


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bexhill Public School (1217)
Region : North Coast
State Electorate : Lismore
Local Government Area : Lismore

Initial Survey : Noel Arnold & Associates : 10 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

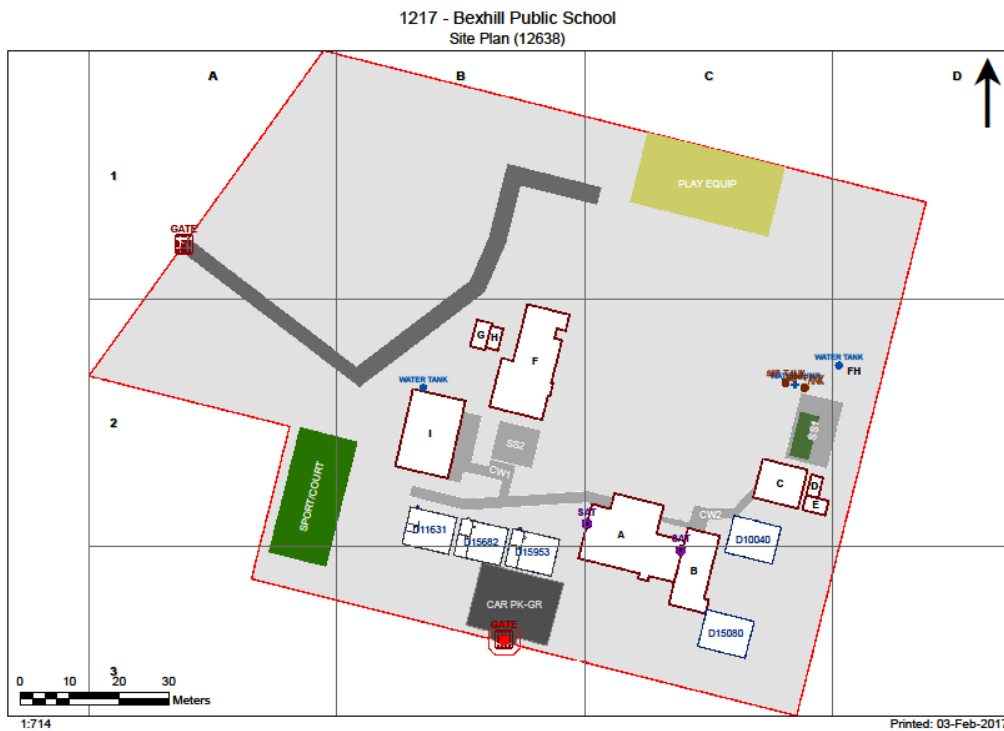

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1915 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
1217/B00A/Underfloor Voids/S7					Chrysotile (white asbestos)	

Interior

B00A - R0001 - Staff Room

No Asbestos

B00A - R0002 - Clerical Office/Workroom

No Asbestos

B00A - R0003 - Movement

No Asbestos

B00A - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	1217/B00A/R0004/Ceiling Structures/Linings/S10			No Asbestos Detected	
----------------------------	------------------	--	--	--	-----------------------------	--

B00A - R0005 - Principal

No Asbestos

B00A - R0006 - Special Programs Room

No Asbestos

B00A - R0007 - Staff Room Annexe

No Asbestos

B00A - R0008 - General Storeroom

No Asbestos

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	1217/B00A/R0009/Ceiling Structures/Linings/S9			No Asbestos Detected	
----------------------------	------------------	---	--	--	-----------------------------	--

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout North & West	Good Condition (1)	Low (1)	Low Priority (2-3)
1217/B00A/R0009/Wall Linings Internal/S3					Chrysotile (white asbestos)	

B00A - R0011 - Staff Toilet

No Asbestos

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1976 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1217/B00B/Eaves Linings/S4					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior

B00B - R0004 - General Storeroom

No Asbestos

B00B - R0006 - Toilets - Girls

No Asbestos

B00B - R0007 - Toilets - Boys

No Asbestos

B00B - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1882 - Timber (Timber)

Exterior

Underfloor Voids	Flat AC Sheeting 1217/B00C/Underfloor Voids/S8					No Asbestos Detected
Ceiling Void	AC Fragments/Debris 1217/B00C/Ceiling Void/S6					No Asbestos Detected

Interior

B00C - R0003 - External Movement

No Asbestos

B00C - R0004 - External Movement

No Asbestos

B00C - R0005 - Canteen Office/Store

No Asbestos

B00C - R0006 - Canteen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 1915 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00D - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1991 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other-After School Care - 1915 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1217/B00F/Eaves Linings/S5					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00F - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1217/B00F/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	3m2	Wall lining to the east south facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1217/B00F/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0002 - Other-After School Care

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0003 - Other-After School Care

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0004 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0005 - Other-After School Care

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0006 - K.L.A. Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0007 - Staff Kitchen

No Asbestos

B00F - R0008 - K.L.A. Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0009 - Staff Shower/Change

No Asbestos

B00F - R0010 - Cleaning Supplies

No Asbestos

B00F - R0011 - Movement

No Asbestos

B00F - R0012 - Staff Toilet

No Asbestos

B00F - R0013 - Laundry - Type 2

No Asbestos

B00F - R0014 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Staff Facilities - 2002 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 1217/B00G/Wall Cladding/S2					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00G - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2002 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - External Movement

No Asbestos

B00I - R0002 - Reading Area

No Asbestos

B00I - R0003 - Library Office/Workroom

No Asbestos

B00I - R0004 - Communications Room

No Asbestos

B00I - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10040 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D11631 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 12/10/2004

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D15080 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D15682 - Learning Unit - Standard/Withdrawal : Placement Date - 21/03/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D15953 - Learning Unit - Standard/Withdrawal : Placement Date - 17/04/2007						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017