


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Bigga Public School (1223)  
**Region :** Illawarra and South East  
**State Electorate :** Goulburn  
**Local Government Area :** Upper Lachlan

**Initial Survey :** Noel Arnold & Associates : 12 - May - 2008  
**Reviewed By :** Greencap-NAA : 25 - Aug - 2016

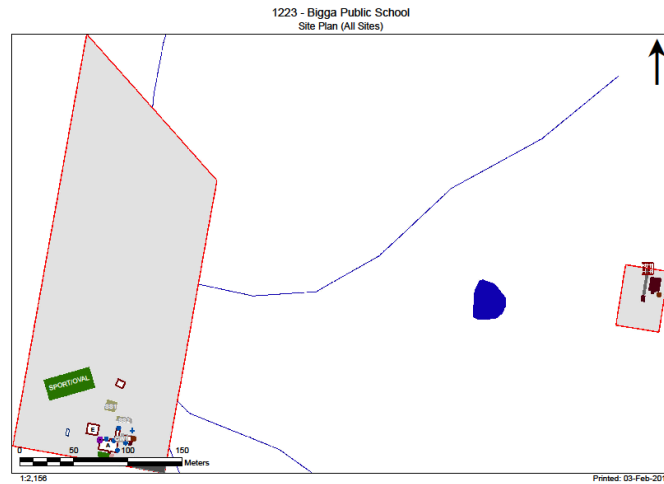

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1916 - Timber (Timber)****Exterior**

Ceiling Voids - Flat Roof Non Accessible Area  
- Height Restriction

Underfloor Voids - Packing to Floor Joists No Asbestos Found

**Interior****B00A - R0001 - Staff Kitchen**

Floor Coverings Res/Textile	Adhesive					
	1223/B00A/R0005/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1223/B00A/R0005/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0002 - Movement**

No Asbestos

**B00A - R0003 - Clerical Office/Workroom**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1223/B00A/R0003/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	1223/B00A/R0003/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>

**B00A - R0004 - Principal**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10.98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1223/B00A/R0005/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	1223/B00A/R0005/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>

**B00A - R0005 - Home Base**

In-fill-panel	Flat AC Sheeting					
	1223/B00A/R0006/In-fill-panel/S1					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	42.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1223/B00A/R0005/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	1223/B00A/R0005/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>

**B00A - R0006 - Home Base**

In-fill-panel	Flat AC Sheeting					
	1223/B00A/R0006/In-fill-panel/S1					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	1223/B00A/R0005/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	42.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1223/B00A/R0005/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0007 - Handwashing Facilities**

No Asbestos

**B00A - R0008 - External Movement**

No Asbestos

**B00A - R0009 - External Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Building Services - 1950 - Timber (Timber)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Wall Cladding	Flat AC Sheeting	20m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1223/B00B/R0001/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1223/B00B/Underfloor Voids/S9					<b>Chrysotile (white asbestos)</b>

**Interior****B00B - R0001 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	6m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1223/B00B/R0001/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00B - R0002 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	20m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1223/B00B/R0001/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Staff Facilities - 1968 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1223/B00C/Eaves Linings/S8	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00C - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting 1223/B00C/R0003/Ceiling Structures/Linings/S7					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00C - R0003 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 1223/B00C/R0003/Ceiling Structures/Linings/S7					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00C - R0004 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 1223/B00C/R0003/Ceiling Structures/Linings/S7					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Building Services - 2001 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00D - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00E - R0001 - External Movement**

No Asbestos

**B00E - R0002 - Reading Area**

No Asbestos

**B00E - R0003 - K.L.A. Store**

No Asbestos

**B00E - R0004 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 971 - D70005 - Shed - Container (Garden/Sports/Bulk) : Placement Date - 23/05/2000**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Garden Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017