


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bilpin Public School (1228)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 12 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

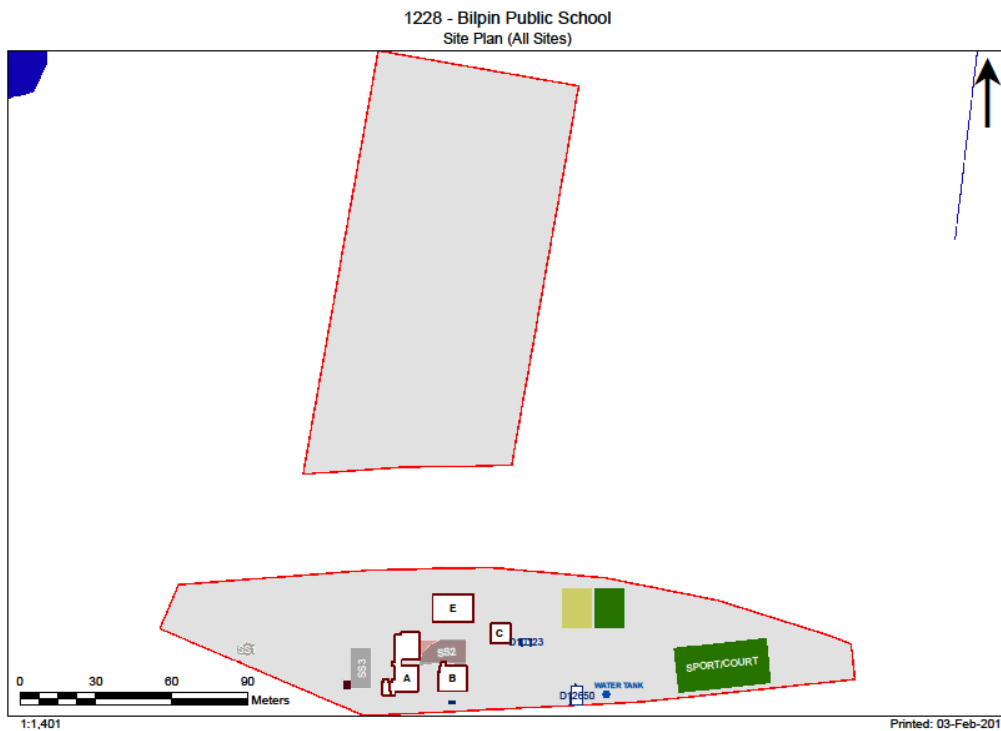

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1967 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00A/Eaves Linings/S4					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	120m2	Upper Portion, South section of House	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1228/B00A/Wall Cladding/S9					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Ceiling Void	Paper					
	1228/B00A/Ceiling Void/S12					No Asbestos Detected

Interior**B00A - R0001 - Staff Room**

No Asbestos

B00A - R0003 - Personal Effects Storage

No Asbestos

B00A - R0004 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00B/R0002/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00A - R0007 - Entry Vestibule

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00A - R0008 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00A - R0009 - Home Base

No Asbestos

B00A - R0010 - Principal

No Asbestos

B00A - R0011 - Clerical Office

No Asbestos

B00A - R0012 - Staff Kitchen

No Asbestos

B00A - R0013 - General Storeroom

No Asbestos

B00A - R9001 - Sports Store

No Asbestos

B00A - R9002 - Garden Store

No Asbestos

B00A - R9003 - Cleaning Distributed Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1965 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00B/Eaves Linings/S5				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Home Base**

No Asbestos

B00B - R0002 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1				Chrysotile (White asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00B/R0002/Floor Coverings Res/Textile/S2				Chrysotile (White asbestos)	

B00B - R0003 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1				Chrysotile (White asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00B/R0002/Floor Coverings Res/Textile/S2				Chrysotile (White asbestos)	

B00B - R0004 - Garden Store

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00B/R0002/Floor Coverings Res/Textile/S2				Chrysotile (White asbestos)	
Electrical Mounting Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00B/R0004/Electrical Mounting Board/S11				Chrysotile (white asbestos)	
Electrical Mounting Board	Millboard	1m2	Throughout	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
	1228/B00B/R0004/Electrical Mounting Board/S10				Chrysotile (white asbestos)	

B00B - R0005 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00B/R0002/Floor Coverings Res/Textile/S2				Chrysotile (White asbestos)	

B00B - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1				Chrysotile (White asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1952 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/Eaves Linings/S6					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting					
	1228/B00C/Gable Verge Lining/S8					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00C - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00C - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00C - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1965 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00D/Eaves Linings/S7					Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	1228/B00D/Wall Cladding/S3					
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0002 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1228/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (White asbestos)

B00D - R0003 - Movement

No Asbestos

B00D - R0004 - Canteen Office/Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0002 - Reading Area

No Asbestos

B00E - R0003 - Library Office/Workroom

No Asbestos

B00E - R0004 - Communications Room

No Asbestos

B00E - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Metal Shed

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 844 - D10123 - Country Toilet - Reltc - Boys/Girls : Placement Date - 26/10/2000

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior

R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

OS 750 - D12650 - Learning Unit - ESL : Placement Date - 26/05/2000

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	5.76 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2

OS 502 - D14464 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 5/12/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Clerical Office						
No Asbestos Found.						
R10 - Store						
No Asbestos Found.						
R2 - Security Store						
No Asbestos Found.						
R3 - Duplicating Wookroom						
No Asbestos Found.						
R4 - Clinic-Waiting						
No Asbestos Found.						
R5 - Staff Room						
No Asbestos Found.						
R6 - Principal						
No Asbestos Found.						
R7 - Staff Toilet						
No Asbestos Found.						
R8 - Staff Toilet						
No Asbestos Found.						
R9 - Entry						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017