


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Binalong Public School (1230)
Region : Riverina
State Electorate : Goulburn
Local Government Area : Yass Valley

Initial Survey : Noel Arnold & Associates : 08 - May - 2008
Reviewed By : Grencap-NAA : 15 - Jun - 2016

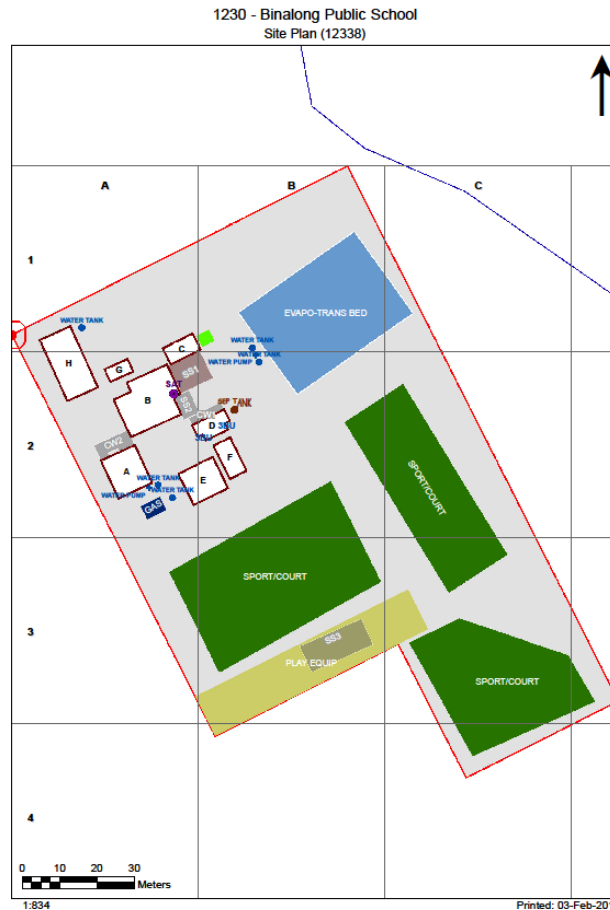

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning - 1960 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1230/B00A/Wall Cladding/S10	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 1230/B00A/Wall Cladding/S10	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior**B00A - R0001 - Principal**

Floor Coverings Res/Textile	Adhesive 1230/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1230/B00A/R0002/Floor Coverings Res/Textile/S7	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0002 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1230/B00A/R0002/Floor Coverings Res/Textile/S7	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive 1230/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0005 - Home Base

Floor Coverings Res/Textile	Adhesive 1230/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1230/B00A/R0002/Floor Coverings Res/Textile/S7	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1230/B00A/R0007/Ceiling Structures/Linings/S9	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0007 - Clerical Office

Ceiling Structures/Linings	Flat AC Sheeting 1230/B00A/R0007/Ceiling Structures/Linings/S9	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/General Learning - 1890 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction 5m height						
Wall Cladding	Flat AC Sheeting 1230/B00B/R0008/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00B - R0001 - Cleaning Distributed Store**

Wall Linings Internal	Flat AC Sheeting 1230/B00B/R0008/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Reading Area

No Asbestos

B00B - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 1230/B00B/R0005/Floor Coverings Res/Textile/S2	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1230/B00B/R0005/Floor Coverings Res/Textile/S12					No Asbestos Detected

B00B - R0005 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 1230/B00B/R0005/Floor Coverings Res/Textile/S2	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1230/B00B/R0005/Floor Coverings Res/Textile/S12					No Asbestos Detected

B00B - R0006 - Movement

No Asbestos

B00B - R0008 - Sports Store

Wall Linings Internal	Flat AC Sheeting 1230/B00B/R0008/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00B - R0009 - External Movement

No Asbestos

B00B - R0010 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Music - 1955 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	8m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00C/R0002/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	

Interior

B00C - R0001 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00C/R0002/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	

B00C - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00C/R0002/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - Pupil Facilities - 1966 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00D - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Door In-fill-panel	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Door In-fill-panel	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1230/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0005 - Toilet - Lobby

No Asbestos

B00D - R0006 - Toilet - Lobby

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Communal Space

No Asbestos

B00E - R0002 - General Storeroom

No Asbestos

B00E - R0003 - Practical Activities

No Asbestos

B00E - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - 2012 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00F - R0002 - Sports Store

No Asbestos

B00F - R0003 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration - 1960 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1230/B00G/Eaves Linings/S11	2m2	North & South	Good Condition (1)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos)

Interior

B00G - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2014 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Communal Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017