


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Binda Public School (1231)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Upper Lachlan

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Aug - 2016

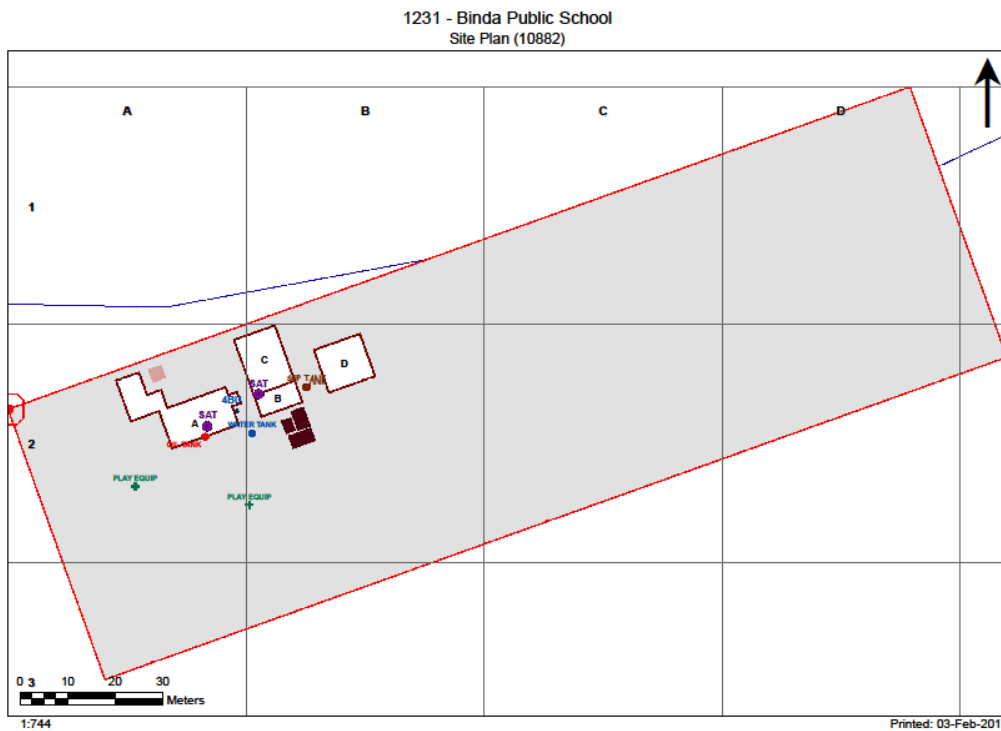

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1950 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1231/B00A/Eaves Linings/S4					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Void	No Asbestos Found					

Interior**B00A - R0001 - Staff Kitchen**

Floor Coverings Res/Textile	Vinyl Tiles 1231/B00A/R0001/Floor Coverings Res/Textile/S1	8m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Movement

No Asbestos

B00A - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting 1231/B00A/R0004/Wall Linings Internal/S2	2m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0005 - Withdrawal Space - 1hb

No Asbestos

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Entry Vestibule

Ceiling Structures/Linings	Flat AC Sheeting 1231/B00A/R0009/Ceiling Structures/Linings/S5					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00A - R0008 - Clerical Office/Workroom

Ceiling Structures/Linings	Flat AC Sheeting 1231/B00A/R0009/Ceiling Structures/Linings/S5					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00A - R0009 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 1231/B00A/R0009/Ceiling Structures/Linings/S5					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00A - R0010 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1959 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1231/B00B/Eaves Linings/S3					Chrysotile (white asbestos)

Interior**B00B - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1231/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00B - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1231/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00B - R0004 - Toilet - Lobby

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1231/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00B - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1231/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1997 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Multi Purpose Facilities - 2010 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Communal Space

No Asbestos

B00D - R0002 - Staff Kitchen

No Asbestos

B00D - R0003 - Hall Chair Store

No Asbestos

B00D - R0004 - General Storeroom

No Asbestos

B00D - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017