


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Binnaway Central School (1237)  
**Region :** Western NSW  
**State Electorate :** Barwon  
**Local Government Area :** Warrumbungle

**Initial Survey :** Noel Arnold & Associates : 29 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

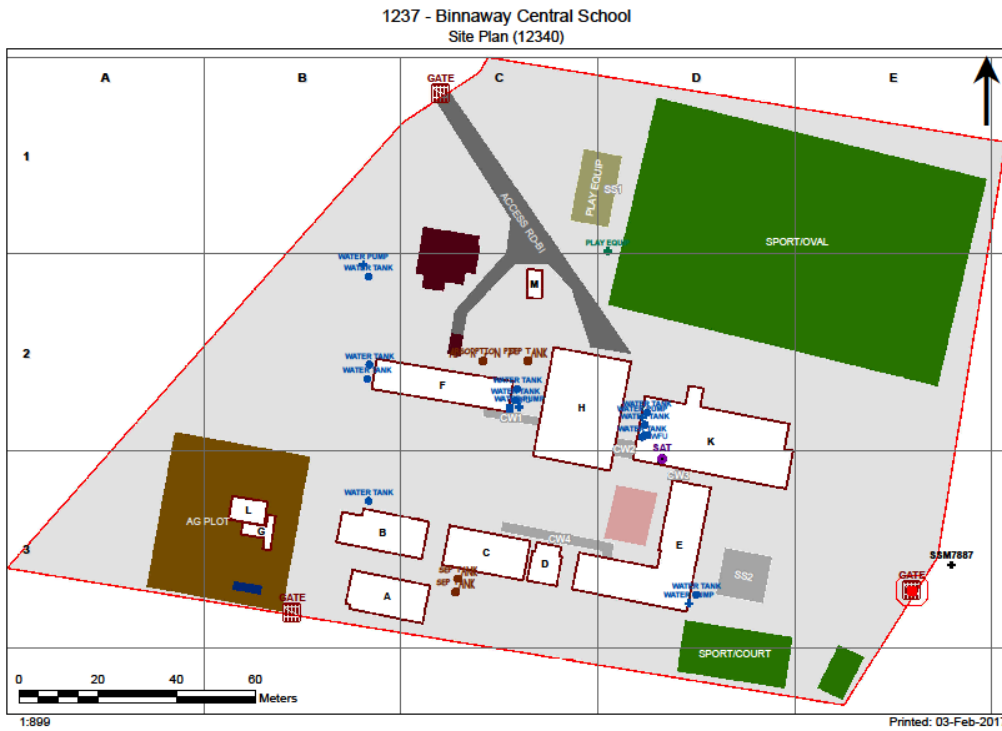

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Technological & Applied Studies - 1965 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00B/Eaves Linings/S6				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Void	Non Accessible Area - No Access - No Manhole in building					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0002 - Resource/Project Store (6.12 m2)**

No Asbestos

**B00A - R0003 - Seminar/Technology Space (6.12 m2)**

No Asbestos

**B00A - R0004 - Food Technology L.S. (65.58 m2)**

No Asbestos

**B00A - R0005 - Food/Research Space (9.24 m2)**

No Asbestos

**B00A - R0006 - Movement (9.19 m2)**

No Asbestos

**B00A - R0007 - General Storeroom (16.09 m2)**

No Asbestos

**B00A - R0008 - Darkroom Space (16.18 m2)**

No Asbestos

**B00A - R0009 - Distribution Board (0.16 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0010 - External Movement (44.05 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00B/R0005/Ceiling Structures/Linings/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Technological & Applied Studies - 1953 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00B/Eaves Linings/S6				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Void	Non Accessible Area - No Access - No Manhole in building					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0005 - External Movement (27.36 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00B/R0005/Ceiling Structures/Linings/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00B - R0006 - Plant (2.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00B/R0005/Ceiling Structures/Linings/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00B - R0007 - Workshop Area (119.91 m2)**

No Asbestos

**B00B - R0008 - Welding Area (3.42 m2)**

No Asbestos

**B00B - R0009 - Materials Store (31.42 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Science Learning - 1977 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00E/Eaves Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Cleaning Distributed Store (2 m2)**

Non Accessible

**B00C - R0002 - Movement (47.68 m2)**

No Asbestos

**B00C - R0003 - General Learning Space (52.27 m2)**

No Asbestos

**B00C - R0004 - Laboratory L.S. (69.54 m2)**

No Asbestos

**B00C - R0005 - Chemical Store (6.48 m2)**

No Asbestos

**B00C - R0006 - Preparation (19.55 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1962 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00E/Eaves Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Movement (13.73 m2)**

No Asbestos

**B00D - R0002 - General Learning Space (53.51 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1924 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00E/Eaves Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00E - R0001 - Movement (101.68 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	102m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - General Learning Space (15.51 m2)**

No Asbestos

**B00E - R0003 - General Storeroom (10.74 m2)**

No Asbestos

**B00E - R0004 - Home Base (67.15 m2)**

No Asbestos

**B00E - R0005 - Craft Store (14.85 m2)**

No Asbestos

**B00E - R0006 - Practical Activities - 1hb (16 m2)**

No Asbestos

**B00E - R0007 - Home Base (43.56 m2)**

No Asbestos

**B00E - R0008 - Home Base (43.69 m2)**

No Asbestos

**B00E - R0009 - Toilets - Boys/Girls (4.27 m2)**

No Asbestos

**B00E - R0010 - Cleaning Distributed Store (6.39 m2)**

No Asbestos

**B00E - R0011 - General Learning Space (47.43 m2)**

No Asbestos

**B00E - R0012 - General Learning Space (31.96 m2)**

No Asbestos

**B00E - R0013 - Practical Activities - 1hb (15.06 m2)**

No Asbestos

**B00E - R0014 - Home Base Store (3.63 m2)**

No Asbestos

**B00E - R0015 - General Storeroom (17.98 m2)**

No Asbestos

**B00E - R0016 - Sports Store (21 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00F - Pupil Facilities - 1967 - Brick/Veneer (Brick/Veneer)</b>						
<b>Exterior</b>						
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00F/Eaves Linings/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Void	No Asbestos Found					
Flue Pipe Through Roof	Fibre Cement Pipe	4m	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1237/B00F/Flue Pipe Through Roof/S16				<b>Chrysotile (white asbestos)</b>	
<b>Interior</b>						
<b>B00F - R0001 - Movement (72.06 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0002 - Toilets - Boys (31.4 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00F/R0002/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00F - R0003 - Shower/Change (32.41 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00F/R0002/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Flue Pipe from Boiler	Fibre Cement Pipe	1m	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1237/B00F/R0003/Flue Pipe from Boiler/S15				<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0004 - Toilets - Girls (29.16 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00F/R0002/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00F - R0005 - Toilets - Girls (23.88 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00F/R0002/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00F - R0006 - Shower/Change (31.98 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00F/R0002/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Flue Pipe from Boiler	Fibre Cement Pipe	1m	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
1237/B00F/R0003/Flue Pipe from Boiler/S15				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R0007 - Toilets - Boys (28.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00K/R0001/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00F/R0002/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Agricultural Science - 1953 - Timber (Timber)**

**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Ground Area	AC Fragments/Debris 1237/B00G/Ground Area/S12					<b>No Asbestos Detected</b>

**Interior**

**B00G - R0001 - Class Tools Storage (8.06 m2)**

No Asbestos

**B00G - R0002 - Animal Space (5.4 m2)**

No Asbestos

**B00G - R0003 - Garden Store (17.11 m2)**

No Asbestos

**B00G - R0004 - Animal Space (1.62 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Multi Purpose Facilities - 1924 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00H/Eaves Linings/S9				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1237/B00H/Gable Verge Lining/S10				Chrysotile (white asbestos)	

**Interior**

**B00H - R0001 - Movement (210.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	211m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	

**B00H - R0002 - Canteen (32.09 m2)**

No Asbestos

**B00H - R0003 - Cleaning Distributed Store (2.9 m2)**

No Asbestos

**B00H - R0004 - Staff Toilet (2.59 m2)**

No Asbestos

**B00H - R0005 - General Storeroom (5.07 m2)**

No Asbestos

**B00H - R0006 - Movement (24.75 m2)**

No Asbestos

**B00H - R0007 - Distribution Board (0.45 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0008 - Raised Platform (39.49 m2)**

No Asbestos

**B00H - R0009 - Multi-Purpose Space (152.06 m2)**

No Asbestos

**B00H - R0010 - Sports Store (14.53 m2)**

No Asbestos

**B00H - R0011 - Hall Chair Store (14.57 m2)**

No Asbestos

**B00H - R0012 - Garden Store (14.57 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00K - Administration/Library - 1977 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/Gable Verge Lining/S11					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					
<b>Interior</b>						
<b>B00K - R0001 - External Movement (214.88 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	215m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
<b>B00K - R0002 - Public Entry (17.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00K - R0003 - Community Clinic (8.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0003/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
<b>B00K - R0004 - Clerical Office (12.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00K - R0005 - Duplicating Workroom (19.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0003/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
<b>B00K - R0006 - Principal (18.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00K - R0007 - Deputy Principal (14.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
<b>B00K - R0008 - Sports Store (4.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0003/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
<b>B00K - R0009 - Cleaning Supplies (10.21 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0011 - Staff Room Annexe (22.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00K - R0012 - Cleaning Distributed Store (2.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0014 - Movement (6.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0016 - Interview (12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0017 - Movement (19.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0018 - General Storeroom (5.63 m2)</b>						
No Asbestos						
<b>B00K - R0019 - Distribution Board (0.54 m2)</b>						
No Asbestos						
Note: No inspection of live electrical installation.						
<b>B00K - R0020 - Withdrawal Space - 1hb (10.44 m2)</b>						
No Asbestos						
<b>B00K - R0021 - Computer Learning Space (70.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0022 - Practical Activities - 1hb (12.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00K - R0023 - Security Store (7.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0002/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0003/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
<b>B00K - R0024 - Staff Kitchen (3.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0029/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	1237/B00K/R0024/Floor Coverings Res/Textile/S18					No Asbestos Detected
<b>B00K - R0025 - Commonroom (53.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0029/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0026 - Toilet - Lobby (1.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0029/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0027 - Staff - Toilet (2.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0029/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0028 - Toilet - Lobby (2.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0029/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0029 - Staff - Toilet (2.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	1237/B00K/R0029/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00K - R0030 - External Stairs (17.89 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0031/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)
<b>B00K - R0031 - Stairs (7.77 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R0031/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)
<b>B00K - R1001 - Seminar/Study (9.66 m2)</b>						
No Asbestos						
<b>B00K - R1002 - Seminar/Study (9.66 m2)</b>						
No Asbestos						
<b>B00K - R1003 - Reading Area (176.08 m2)</b>						
No Asbestos						
<b>B00K - R1004 - Communications Room (17.65 m2)</b>						
No Asbestos						
<b>B00K - R1005 - Library Office/Workroom (12.83 m2)</b>						
No Asbestos						
<b>B00K - R1006 - Library Office/Workroom (8.81 m2)</b>						
No Asbestos						
<b>B00K - R1007 - Distribution Board (2.95 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00K - R1008 - Movement (12.17 m2)</b>						
No Asbestos						
<b>B00K - R1009 - Cleaning Distributed Store (2.71 m2)</b>						
No Asbestos						
<b>B00K - R1010 - Toilets - Girls (3.71 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1237/B00K/R1010/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00K - R1011 - Toilets - Boys (3.67 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00K/R1010/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00K - R1012 - Practical Activities - 1hb (12.45 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00K/R0003/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00K - R1013 - Home Base (70.79 m2)</b>						
No Asbestos						
<b>B00K - R1014 - External Movement (68.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00K/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00K - R1015 - Stairs (12.67 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00K/R0031/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos)</b>	
<b>B00K - R1016 - External Stairs (17.89 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1237/B00K/R0031/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Agricultural Science - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00L - R0001 - Machine Storage (51.69 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Building Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00M - R0001 - General Assistants (25.24 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017