


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blackville Public School (1252)
Region : New England
State Electorate : Upper Hunter
Local Government Area : Liverpool Plains

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Greencap-NAA : 14 - Apr - 2016

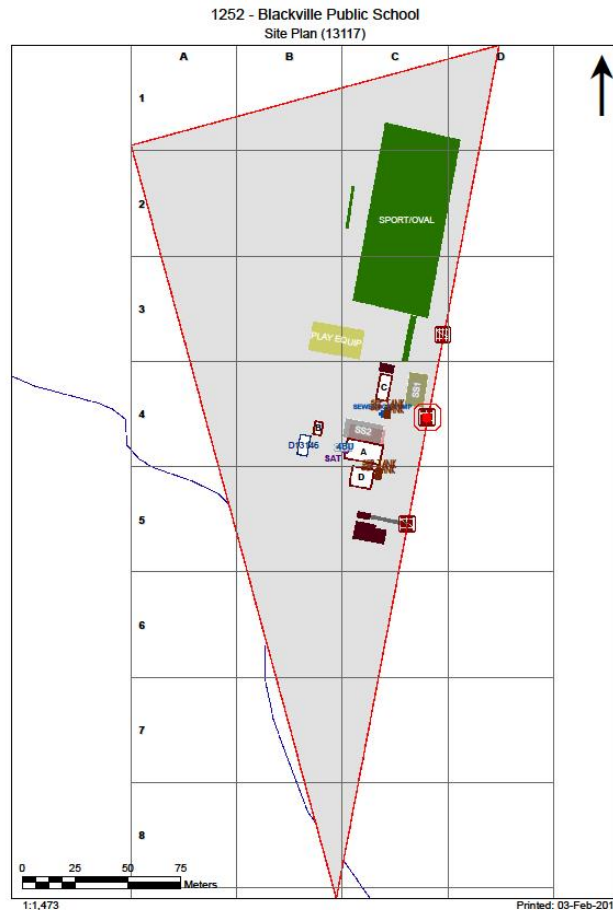

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1990 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Eaves Linings	Flat AC Sheeting 1252/B00A/Eaves Linings/S4					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 1252/B00A/Wall Cladding/S3					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior**B00A - R0002 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet 1252/B00A/R0002/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1252/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet 1252/B00A/R0002/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1252/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0004 - Clerical Office/Workroom

Wall Linings Internal	Flat AC Sheeting 1252/B00A/R0004/Wall Linings Internal/S6					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 1252/B00A/R0002/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1252/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1252/B00A/R0004/Wall Linings Internal/S6					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 1252/B00A/R0002/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1252/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0006 - Sick Bay

Floor Coverings Res/Textile	Vinyl Sheet 1252/B00A/R0002/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1252/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0007 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
--	-------------------	--	--	--	--	--

B00A - R0008 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
--	-------------------	--	--	--	--	--

B00A - R0009 - Practical Activities - 1hb

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Sheet					
	1252/B00A/R0002/Floor Coverings Res/Textile/S7					No Asbestos Detected

Floor Coverings Res/Textile	Adhesive					
	1252/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0010 - Home Base Store

No Asbestos

B00A - R0011 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1970 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1252/B00C/Eaves Linings/S1					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole - Ceiling height approx 3.5m					

Interior**B00C - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1252/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed unit					

B00C - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1252/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1252/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
Incinerette	Encapsulated Insulation material within unit	1m2	Northwest within staff toilet cubicle	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - sealed unit					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00D - R0001 - Reading Area

No Asbestos

B00D - R0002 - K.L.A. Store

No Asbestos

B00D - R0003 - Practical Activities

No Asbestos

B00D - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Storage Garage (greater than 2000)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00E - R0001 - Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

NS 020 - D13146 - Staff Study/Store : Placement Date - 3/03/2004

Exterior

No Asbestos Found.

Interior

R1 - Staff Room

No Asbestos Found.

R2 - Store

No Asbestos Found.

R3 - Entry

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017