


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blakehurst Public School (1255)
Region : Sydney
State Electorate : Kogarah
Local Government Area : Kogarah

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

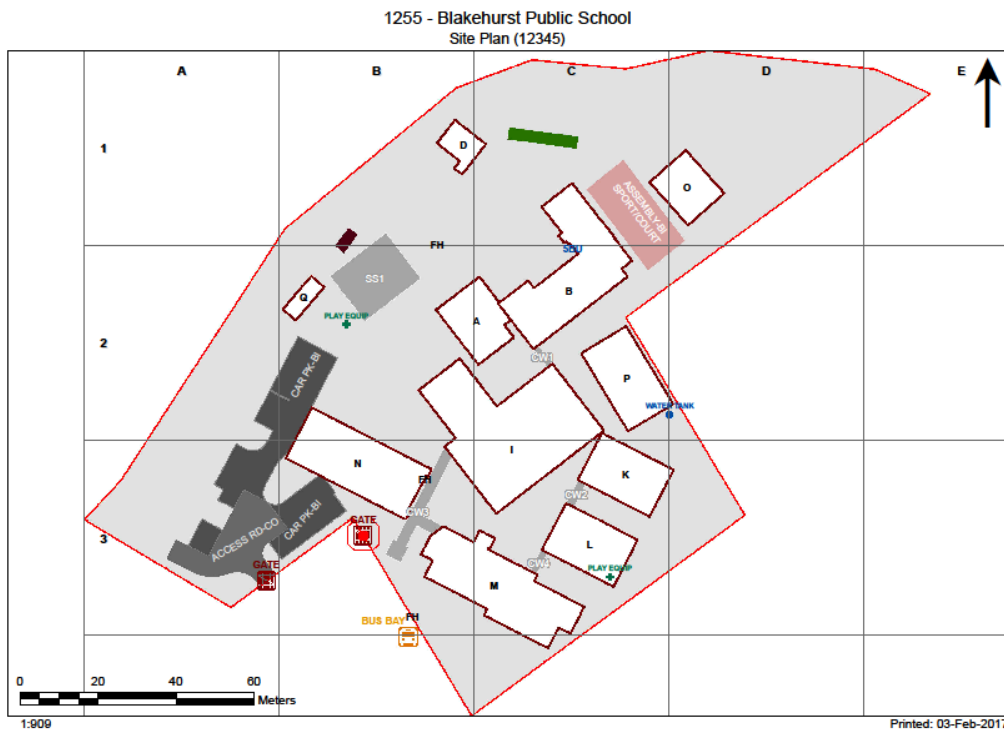

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1948 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	3m	North-East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1255/B00A/Gable Verge Lining/S7					Chrysotile (white asbestos)	

Interior

B00A - R0001 - External Movement						
No Asbestos						
B00A - R0002 - Duplicating Workroom						
No Asbestos						
B00A - R0003 - General Storeroom						
No Asbestos						
B00A - R0004 - Staff Room Annexe						
No Asbestos						
B00A - R0006 - Entry Vestibule						
No Asbestos						
B00A - R0007 - Staff Room Annexe						
No Asbestos						
B00A - R0008 - Principal						
No Asbestos						
B00A - R0009 - Clerical Office						
No Asbestos						
B00A - R0010 - Clerical Office						
No Asbestos						
B00A - R0011 - Movement						
No Asbestos						
B00A - R0012 - Staff Toilet						
No Asbestos						
B00A - R0014 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Above door	Good Condition (1)	Low (1)	Low Priority (2-3)
1255/B00A/R0014/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/General Learning - 1936 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids	Non Accessible Area - No Access - No manhole found in Building

Interior**B00B - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	9m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00B/R0002/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00B/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00B - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00B/R0002/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Above false ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00B/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00B - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00B/R0004/Ceiling Structures/Linings/S4				Insufficient Sample	

B00B - R0012 - General Storeroom

No Asbestos

B00B - R0014 - External Movement

No Asbestos

B00B - R0015 - Staff Toilet

No Asbestos

B00B - R0018 - External Movement

No Asbestos

B00B - R0024 - Library Office/Workroom

No Asbestos

B00B - R0025 - K.L.A. Store

No Asbestos

B00B - R0026 - Movement

No Asbestos

B00B - R0027 - Practical Activities - 2hb

No Asbestos

B00B - R0028 - Home Base Store

No Asbestos

B00B - R0029 - Withdrawal Space - 1hb

No Asbestos

B00B - R0030 - Home Base

No Asbestos

B00B - R0031 - Home Base

No Asbestos

B00B - R0032 - Home Base Store

No Asbestos

B00B - R0033 - Withdrawal Space - 1hb

No Asbestos

B00B - R0035 - No Access

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R0036 - Reading Area

No Asbestos

B00B - R0037 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1948 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00D/Eaves Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Cleaning Distributed Store**

No Asbestos

B00D - R0006 - Withdrawal Space - 1hb

No Asbestos

B00D - R0007 - Toilets - Boys/Girls

No Asbestos

B00D - R0008 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00D/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00D - R0009 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	0.5m2	Above sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00D/R0009/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00D - R0010 - Staff Room Annexe

No Asbestos

B00D - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00D/Eaves Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1255/B00D/Eaves Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities/Pupil Facilities - 1962 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B00I - R0002 - General Storeroom**

No Asbestos

B00I - R0004 - Communal Space

No Asbestos

B00I - R0005 - Hall Chair Store

No Asbestos

B00I - R0006 - Movement

No Asbestos

B00I - R0007 - Out Of School Hours Care Centre

No Asbestos

B00I - R0008 - Toilets - Boys

No Asbestos

B00I - R0010 - Toilets - Girls

No Asbestos

B00I - R0014 - External Movement

No Asbestos

B00I - R0015 - Disabled Toilet

No Asbestos

B00I - R0016 - General Assistant/Bulk Store

No Asbestos

B00I - R0017 - Security Store

No Asbestos

B00I - R0018 - Canteen

No Asbestos

B00I - R0019 - Toilets - Girls

No Asbestos

B00I - R0020 - Plant

No Asbestos

B00I - R0021 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0022 - Toilets - Boys

No Asbestos

B00I - R0023 - Hall Chair Store

No Asbestos

B00I - R0024 - Kiln Room

No Asbestos

B00I - R0025 - General Assistant/Bulk Store

No Asbestos

B00I - R0026 - Raised Platform

No Asbestos

B00I - R0027 - Movement

No Asbestos

B00I - R0028 - Covered Outdoor Learning Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 2002 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00K - R0001 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0002 - Home Base Store

No Asbestos

B00K - R0003 - Practical Activities - 1hb

No Asbestos

B00K - R0004 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0006 - Home Base Store

No Asbestos

B00K - R0007 - Practical Activities - 1hb

No Asbestos

B00K - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0009 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2002 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00L - R0001 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0002 - Home Base Store

No Asbestos

B00L - R0003 - Practical Activities - 1hb

No Asbestos

B00L - R0004 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0006 - Home Base Store

No Asbestos

B00L - R0007 - Practical Activities - 1hb

No Asbestos

B00L - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0009 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2005 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00M - R0001 - Staff Toilet**

No Asbestos

B00M - R0002 - Practical Activities - 1hb

No Asbestos

B00M - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0008 - Practical Activities - 1hb

No Asbestos

B00M - R0009 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0010 - Practical Activities - 1hb

No Asbestos

B00M - R0011 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0012 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0013 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0014 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0015 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0016 - Practical Activities - 1hb

No Asbestos

B00M - R0017 - Cleaning Distributed Store

No Asbestos

B00M - R0018 - External Movement

No Asbestos

B00M - R0019 - External Stairs

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00M - R0020 - Movement						
No Asbestos						
B00M - R0021 - Lift						
No Asbestos						
B00M - R0022 - External Stairs						
No Asbestos						
B00M - R1001 - Practical Activities - 1hb						
No Asbestos						
B00M - R1002 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1003 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1004 - Withdrawal Space - 2hb						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1005 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1006 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1007 - Practical Activities - 1hb						
No Asbestos						
B00M - R1008 - Distribution Board Cupboard						
No Asbestos					Note: No inspection of live electrical installation.	
B00M - R1009 - Practical Activities - 1hb						
No Asbestos						
B00M - R1010 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1011 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1012 - Withdrawal Space - 2hb						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1013 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1014 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00M - R1015 - Practical Activities - 1hb						
No Asbestos						
B00M - R1016 - External Stairs						
No Asbestos						
B00M - R1017 - External Movement						
No Asbestos						
B00M - R1018 - Movement						
No Asbestos						
B00M - R1019 - Lift						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - R1020 - Plant

No Asbestos

B00M - R1021 - External Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Administration/Staff Facilities - 2004 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00N - R0001 - Clerical Office**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0002 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0003 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0004 - Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0005 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0006 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0007 - Main Switch Board

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0008 - Cleaning Distributed Store

No Asbestos

B00N - R0009 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0010 - General Assistant/Bulk Store

No Asbestos

B00N - R0011 - General Assistant/Bulk Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0012 - Cleaning Supplies

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0013 - Sports Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0014 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0015 - Staff Kitchen

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0016 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0017 - Staff Toilet

No Asbestos

B00N - R0018 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00N - R0019 - Staff Toilet

No Asbestos

B00N - R0020 - Security Store

No Asbestos

B00N - R0021 - Sick Bay - Shower/Toilet

No Asbestos

B00N - R0022 - Sick Bay

No Asbestos

B00N - R0023 - Clerical Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0024 - External Movement

No Asbestos

B00N - R0025 - External Movement

No Asbestos

B00N - R0026 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Special Purpose - 2004 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris					
	1255/B000/Underfloor Voids/S8					No Asbestos Detected

Interior

B000 - R0001 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0002 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0003 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0004 - External Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00P - R0001 - External Movement	No Asbestos
B00P - R0002 - Special Programs Store	No Asbestos
B00P - R0003 - Special Programs Store	No Asbestos
B00P - R0004 - Special Programs Room - Type 2	No Asbestos
B00P - R0005 - Movement	No Asbestos
B00P - R0006 - Practical Activities - 1hb	No Asbestos
B00P - R0007 - Home Base Store	No Asbestos
B00P - R0008 - Home Base	No Asbestos
B00P - R0009 - Withdrawal Space - 2hb	No Asbestos
B00P - R0010 - Home Base	No Asbestos
B00P - R0011 - Home Base Store	No Asbestos
B00P - R0012 - Practical Activities - 1hb	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Other - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00Q - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1255_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017