


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blandford Public School (1256)
Region : Hunter/Central Coast
State Electorate : Upper Hunter
Local Government Area : Upper Hunter

Initial Survey : Noel Arnold & Associates : 03 - May - 2008
Reviewed By : Grencap-NAA : 16 - Jun - 2015

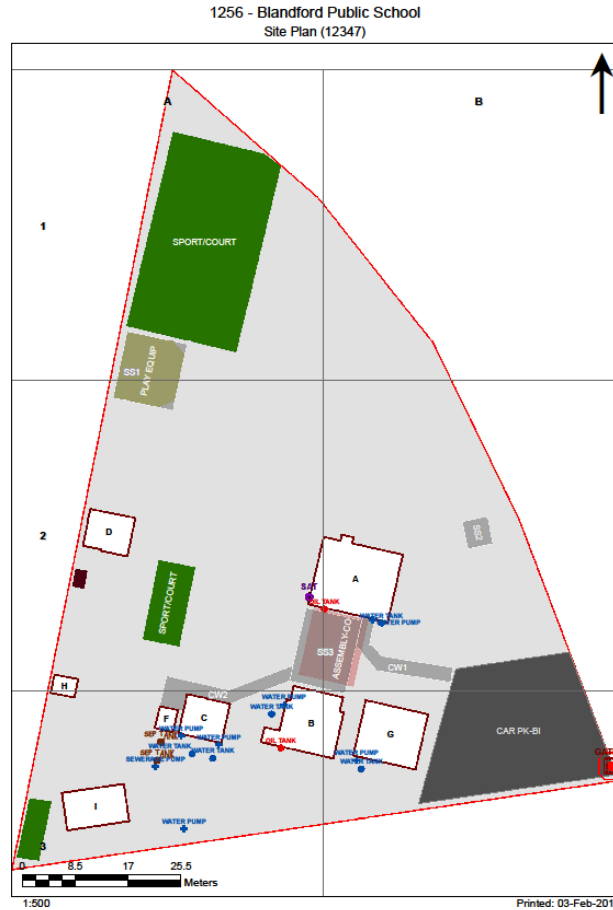

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1913 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00A/R0004/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
	1256/B00A/R0001/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0002 - Clerical Office

No Asbestos

B00A - R0003 - Movement

Wall Linings Internal	Flat AC Sheeting					
	1256/B00A/R0003/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	1256/B00A/R0003/Ceiling Structures/Linings/S2					No Asbestos Detected

B00A - R0004 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00A/R0004/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00A - R0005 - Library Office/Workroom

Ceiling Structures/Linings	Flat AC Sheeting					
	1256/B00A/R0003/Ceiling Structures/Linings/S2					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00A/R0005/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1256/B00A/R0005/Floor Coverings Res/Textile/S12					No Asbestos Detected

B00A - R0006 - Principal

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00A/R0004/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	1256/B00A/R0005/Floor Coverings Res/Textile/S12					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00A/R0005/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00A - R0007 - Interview

Ceiling Structures/Linings	Flat AC Sheeting					
	1256/B00A/R0003/Ceiling Structures/Linings/S2					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	1256/B00A/R0005/Floor Coverings Res/Textile/S12					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00A/R0005/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00A - R0008 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings
Res/Textile

Vinyl Sheet

1256/B00A/R0008/Floor Coverings Res/Textile/S4

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1913 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Obstructed Area - To tight to access with ladder					
Eaves Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00B/R0001/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Obstructed Area - To tight to access with ladder					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00B/R0001/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting 1256/B00B/R0001/Wall Linings Internal/S5					No Asbestos Detected

B00B - R0002 - Home Base

Heater Surround	Flat AC Sheeting	5m2	South, East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00B/R0002/Heater backboard/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Space Access Panel	Flat AC Sheeting	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction - Extreme Access					
Ceiling Structures/Linings	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1256/B00B/R0001/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof Non Accessible Area
- Area inaccessible

Underfloor Voids - Slab on Ground Non Accessible Area
- Area inaccessible

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1256/B00C/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00C - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1256/B00C/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet				No Asbestos Detected	
1256/B00C/R0003/Partition Walls (Cubicles)/S7						

B00C - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1256/B00C/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet				No Asbestos Detected	
1256/B00C/R0003/Partition Walls (Cubicles)/S7						

B00C - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1256/B00C/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet				No Asbestos Detected	
1256/B00C/R0003/Partition Walls (Cubicles)/S7						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00D - R0003 - P.E. Store

No Asbestos

B00D - R0004 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Staff Facilities - 2004 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Staff Toilet

No Asbestos

B00F - R0002 - Staff Toilet

No Asbestos

B00F - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - External Movement

No Asbestos

B00G - R0002 - Home Base

No Asbestos

B00G - R0003 - Home Base Store

No Asbestos

B00G - R0004 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Storage - 2009 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00H - R0001 - External Movement

No Asbestos

B00H - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Storage - 2010 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B001 - R0001 - General Storeroom

No Asbestos

B001 - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017