


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blaxcell Street Public School (1257)
Region : South Western Sydney
State Electorate : Auburn
Local Government Area : Parramatta

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Jul - 2015

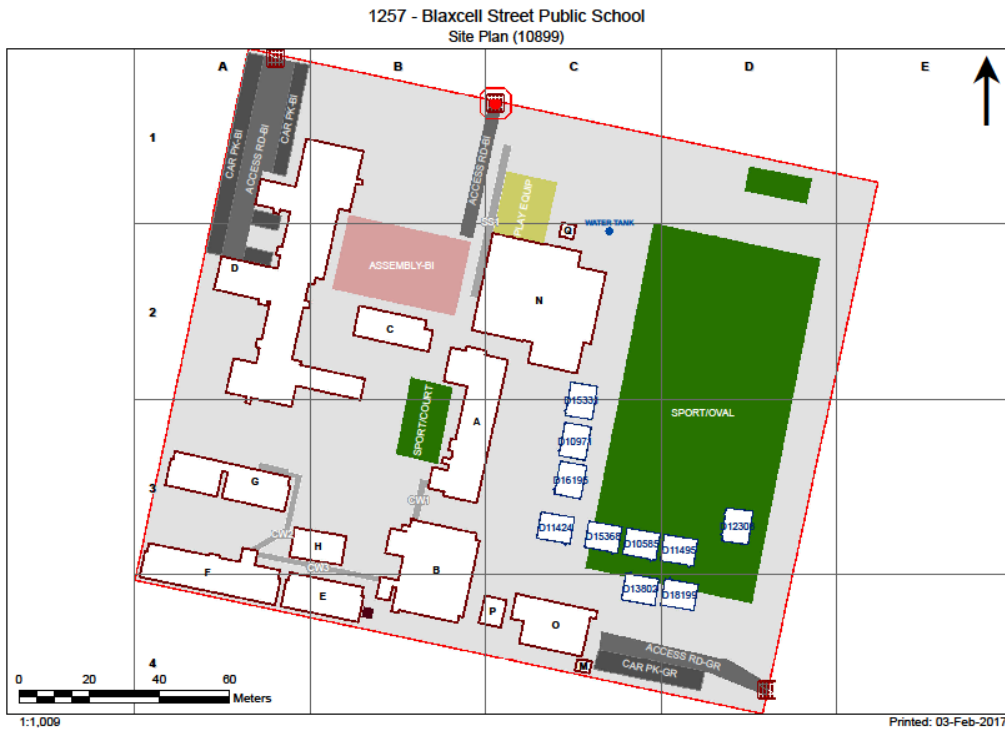

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1938 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	1257/B00A/Underfloor Voids - Packing to Floor Joists/S15					No Asbestos Detected

Interior**B00A - R0004 - Clerical Office (47.16 m2)**

No Asbestos

B00A - R0005 - Special Programs Room (46.86 m2)

No Asbestos

B00A - R0006 - Home Base (47.09 m2)

No Asbestos

B00A - R0007 - Security Store (9.07 m2)

No Asbestos

B00A - R0008 - Movement (73.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00A/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0011 - Movement (1.89 m2)

No Asbestos

B00A - R0012 - Deputy Principal (12.91 m2)

No Asbestos

B00A - R0013 - Staff Toilet (6.14 m2)

No Asbestos

B00A - R0014 - Deputy Principal (15.85 m2)

No Asbestos

B00A - R0015 - Movement (10.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00A/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0016 - Cleaning Distributed Store (5.31 m2)

No Asbestos

B00A - R0017 - Movement (1.84 m2)

No Asbestos

B00A - R0018 - Movement (1.84 m2)

No Asbestos

B00A - R0019 - Entry Vestibule (19.58 m2)

No Asbestos

B00A - R0024 - Movement (4.4 m2)

No Asbestos

B00A - R0025 - Principal (16.6 m2)

No Asbestos

B00A - R0026 - Clerical Office (18.43 m2)

No Asbestos

B00A - R0027 - Sick Bay (6.24 m2)

No Asbestos

B00A - R0028 - Duplicating Workroom (39.58 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00A/R0028/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00A - R0029 - Stairs (3.08 m2)						
No Asbestos						
B00A - R0030 - Stairs (5.21 m2)						
No Asbestos						
B00A - R0031 - Movement (19.25 m2)						
No Asbestos						
B00A - R0032 - Stairs (3.76 m2)						
No Asbestos						
B00A - R0033 - Lift (1.32 m2)						
No Asbestos						
B00A - R0034 - Staff Toilet (3.07 m2)						
Wall Linings Internal	Flat AC Sheeting					
	1257/B00A/R0034/Wall Linings Internal/S23					No Asbestos Detected
B00A - R0035 - Toilet - Lobby (3.07 m2)						
Wall Linings Internal	Flat AC Sheeting					
	1257/B00A/R0034/Wall Linings Internal/S23					No Asbestos Detected
B00A - R1001 - Home Base (48.81 m2)						
No Asbestos						
B00A - R1002 - Home Base (46.93 m2)						
No Asbestos						
B00A - R1003 - Home Base (46.86 m2)						
No Asbestos						
B00A - R1004 - Home Base (47.51 m2)						
No Asbestos						
B00A - R1005 - Special Programs Room (47.87 m2)						
No Asbestos						
B00A - R1007 - Movement (4.78 m2)						
No Asbestos						
B00A - R1009 - Interview (12.53 m2)						
No Asbestos						
B00A - R1011 - Cleaning Distributed Store (1.56 m2)						
No Asbestos						
B00A - R1013 - Stairs (15.17 m2)						
No Asbestos						
B00A - R1014 - General Storeroom (11.28 m2)						
No Asbestos						
B00A - R1015 - Movement (100.03 m2)						
No Asbestos						
B00A - R1016 - Stairs (16.01 m2)						
No Asbestos						
B00A - R1017 - Stairs (17.78 m2)						
No Asbestos						
B00A - R1018 - Toilet - Lobby (3.53 m2)						
No Asbestos						
B00A - R1019 - Toilets - Boys/Girls (1.37 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R1020 - Toilet - Lobby (1.72 m2)

No Asbestos

B00A - R1021 - Staff Toilet (2.9 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/General Learning - 1976 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00B - R0001 - Movement (59.35 m2)**

No Asbestos

B00B - R0002 - Home Base (49.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	50m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0003 - Practical Activities - 1hb (15.49 m2)

Ceiling Structures/Linings	Vermiculite	16m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00B - R0004 - Practical Activities - 1hb (15.57 m2)

Ceiling Structures/Linings	Vermiculite	16m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00B - R0005 - Home Base (49.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	50m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0006 - Movement (59.62 m2)

No Asbestos

B00B - R0007 - Home Base (50.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	51m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00B - R0008 - Practical Activities - 1hb (15.74 m2)

Ceiling Structures/Linings	Vermiculite	16m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00B - R0009 - Movement (95.66 m2)

No Asbestos

B00B - R0010 - Toilets - Boys (13.8 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0011 - Toilets - Girls (11.11 m2)						
No Asbestos						
B00B - R0012 - Practical Activities - 1hb (15.36 m2)						
Ceiling Structures/Linings	Vermiculite	16m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R0013 - Home Base (50.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	50m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	1257/B00B/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B00B - R0014 - Cleaning Distributed Store (2.11 m2)						
No Asbestos						
B00B - R0015 - Stairs (10.15 m2)						
No Asbestos						
B00B - R0016 - Lift (1.37 m2)						
No Asbestos						
B00B - R1002 - K.L.A. Store (14.69 m2)						
No Asbestos						
B00B - R1003 - Seminar/Study (14.84 m2)						
No Asbestos						
B00B - R1004 - Library Office/Workroom (15.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1005 - K.L.A. Store (27.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1006 - Library Office/Workroom (9.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	1257/B00B/R1005/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R1008 - Distribution Board (1.58 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00B - R1009 - Toilets - Boys/Girls (3.09 m2)						
No Asbestos						
B00B - R1010 - Movement (15.15 m2)						
No Asbestos						
B00B - R1011 - Staff Toilet (3.11 m2)						
No Asbestos						
B00B - R1012 - Cleaning Distributed Store (1.58 m2)						
No Asbestos						
B00B - R1013 - Movement (58.41 m2)						
No Asbestos						
B00B - R1014 - Movement (8.42 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00B - R1015 - Reading Area (256.23 m2)

No Asbestos

B00B - R1016 - General Storeroom (1.14 m2)

No Asbestos

B00B - R1017 - Stairs (4.16 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1953 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00C/Gable Verge Lining/S12					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Movement (45.62 m2)**

No Asbestos

B00C - R0002 - Sports Store (2.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

B00C - R0003 - Sports Store (7.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

B00C - R0004 - Sports Store (33.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

B00C - R0005 - Canteen Office/Store (2.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

B00C - R0006 - Canteen (19.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

B00C - R0007 - Canteen Office/Store (1.72 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

B00C - R0008 - General Storeroom (33.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

B00C - R0009 - Movement (10.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1257/B00C/R0006/Ceiling Structures/Linings/S17					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Communal Facilities - 1953 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Movement (102.29 m2)

No Asbestos

B00D - R0004 - Staff Toilet (4.93 m2)

No Asbestos

B00D - R0005 - Cleaning Supplies (5.34 m2)

No Asbestos

B00D - R0006 - Home Base (51.74 m2)

No Asbestos

B00D - R0007 - Home Base (51.59 m2)

No Asbestos

B00D - R0008 - Movement (4.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1257/B00D/R0013/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0009 - Cleaning Distributed Store (5.45 m2)

No Asbestos

B00D - R0010 - Cleaning Distributed Store (3.83 m2)

No Asbestos

B00D - R0011 - Security Store (6.16 m2)

No Asbestos

B00D - R0012 - General Storeroom (8.59 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
1257/B00D/R0041/Floor Coverings Res/Textile/S6						

B00D - R0013 - Movement (4.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1257/B00D/R0013/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0014 - Home Base (51.36 m2)

No Asbestos

B00D - R0015 - Home Base (51.03 m2)

No Asbestos

B00D - R0016 - Movement (2.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1257/B00D/R0013/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0020 - Toilets - Girls (39.2 m2)

No Asbestos

B00D - R0021 - Cleaning Distributed Store (0.69 m2)

No Asbestos

B00D - R0022 - Toilets - Boys (39.94 m2)

No Asbestos

B00D - R0023 - Staff Room (138.5 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R0024 - Movement (1.91 m2)						
No Asbestos						
B00D - R0026 - Movement (2.56 m2)						
No Asbestos						
B00D - R0027 - Movement (2.55 m2)						
No Asbestos						
B00D - R0028 - Home Base (51.18 m2)						
No Asbestos						
B00D - R0029 - Home Base (51.44 m2)						
No Asbestos						
B00D - R0030 - General Storeroom (10.97 m2)						
No Asbestos						
B00D - R0031 - Movement (2.55 m2)						
No Asbestos						
B00D - R0032 - General Storeroom (5.31 m2)						
No Asbestos						
B00D - R0033 - General Storeroom (3.89 m2)						
No Asbestos						
B00D - R0034 - Movement (1.67 m2)						
No Asbestos						
B00D - R0035 - Staff Toilet (5.38 m2)						
No Asbestos						
B00D - R0036 - Staff Room Annexe (20.91 m2)						
No Asbestos						
B00D - R0037 - Movement (1.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1257/B00D/R0013/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0038 - Interview (13.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1257/B00D/R0041/Floor Coverings Res/Textile/S6				No Asbestos Detected		
B00D - R0039 - Home Base (67.03 m2)						
No Asbestos						
B00D - R0040 - Home Base (70.2 m2)						
No Asbestos						
B00D - R0041 - Movement (208.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1257/B00D/R0041/Floor Coverings Res/Textile/S6				No Asbestos Detected		
Electrical Backing Board	Resinous Board	1Unit	Adjacent R0013	Good Condition (1)	Low (1)	Low Priority (2-3)
1257/B00D/R0041/Electrical Backing Board/S19				Chrysotile (white asbestos)		
B00D - R0042 - Movement (10.14 m2)						
No Asbestos						
B00D - R0043 - Movement (3.4 m2)						
No Asbestos						
B00D - R0044 - Outdoor Learning Area (66.42 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0045 - Movement (8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1257/B00D/R0013/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0046 - Raised Platform (9.18 m2)						
No Asbestos						
B00D - R0047 - Special Programs Room (17.37 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other-D.E.C. Admin/General Learning - 1938 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00E/Eaves Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00E - R0001 - Other - Regional Use (8.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00E/R0004/Ceiling Structures/Linings/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0003 - Home Base (53.43 m2)

No Asbestos

B00E - R0004 - Movement (38.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00E/R0004/Ceiling Structures/Linings/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0005 - Home Base (53.66 m2)

No Asbestos

B00E - R0006 - Home Base (53.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1938 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 1257/B00F/Underfloor Voids - Packing to Floor Joists/S16	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
Eaves Linings	Flat AC Sheeting 1257/B00G/Eaves Linings/S11	40m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B00F - R0001 - External Movement (87.28 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1257/B00E/R0004/Ceiling Structures/Linings/S20	88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0002 - General Storeroom (5.64 m2)

No Asbestos

B00F - R0003 - Cleaning Supplies (12.76 m2)

No Asbestos

B00F - R0004 - Home Base (53.65 m2)

Heater Surround	Flat AC Sheeting 1257/B00F/R0005/Heater Surround/S8	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0005 - Home Base (53.8 m2)

Heater Surround	Flat AC Sheeting 1257/B00F/R0005/Heater Surround/S8	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0006 - General Assistant/Bulk Store (22.35 m2)

No Asbestos

B00F - R0007 - Movement (3.38 m2)

No Asbestos

B00F - R0008 - Home Base (53.5 m2)

Heater Surround	Flat AC Sheeting 1257/B00F/R0005/Heater Surround/S8	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0009 - Home Base (53.5 m2)

Heater Surround	Flat AC Sheeting 1257/B00F/R0005/Heater Surround/S8	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0010 - Cleaning Supplies (16.61 m2)

No Asbestos

B00F - R0011 - Cleaning Distributed Store (5.51 m2)

No Asbestos

B00F - R0012 - External Movement (17.7 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00G - General Learning - 1976 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00G/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1257/B00G/Underfloor Voids/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1257/B00G/Underfloor Voids - Packing to Floor Joists/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00G - R0002 - Community Clinic (18.97 m2)**

No Asbestos

B00G - R0003 - Community Clinic (3.16 m2)

No Asbestos

B00G - R0004 - Home Base (53.44 m2)

Heater Surround	Flat AC Sheeting	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00G/R0004/Heater Surround/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0005 - Home Base (53.5 m2)

Heater Surround	Flat AC Sheeting	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00G/R0004/Heater Surround/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0006 - Home Base (53.29 m2)

Heater Surround	Flat AC Sheeting	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00G/R0004/Heater Surround/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0007 - Home Base (53.51 m2)

Heater Surround	Flat AC Sheeting	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00G/R0004/Heater Surround/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0009 - Movement (74.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1257/B00E/R0004/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Special Purpose - 1938 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Movement (24.86 m2)

No Asbestos

B00H - R0002 - Craft Store (19.22 m2)

Wall Linings Internal	Flat AC Sheeting	20m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1257/B00H/R0002/Wall Linings Internal/S21					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1257/B00H/R0002/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)	

B00H - R0003 - Practical Activities - 1hb (28.12 m2)

Floor Coverings Res/Textile	Vinyl Tiles						
1257/B00H/R0003/Floor Coverings Res/Textile/S7					No Asbestos Detected		

B00H - R0004 - Practical Activities - 1hb (47.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Building Services - 2005 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00M - R0001 - Garden Store (10.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - Communal Facilities/Pupil Facilities - 2004 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00N - R0001 - Communal Space (204.2 m2)**

No Asbestos

B00N - R0002 - Raised Platform (51.05 m2)

No Asbestos

B00N - R0003 - Chair Store (11.85 m2)

No Asbestos

B00N - R0004 - Cleaning Distributed Store (2.6 m2)

No Asbestos

B00N - R0005 - P.E. Store (17.35 m2)

No Asbestos

B00N - R0006 - Communications Room (3.12 m2)

No Asbestos

B00N - R0007 - Disabled Shower/Toilet (5.38 m2)

No Asbestos

B00N - R0008 - Performance Store (11.17 m2)

No Asbestos

B00N - R0009 - Main Switch Board (1.53 m2)

No Asbestos

B00N - R0010 - Canteen (44.11 m2)

No Asbestos

B00N - R0013 - Canteen Office/Store (12.5 m2)

No Asbestos

B00N - R0014 - Movement (46.8 m2)

No Asbestos

B00N - R0015 - Covered Outdoor Learning Area (518.19 m2)

No Asbestos

B00N - R0016 - Toilets - Girls (7.81 m2)

No Asbestos

B00N - R0017 - Toilet - Lobby (1.89 m2)

No Asbestos

B00N - R0018 - Toilets - Boys (7.8 m2)

No Asbestos

B00N - R0019 - Toilet - Lobby (1.89 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B000 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B000 - R0001 - Practical Activities - 1hb (18.91 m2)**

No Asbestos

B000 - R0002 - Home Base Store (6.22 m2)

No Asbestos

B000 - R0003 - Home Base (60.83 m2)

No Asbestos

B000 - R0004 - Withdrawal Space - 2hb (11.51 m2)

No Asbestos

B000 - R0005 - Home Base (61.02 m2)

No Asbestos

B000 - R0006 - Home Base Store (6.22 m2)

No Asbestos

B000 - R0007 - Practical Activities - 1hb (18.26 m2)

No Asbestos

B000 - R0008 - External Movement (60.32 m2)

No Asbestos

B000 - R0009 - Distribution Board (0.48 m2)

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0010 - External Stairs (11.9 m2)

No Asbestos

B000 - R1001 - Practical Activities - 1hb (19.16 m2)

No Asbestos

B000 - R1002 - Home Base Store (6.02 m2)

No Asbestos

B000 - R1003 - Home Base (61.11 m2)

No Asbestos

B000 - R1004 - Withdrawal Space - 2hb (11.71 m2)

No Asbestos

B000 - R1005 - Home Base (61.1 m2)

No Asbestos

B000 - R1006 - Home Base Store (6.02 m2)

No Asbestos

B000 - R1007 - Practical Activities - 1hb (19.16 m2)

No Asbestos

B000 - R1008 - External Movement (55.24 m2)

No Asbestos

B000 - R1009 - External Stairs (17.8 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00P - R0001 - Toilets - Boys (17.72 m2)

No Asbestos

B00P - R0002 - Toilets - Girls (24.43 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00Q - R0001 - Garden Store (13.83 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10585 - Learning Unit - Standard/Withdrawal : Placement Date - 14/01/2008

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D10971 - Learning Unit - Standard With P.A.A. : Placement Date - 8/01/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D11424 - Learning Unit - Standard/Withdrawal : Placement Date - 9/04/2007

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D11495 - Learning Unit - Standard/Withdrawal : Placement Date - 11/01/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 751 - D12303 - Learning Unit - ESL : Placement Date - 20/01/2011						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Esl						
No Asbestos Found.						
R2 - Esl						
No Asbestos Found.						
OS 601 - D13802 - Learning Unit - Standard/Withdrawal : Placement Date - 14/02/2004						
Exterior						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D15331 - Learning Unit - Standard/Withdrawal : Placement Date - 2/02/2002						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

OS 602 - D15368 - Learning Unit - Standard With P.A.A. : Placement Date - 8/12/2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D16196 - Learning Unit - Standard/Withdrawal : Placement Date - 24/01/2002

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D18199 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 20/04/2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1257_ASB_030113_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017