


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blaxland Public School (1258)
Region : Western Sydney
State Electorate : Blue Mountains
Local Government Area : Blue Mountains

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

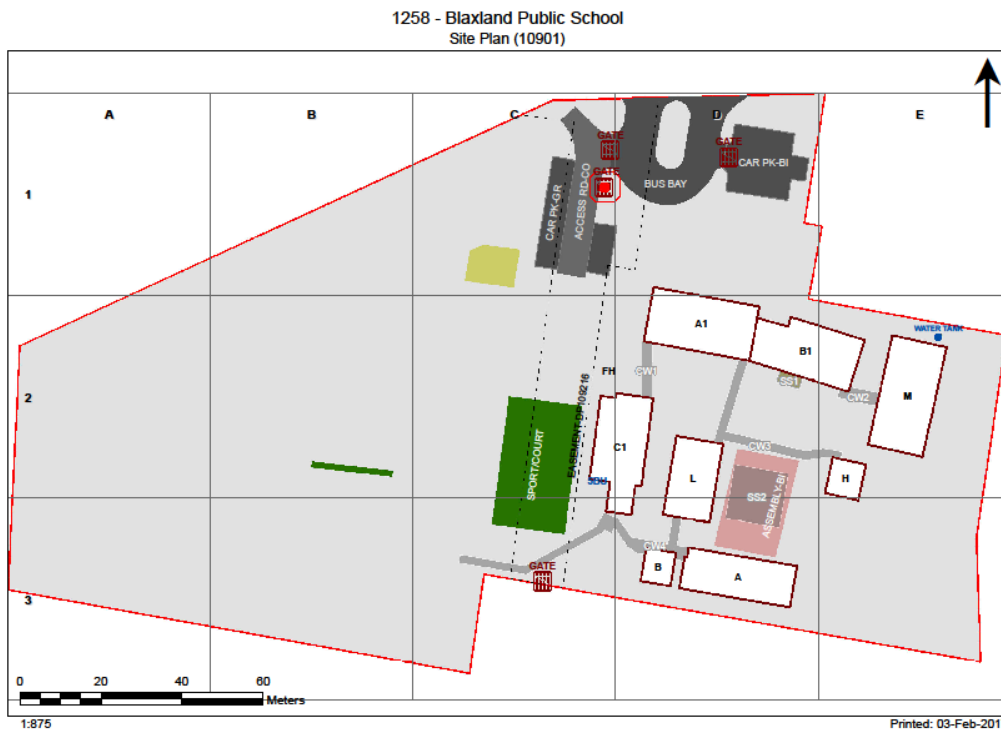

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 1258/B00G/Wall Cladding/S1					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 1258/B00A/Underfloor Voids/S5	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 1258/B00A/Underfloor Voids/S6					No Asbestos Detected
Underfloor Voids	Vinyl Tile Debris 1258/B00A/Underfloor Voids/S7					No Asbestos Detected

Interior

B00A - R0005 - Home Base Store

No Asbestos

B00A - R0006 - Home Base Store

No Asbestos

B00A - R0007 - Home Base

No Asbestos

B00A - R0008 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1258/B00A/R0008/Ceiling Structures/Linings/S8	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	--------------	--------------------	---------	---

B00A - R0012 - Home Base Store

No Asbestos

B00A - R0013 - Home Base

No Asbestos

B00A - R0014 - Home Base

No Asbestos

B00A - R0015 - Practical Activities - 1hb

No Asbestos

B00A - R0016 - Cleaning Distributed Store

No Asbestos

B00A - R9001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1940 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1258/B00G/Wall Cladding/S1					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Withdrawal Space - 2hb

No Asbestos

B00B - R0002 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Pupil Facilities - 1926 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	15m2	North facing, South facing, East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1258/B00H/Eaves Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0003 - Canteen

No Asbestos

B00H - R0004 - Practical Activities - 1hb

No Asbestos

B00H - R0005 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - No manhole in building

Underfloor Voids - Slab on Ground
 No Asbestos Found

Interior

B00L - R0001 - External Movement

No Asbestos

B00L - R0002 - Reading Area

No Asbestos

B00L - R0003 - Communications Room

No Asbestos

B00L - R0004 - Library Office/Workroom

No Asbestos

B00L - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1258/B00L/R0005/Wall Linings Internal/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Practical Activities - 1hb

No Asbestos

B00M - R0002 - Home Base Store

No Asbestos

B00M - R0003 - Home Base

No Asbestos

B00M - R0004 - Withdrawal Space - 2hb

No Asbestos

B00M - R0005 - Home Base

No Asbestos

B00M - R0006 - Home Base Store

No Asbestos

B00M - R0007 - Practical Activities - 1hb

No Asbestos

B00M - R0008 - Special Programs Store

No Asbestos

B00M - R0009 - Special Programs Room - Type 2

No Asbestos

B00M - R0010 - Special Programs Room - Type 2

No Asbestos

B00M - R0011 - Special Programs Store

No Asbestos

B00M - R0012 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A1 - Administration/Staff Facilities - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B0A1 - R0001 - Staff Room**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0002 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0003 - Cleaning Distributed Store

No Asbestos

B0A1 - R0004 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0005 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0006 - Disabled Toilet

No Asbestos

B0A1 - R0007 - Sick Bay

No Asbestos

B0A1 - R0008 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0009 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0010 - Duplicating Workroom

No Asbestos

B0A1 - R0011 - Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0012 - Security Store

No Asbestos

B0A1 - R0013 - Staff Toilet

No Asbestos

B0A1 - R0014 - Staff Toilet

No Asbestos

B0A1 - R0015 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0A1 - R0017 - Distribution Board

No Asbestos

Note: No inspection of live electrical installation.

B0A1 - R0018 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0B1 - General Learning/Pupil Facilities - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B0B1 - R0001 - Main Switch Board

Electrical Mounting Board Resinous Board
 1258/B0B1/R0001/Electrical Mounting Board/S9 **No Asbestos Detected**

B0B1 - R0002 - Home Base Store

No Asbestos

B0B1 - R0003 - Practical Activities - 1hb

No Asbestos

B0B1 - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0B1 - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0B1 - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0B1 - R0007 - Practical Activities - 1hb

No Asbestos

B0B1 - R0008 - Home Base Store

No Asbestos

B0B1 - R0009 - Cleaning Supplies

No Asbestos

B0B1 - R0010 - Toilets - Girls

No Asbestos

B0B1 - R0011 - Toilets - Boys

No Asbestos

B0B1 - R0012 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B0C1 - Communal Facilities - 1999 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B0C1 - R0001 - External Movement	No Asbestos
B0C1 - R0002 - Communal Space	No Asbestos
B0C1 - R0003 - Raised Platform	No Asbestos
B0C1 - R0004 - Lift	No Asbestos
B0C1 - R0005 - Toilets - Boys	No Asbestos
B0C1 - R0006 - Disabled Toilet	No Asbestos
B0C1 - R0007 - Movement	No Asbestos
B0C1 - R0008 - Toilets - Girls	No Asbestos
B0C1 - R0009 - P.E. Store	No Asbestos
B0C1 - R0010 - Hall Chair Store	No Asbestos
B0C1 - R0011 - Plant	No Asbestos
B0C1 - R0012 - Canteen	No Asbestos
B0C1 - R0013 - General Assistant/Bulk Store	No Asbestos
B0C1 - R0014 - Distribution Board	No Asbestos Note: No inspection of live electrical installation.
B0C1 - R0015 - External Movement	No Asbestos
B0C1 - R0016 - General Storeroom	No Asbestos
B0C1 - R0017 - External Movement	No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017