


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blayney Public School (1260)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Blayney

Initial Survey : Noel Arnold & Associates : 30 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Aug - 2016

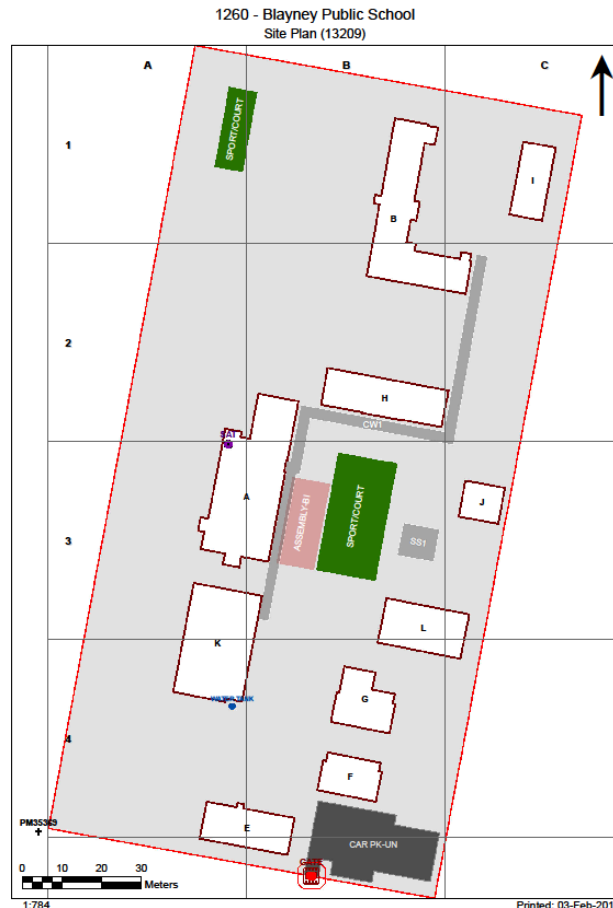

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1933 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00A - R0003 - Movement**

No Asbestos

B00A - R0004 - Staff Room Annexe

No Asbestos

B00A - R0005 - General Storeroom

No Asbestos

B00A - R0006 - Cleaning Distributed Store

No Asbestos

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - External Movement

No Asbestos

B00A - R0009 - Staff Room

No Asbestos

B00A - R0010 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1260/B00A/R0011/Wall Linings Internal/S12	No Asbestos Detected
-----------------------	---	-----------------------------

B00A - R0011 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1260/B00A/R0011/Wall Linings Internal/S12	No Asbestos Detected
-----------------------	---	-----------------------------

B00A - R0017 - Movement

No Asbestos

B00A - R0021 - Movement

No Asbestos

B00A - R0022 - General Storeroom

No Asbestos

B00A - R0024 - Raised Platform

No Asbestos

B00A - R0026 - Handwashing Facilities

No Asbestos

B00A - R0027 - External Movement

No Asbestos

B00A - R0028 - Stairs

No Asbestos

B00A - R0029 - Stairs

No Asbestos

B00A - R0030 - Reading Area

No Asbestos

B00A - R0031 - Movement

No Asbestos

B00A - R0032 - Lift

No Asbestos

B00A - R0033 - Movement

No Asbestos

B00A - R0034 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
	B00A - R0035 - Staff Room					
No Asbestos						
	B00A - R0036 - Principal					
No Asbestos						
	B00A - R0037 - Clerical Office/Workroom					
No Asbestos						
	B00A - R0038 - Entry Vestibule					
No Asbestos						
	B00A - R0039 - Movement					
No Asbestos						
	B00A - R0040 - Disabled Toilet					
No Asbestos						
	B00A - R0041 - Interview					
No Asbestos						
	B00A - R0042 - Communications Cupboard					
No Asbestos						
	B00A - R0043 - Movement					
No Asbestos						
	B00A - R0044 - Sick Bay					
No Asbestos						
	B00A - R0045 - Disabled Toilet					
No Asbestos						
	B00A - R0046 - General Storeroom					
No Asbestos						
	B00A - R1001 - Reading Area					
No Asbestos						
	B00A - R1002 - Library Office/Workroom					
No Asbestos						
	B00A - R1003 - K.L.A. Store					
No Asbestos						
	B00A - R1004 - Home Base					
No Asbestos						
	B00A - R1005 - Home Base					
No Asbestos						
	B00A - R1006 - Home Base					
No Asbestos						
	B00A - R1007 - Handwashing Facilities					
No Asbestos						
	B00A - R1008 - Withdrawal Space - 1hb					
No Asbestos						
	B00A - R1009 - Movement					
No Asbestos						
	B00A - R1010 - Handwashing Facilities					
No Asbestos						
	B00A - R1011 - Movement					
No Asbestos						
	B00A - R1012 - Stairs					
No Asbestos						
	B00A - R1013 - Stairs					
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1964 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 1260/B00B/Eaves Linings/S15	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Cladding	Corrugated AC Sheeting 1260/B00B/Wall Cladding/S21	25m2	South-East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	Non Accessible Area - Manhole is padlocked - No key on site					

Interior**B00B - R0001 - Staff Toilet**

No Asbestos

B00B - R0002 - Other-Vacant

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - Practical Activities - 1hb

No Asbestos

B00B - R0006 - Home Base

No Asbestos

B00B - R0007 - Practical Activities - 1hb

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - Movement

No Asbestos

B00B - R0010 - Personal Effects Storage

No Asbestos

B00B - R0011 - Home Base

Wall Linings Internal	Flat AC Sheeting 1260/B00B/R0013/Wall Linings Internal/S11	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (White asbestos)

B00B - R0012 - Practical Activities - 1hb

No Asbestos

B00B - R0013 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 1260/B00B/R0013/Wall Linings Internal/S11	22m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (White asbestos)

B00B - R0014 - Staff Room Annexe

No Asbestos

B00B - R0015 - General Storeroom

No Asbestos

B00B - R0016 - Cleaning Distributed Store

No Asbestos

B00B - R0017 - Other-Vacant

No Asbestos

B00B - R0018 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00B/R0027/Ceiling Structures/Linings/S10				Chrysotile (White asbestos) , Amosite (Brown asbestos)		
B00B - R0019 - Movement						
No Asbestos						
B00B - R0020 - General Storeroom						
No Asbestos						
B00B - R0021 - Staff Room Annexe						
No Asbestos						
B00B - R0022 - Home Base						
No Asbestos						
B00B - R0023 - Practical Activities - 1hb						
No Asbestos						
B00B - R0024 - Personal Effects Storage						
No Asbestos						
B00B - R0025 - General Storeroom						
No Asbestos						
B00B - R0026 - Movement						
No Asbestos						
B00B - R0027 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00B/R0027/Ceiling Structures/Linings/S10				Chrysotile (White asbestos) , Amosite (Brown asbestos)		
B00B - R0028 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00B/R0027/Ceiling Structures/Linings/S10				Chrysotile (White asbestos) , Amosite (Brown asbestos)		
B00B - R0029 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00B/R0027/Ceiling Structures/Linings/S10				Chrysotile (White asbestos) , Amosite (Brown asbestos)		
B00B - R0030 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00B/R0027/Ceiling Structures/Linings/S10				Chrysotile (White asbestos) , Amosite (Brown asbestos)		
B00B - R0031 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00B/R0027/Ceiling Structures/Linings/S10				Chrysotile (White asbestos) , Amosite (Brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - General Learning - 1944 - Timber (Timber)						
Exterior						
Eaves Linings	Flat AC Sheeting 1260/B00E/R0006/Ceiling Structures/Linings/S2				No Asbestos Detected	
Gable Ends	Flat AC Sheeting 1260/B00E/Gable Ends/S20				No Asbestos Detected	
Underfloor Voids	Flat AC Sheeting 1260/B00E/Underfloor Voids/S22	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
Ceiling Void	AC Fragments/Debris 1260/B00E/Ceiling Void/S23	1m2	Throughout	Poor Condition - Extensive Damage (4) Chrysotile (white asbestos), Amosite (brown asbestos)	Low (1)	Medium Priority (4-5)
Underfloor Void	AC Fragments/Debris 1260/B00E/Underfloor Void/S24	1m2	Throughout	Poor Condition - Extensive Damage (4) Chrysotile (white asbestos)	Low (1)	Medium Priority (4-5)
Interior						
B00E - R0001 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting 1260/B00E/R0006/Wall Linings Internal/S1	30m2	Throughout	Good Condition (1) Chrysotile (White asbestos), Amosite (Brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 1260/B00E/R0006/Ceiling Structures/Linings/S2				No Asbestos Detected	
B00E - R0002 - Home Base						
Wall Linings Internal	Flat AC Sheeting 1260/B00E/R0006/Wall Linings Internal/S1	80m2	Upper portion	Good Condition (1) Chrysotile (White asbestos), Amosite (Brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 1260/B00E/R0006/Ceiling Structures/Linings/S2				No Asbestos Detected	
B00E - R0003 - Practical Activities - 1hb						
Wall Linings Internal	Flat AC Sheeting 1260/B00E/R0006/Wall Linings Internal/S1	6m2	Upper portion	Good Condition (1) Chrysotile (White asbestos), Amosite (Brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 1260/B00E/R0006/Ceiling Structures/Linings/S2				No Asbestos Detected	
B00E - R0004 - Home Base						
Wall Linings Internal	Flat AC Sheeting 1260/B00E/R0006/Wall Linings Internal/S1	80m2	Upper portion	Good Condition (1) Chrysotile (White asbestos), Amosite (Brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 1260/B00E/R0006/Ceiling Structures/Linings/S2				No Asbestos Detected	
B00E - R0005 - Practical Activities - 1hb						
Wall Linings Internal	Flat AC Sheeting 1260/B00E/R0006/Wall Linings Internal/S1	20m2	South, West, Upper portion	Good Condition (1) Chrysotile (White asbestos), Amosite (Brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 1260/B00E/R0006/Ceiling Structures/Linings/S2				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles 1260/B00E/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	
B00E - R0006 - Toilet - P						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00E/R0006/Wall Linings Internal/S1				Chrysotile (White asbestos) , Amosite (Brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
1260/B00E/R0006/Ceiling Structures/Linings/S2						
B00E - R0007 - Movement						
Wall Linings Internal	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1260/B00E/R0006/Wall Linings Internal/S1				Chrysotile (White asbestos) , Amosite (Brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
1260/B00E/R0006/Ceiling Structures/Linings/S2						
B00E - R0008 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
1260/B00E/R0006/Ceiling Structures/Linings/S2						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1956 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00F/R0001/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00F - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00F/R0001/Ceiling Structures/Linings/S4				Chrysotile (White asbestos)	

B00F - R0002 - Practical Activities - 1hb

No Asbestos

B00F - R0005 - Home Base Store

Electrical Backing Board	Resinous Board	2Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1260/B00F/R0005/Electrical Backing Board/S32				Chrysotile (white asbestos)	

B00F - R0006 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1956 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00G/Eaves Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00G - R0002 - Staff Toilet**

Floor Coverings Res/Textile	Vinyl Tiles					
	1260/B00G/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00G/R0010/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0003 - Uniform Shop

Floor Coverings Res/Textile	Vinyl Sheet					
	1260/B00G/R0004/Floor Coverings Res/Textile/S34					No Asbestos Detected

B00G - R0004 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Sheet					
	1260/B00G/R0004/Floor Coverings Res/Textile/S34					No Asbestos Detected

B00G - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00G/R0010/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0007 - Canteen Covered Area

No Asbestos

B00G - R0008 - Canteen

Floor Coverings Res/Textile	Vinyl Sheet					
	1260/B00G/R0004/Floor Coverings Res/Textile/S34					No Asbestos Detected

B00G - R0009 - Canteen

Floor Coverings Res/Textile	Vinyl Sheet					
	1260/B00G/R0004/Floor Coverings Res/Textile/S34					No Asbestos Detected

B00G - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00G/R0010/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0011 - General Storeroom

No Asbestos

B00G - R0012 - Cleaning Distributed Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00H/Eaves Linings/S18					Chrysotile (white asbestos)
Ceiling Void	Non Accessible Area - Manhole is sealed - No access possible					

Interior**B00H - R0001 - Staff Toilet**

No Asbestos

B00H - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	18m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00H/R0002/Partition Walls (Cubicles)/S8					Chrysotile (White asbestos)

B00H - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0004 - Plant

No Asbestos

B00H - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	18m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00H/R0002/Partition Walls (Cubicles)/S8					Chrysotile (White asbestos)

B00H - R0006 - General Storeroom

In-fill-panel	Flat AC Sheeting	12m	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00H/R0006/In-fill-panel/S9					Chrysotile (White asbestos)

B00H - R0007 - General Assistant/Bulk Store

No Asbestos

B00H - R0008 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00H/R0003/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)

B00H - R0009 - Plant

No Asbestos

B00H - R0010 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B00H/R0002/Partition Walls (Cubicles)/S8					Chrysotile (White asbestos)

B00H - R0011 - Staff Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B001/Eaves Linings/S19					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
In-fill Panels under windows	Flat AC Sheeting	3m2	North & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1260/B001/In-fill Panels under windows/S31					Chrysotile (white asbestos)

Interior**B001 - R0001 - General Storeroom**

In-fill-panel	Flat AC Sheeting	12m	North, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B001/R0001/In-fill-panel/S14					Chrysotile (White asbestos) , Amosite (Brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	1260/B001/R0001/Floor Coverings Res/Textile/S33					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	1260/B001/R0001/Ceiling Structures/Linings/S29					No Asbestos Detected

B001 - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B001/R0004/Partition Walls (Cubicles)/S13					Chrysotile (White asbestos)

B001 - R0003 - Plant

No Asbestos

B001 - R0004 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B001/R0004/Partition Walls (Cubicles)/S13					Chrysotile (White asbestos)

B001 - R0005 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B001/R0005/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)

B001 - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1260/B001/R0006/Ceiling Structures/Linings/S30					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1964 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B00J - R0001 - Sports Store

No Asbestos

B00J - R0002 - General Storeroom

No Asbestos

B00J - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00K - R0001 - Access Shower/Toilet/Change**

No Asbestos

B00K - R0002 - Main Switch Board

No Asbestos

B00K - R0003 - Cleaning Distributed Store

No Asbestos

B00K - R0004 - Plant

No Asbestos

B00K - R0005 - Movement

No Asbestos

B00K - R0006 - Toilets - Boys

No Asbestos

B00K - R0007 - Sound Cupboard

No Asbestos

B00K - R0008 - Toilets - Girls

No Asbestos

B00K - R0009 - Movement

No Asbestos

B00K - R0010 - P.E. Store

No Asbestos

B00K - R0011 - Communal/Performance Store

No Asbestos

B00K - R0012 - Hall Chair Store

No Asbestos

B00K - R0013 - Raised Platform

No Asbestos

B00K - R0014 - Communal Space

No Asbestos

B00K - R0015 - Covered Outdoor Learning Area

No Asbestos

B00K - R0016 - Movement

No Asbestos

B00K - R0017 - Ramp

No Asbestos

B00K - R0018 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2016 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00L - R0001 - Practical Activities - 1hb

No Asbestos

B00L - R0002 - Home Base

No Asbestos

B00L - R0003 - Withdrawal Space - 2hb

No Asbestos

B00L - R0004 - General Storeroom

No Asbestos

B00L - R0005 - General Storeroom

No Asbestos

B00L - R0006 - Home Base

No Asbestos

B00L - R0007 - Practical Activities - 1hb

No Asbestos

B00L - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13650 - Learning Unit - Standard With P.A.A. : Placement Date - 16/08/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D14437 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 7/12/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017