


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Blighty Public School (1261)
Region : Riverina
State Electorate : Murray
Local Government Area : Conargo

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Greencap-NAA : 07 - Jul - 2016

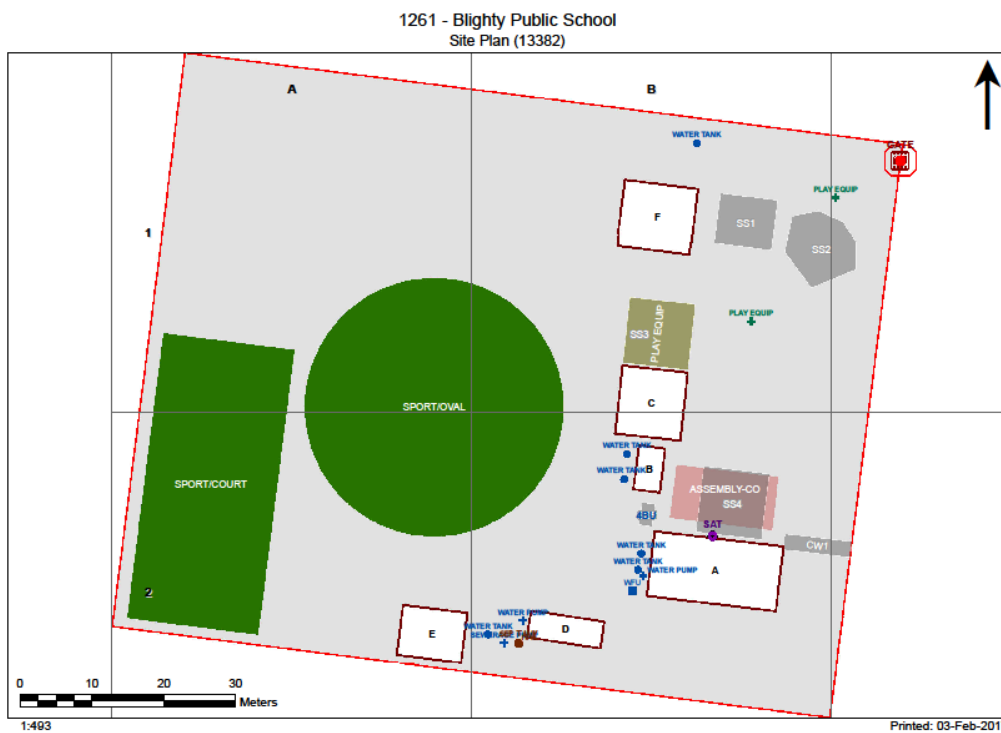

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1912 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior**B00A - R0001 - Withdrawal Space - 1hb**

No Asbestos

B00A - R0002 - Home Base

Wall Linings Internal	Millboard	2m2	South facing, West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
1261/B00A/R0009/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0004 - General Storeroom

No Asbestos

B00A - R0005 - Principal

No Asbestos

B00A - R0006 - General Storeroom

Floor Coverings Res/Textile	Millboard	4m2	All surfaces, backing to vinyl floor sheeting	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
1261/B00A/R0006/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		

B00A - R0007 - Movement

In-fill-panel	Flat AC Sheeting					No Asbestos Detected
1261/B00A/R0007/In-fill-panel/S6						
Floor Coverings Res/Textile	Compressed AC Sheet	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1261/B00A/R0007/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00A - R0008 - Principal

No Asbestos

B00A - R0009 - Clerical Office/Workroom

Wall Linings Internal	Millboard	2m2	South facing, West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
1261/B00A/R0009/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Movement

Floor Coverings Res/Textile	Compressed AC Sheet	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1261/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1920 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior**B00C - R0001 - General Storeroom**

Floor Coverings Res/Textile	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1261/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	16m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1261/B00C/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1261/B00C/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)	

B00C - R0002 - Movement

Floor Coverings Res/Textile	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1261/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	8m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1261/B00C/R0002/Wall Linings Internal/S4					Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard**B00C - R0003 - Home Base**

Wall Linings Internal	Millboard	2m2	North facing, West facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
1261/B00A/R0009/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0004 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1261/B00D/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

Interior**B00D - R0001 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1261/B00D/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

B00D - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1261/B00D/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

B00D - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1261/B00D/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

B00D - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1261/B00D/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1261/B00D/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

B00D - R0006 - Disabled Shower/Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other - 2008 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - General Storeroom

No Asbestos

B00E - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Reading Area

No Asbestos

B00F - R0002 - K.L.A. Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017