


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bobin Public School (1269)
Region : North Coast
State Electorate : Myall Lakes
Local Government Area : Greater Taree

Initial Survey : Noel Arnold & Associates : 07 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 31 - Oct - 2016

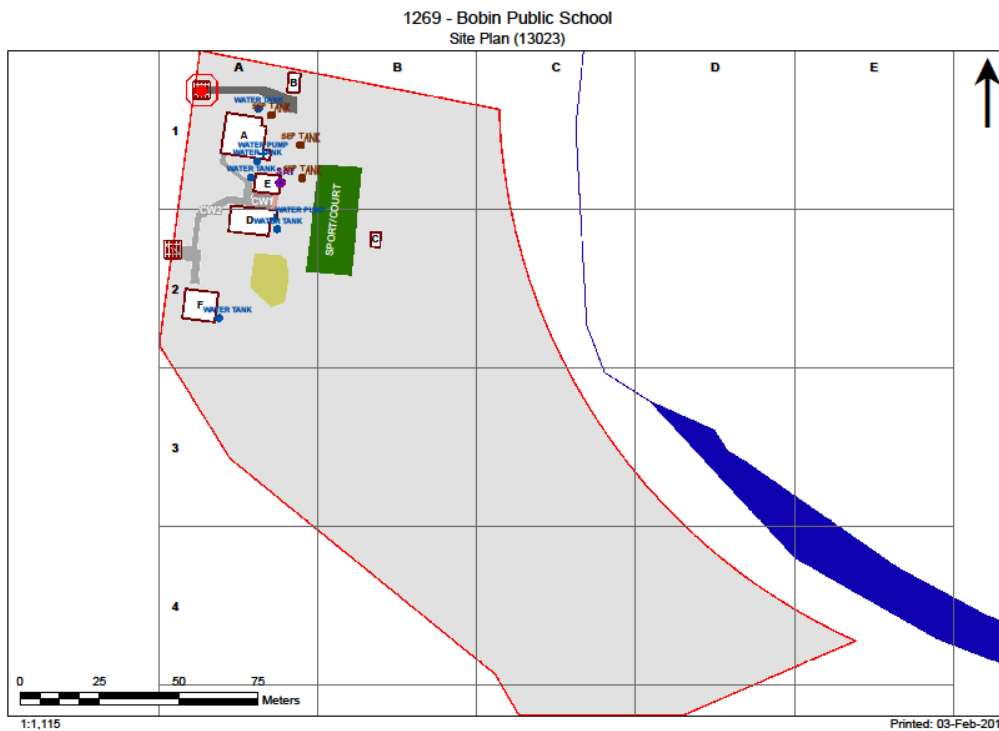

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1930 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting 1269/B00A/Wall Cladding/S7	25m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting 1269/B00A/Eaves Linings/S14					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 1269/B00A/Underfloor Voids/S16					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 1269/B00A/Underfloor Voids - Packing to Floor Joists/S17	1m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)

Interior**B00A - R0001 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting 1269/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1269/B00A/R0001/Wall Linings Internal/S9	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1269/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1269/B00A/R0001/Wall Linings Internal/S9	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0003 - Staff Shower/Change

Floor Coverings Res/Textile	Vinyl Tiles 1269/B00A/R0003/Floor Coverings Res/Textile/S10					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1269/B00A/R0003/Wall Linings Internal/S11	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 1269/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected

B00A - R0004 - Staff Room

No Asbestos

B00A - R0006 - Clerical Office

No Asbestos

B00A - R0007 - Principal

No Asbestos

B00A - R0008 - Sick Bay

No Asbestos

B00A - R0009 - Movement

No Asbestos

B00A - R0010 - Withdrawal Space - 1hb

No Asbestos

B00A - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1269/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Electrical Mounting Board	Resinous Board 1269/B00A/R0011/Electrical Mounting Board/S18	1Unit	East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0012 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting 1269/B00A/R0011/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1269/B00A/R0001/Wall Linings Internal/S9	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0013 - Craft Store						
Ceiling Structures/Linings	Flat AC Sheeting 1269/B00A/R0013/Ceiling Structures/Linings/S19	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0014 - Security Store						
Ceiling Structures/Linings	Flat AC Sheeting 1269/B00A/R0013/Ceiling Structures/Linings/S19	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration - 1970 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00B/Wall Cladding/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00B - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1970 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00C - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library/Special Purpose - 1930 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/Eaves Linings/S3					Chrysotile (white asbestos)
Underfloor Void	No Asbestos Found					
Ceiling Void	Non Accessible Area - No Manhole in Building					

Interior**B00D - R0001 - Special Programs Room**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0006/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00D - R0002 - Reading Area

Wall Linings Internal	Flat AC Sheeting	3m2	South, East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00D - R0003 - Craft Store

No Asbestos

B00D - R0004 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0004/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00D - R0005 - Seminar/Study

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0006/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00D - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00D/R0006/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00D - R0007 - Sports Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities/Staff Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00E/Eaves Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B00E - R0001 - Staff Toilet**

In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00E/R0001/In-fill-panel/S2			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00E/R0004/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00E - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00E/R0004/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00E - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00E/R0004/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00E - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1269/B00E/R0004/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Staff Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00F - R0001 - Home Base

No Asbestos

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017