


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bonalbo Central School (1290)  
**Region :** North Coast  
**State Electorate :** Lismore  
**Local Government Area :** Kyogle

**Initial Survey :** Noel Arnold & Associates : 10 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 08 - Oct - 2015

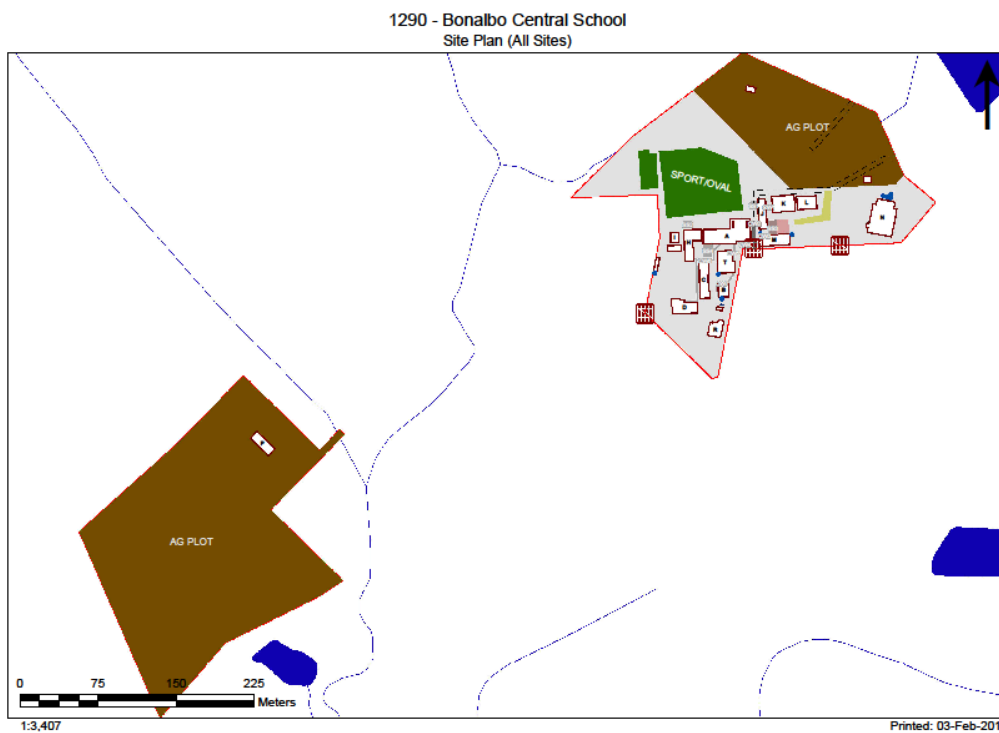

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
<b>B00A - Administration/Library - 1977 - Brick/Block (Brick/Block)</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0003 - General Storeroom (10.7 m2)</b>							
Decorative Coating	Vermiculite	1290/B00A/R0003/Decorative Coating/S37				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							
<b>B00A - R0004 - Distribution Board (0.46 m2)</b>							
						Note: No inspection of live electrical installation.	
No Asbestos							
<b>B00A - R0017 - Laboratory L.S. (91.87 m2)</b>							
Decorative Coating	Vermiculite	1290/B00A/R0017/Decorative Coating/S38				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							
<b>B00A - R0019 - Sports Store (12.12 m2)</b>							
No Asbestos							
<b>B00A - R0020 - External Stairs (4.72 m2)</b>							
No Asbestos							
<b>B00A - R0021 - External Stairs (14.13 m2)</b>							
No Asbestos							
<b>B00A - R0022 - External Movement (236.89 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1290/B00A/R0022/Ceiling Structures/Linings/S39				No Asbestos Detected	
<b>B00A - R0026 - Movement (34.53 m2)</b>							
Decorative Coating	Vermiculite	1290/B00A/R0026/Decorative Coating/S56				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							
<b>B00A - R0027 - Clerical Office (28.87 m2)</b>							
Decorative Coating	Vermiculite	1290/B00A/R0027/Decorative Coating/S40				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							
<b>B00A - R0028 - Duplicating Workroom (15.44 m2)</b>							
No Asbestos							
<b>B00A - R0029 - Cleaning Distributed Store (2.41 m2)</b>							
Decorative Coating	Vermiculite	1290/B00A/R0029/Decorative Coating/S41				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							
<b>B00A - R0030 - Staff Toilet (6.47 m2)</b>							
Decorative Coating	Vermiculite	1290/B00A/R0030/Decorative Coating/S42				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							
<b>B00A - R0031 - Security Store (17.37 m2)</b>							
No Asbestos							
<b>B00A - R0032 - Principal (20.75 m2)</b>							
No Asbestos							
<b>B00A - R0033 - Deputy Principal (17.97 m2)</b>							
No Asbestos							
<b>B00A - R0034 - Interview (12.86 m2)</b>							
No Asbestos							
<b>B00A - R0035 - Community Clinic (10.09 m2)</b>							
No Asbestos							

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite 1290/B00A/R0035/Decorative Coating/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0036 - Community Clinic (10.01 m2)</b>						
Decorative Coating	Vermiculite 1290/B00A/R0036/Decorative Coating/S44					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0037 - Store (4.67 m2)</b>						
Decorative Coating	Vermiculite 1290/B00A/R0037/Decorative Coating/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0038 - General Learning Space (90.31 m2)</b>						
Decorative Coating	Vermiculite 1290/B00A/R0038/Decorative Coating/S46					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0039 - General Learning Space (49.14 m2)</b>						
Decorative Coating	Vermiculite 1290/B00A/R0039/Decorative Coating/S47					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0040 - Practical Activities (1.08 m2)</b>						
Decorative Coating	Vermiculite 1290/B00A/R0040/Decorative Coating/S48					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1001 - External Movement (83.98 m2)</b>						
Wall Linings Internal	Flat AC Sheeting 1290/B00A/R1001/Wall Linings Internal/S7					No Asbestos Detected
<b>B00A - R1002 - Staff Room Annexe (33.45 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Staff Room (54.25 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Staff Toilet (4.78 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 1290/B00A/R1004/Partition Walls (Cubicles)/S6	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1005 - Staff Toilet (4.82 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 1290/B00A/R1004/Partition Walls (Cubicles)/S6	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1006 - Distribution Board (0.21 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R1007 - Library Office/Workroom (15.04 m2)</b>						
No Asbestos						
<b>B00A - R1008 - Communications Room (18.8 m2)</b>						
No Asbestos						
<b>B00A - R1009 - K.L.A. Store (15.97 m2)</b>						
No Asbestos						
<b>B00A - R1010 - Library Office/Workroom (16.87 m2)</b>						
No Asbestos						
<b>B00A - R1011 - Reading Area (162.87 m2)</b>						
No Asbestos						
<b>B00A - R1012 - Communications Room (10.54 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1013 - Seminar/Study (21.9 m2)</b>						
No Asbestos						
<b>B00A - R1014 - External Stairs (17.27 m2)</b>						
No Asbestos						
<b>B00A - R1015 - External Stairs (17.49 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Music - 1955 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1290/B00B/Eaves Linings/S25					<b>No Asbestos Detected</b>

**Interior**

**B00B - R0004 - Music Learning Space (71.38 m2)**

Wall Linings Internal	Flat AC Sheeting 1290/B00B/R0004/Wall Linings Internal/S11					<b>No Asbestos Detected</b>
-----------------------	---	--	--	--	--	-----------------------------

**B00B - R0005 - Practice/Seminar (24.38 m2)**

No Asbestos

**B00B - R0006 - Resources (24.33 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00C - General Learning - 1955 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00C - R0001 - Staff Room Annexe (14.37 m2)**

No Asbestos

**B00C - R0002 - Movement (5.87 m2)**

No Asbestos

**B00C - R0003 - Staff Room Annexe (10.69 m2)**

No Asbestos

**B00C - R0004 - General Assistant/Bulk Store (7.8 m2)**

No Asbestos

**B00C - R0005 - External Movement (57.7 m2)**

No Asbestos

**B00C - R0006 - Computer Learning Space (50.93 m2)**

No Asbestos

**B00C - R0007 - Withdrawal Space - 1hb (6.2 m2)**

No Asbestos

**B00C - R0008 - Cleaning Distributed Store (6.33 m2)**

No Asbestos

**B00C - R0009 - General Learning Space (60.06 m2)**

No Asbestos

**B00C - R0010 - General Storeroom (5.24 m2)**

No Asbestos

**B00C - R0011 - General Storeroom (7.94 m2)**

No Asbestos

**B00C - R0012 - General Learning Space (47.95 m2)**

No Asbestos

**B00C - R0013 - Interview (9.48 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Technological & Applied Studies - 1985 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00D/Eaves Linings/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	Flat AC Sheeting Debris					
	1290/B00D/Underfloor Voids/S27			<b>No Asbestos Detected</b>		

**Interior**

**B00D - R0004 - External Movement (9.48 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00D/R0004/Ceiling Structures/Linings/S49			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00D - R0005 - Laundry (6.41 m2)**

No Asbestos

**B00D - R0006 - Pantry (13.32 m2)**

No Asbestos

**B00D - R0007 - Apparatus Store (6.11 m2)**

No Asbestos

**B00D - R0008 - Laboratory L.S. (73.26 m2)**

No Asbestos

**B00D - R0009 - External Movement (10.08 m2)**

No Asbestos

**B00D - R0010 - Resources Store (15.01 m2)**

No Asbestos

**B00D - R0011 - Kiln Room (10.57 m2)**

No Asbestos

**B00D - R0012 - Food Technology L.S. (129.75 m2)**

No Asbestos

**B00D - R9002 - External Movement (24.58 m2)**


No Asbestos

**B00D - R9003 - Darkroom Space (30.45 m2)**

No Asbestos

**B00D - R9004 - Resources Store (38.41 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1290/B00D/R9004/Ceiling Structures/Linings/S50			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

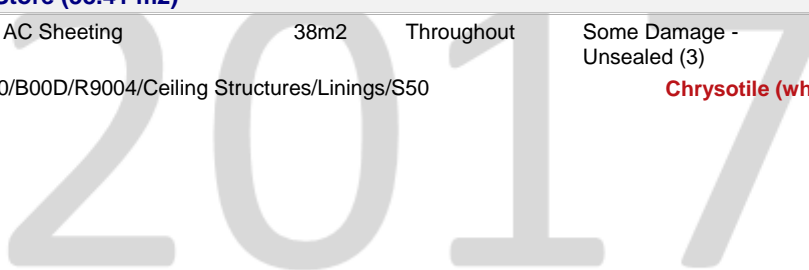

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Building Services - 1975 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Seminar/Study (8.28 m2)**

No Asbestos

**B00E - R0002 - External Movement (21.48 m2)**

No Asbestos

**B00E - R0003 - General Storeroom (8.18 m2)**

Wall Linings Internal	Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00E/R0003/Wall Linings Internal/S9					<b>Chrysotile (white asbestos)</b>	

**B00E - R0004 - General Storeroom (8.18 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00E/R0003/Wall Linings Internal/S9					<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00F/Eaves Linings/S28					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00F - R0001 - Toilets - Boys (24.9 m2)**

No Asbestos

**B00F - R0002 - Staff Toilet (4.03 m2)**

No Asbestos

**B00F - R0004 - Staff Toilet (4.36 m2)**

No Asbestos

**B00F - R0005 - Toilets - Girls (22.79 m2)**

No Asbestos

**B00F - R0006 - Cleaning Distributed Store (1.66 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Technological & Applied Studies - 1975 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1290/B00H/Eaves Linings/S29					<b>No Asbestos Detected</b>

**Interior**

**B00H - R0004 - Metal Technology Bay (141.87 m2)**

No Asbestos

**B00H - R0005 - Materials Store (28.45 m2)**

No Asbestos

**B00H - R0006 - Wood Technology Bay (44.83 m2)**

No Asbestos

**B00H - R0007 - Wood Technology Bay (88.06 m2)**

No Asbestos

**B00H - R0008 - Project Store - Type 1 (11.27 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Agricultural Science - 1975 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - Garden Store (65.25 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 1975 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 1290/B00K/R0001/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Infill panels above Doors and Windows	Flat AC Sheeting 1290/B00J/Infill panels above Doors and Windows/S30	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Underfloor Voids	Flat AC Sheeting Debris 1290/B00J/Underfloor Voids/S31	2m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00J - R0001 - Garden Store (8.22 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1290/B00J/R0001/Ceiling Structures/Linings/S51	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	------------	--------------------	---------	--

**B00J - R0002 - Cleaning Distributed Store (7.77 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1290/B00J/R0002/Ceiling Structures/Linings/S52	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	------------	--------------------	---------	--

**B00J - R0003 - Sports Store (21.63 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1290/B00J/R0003/Ceiling Structures/Linings/S53	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	------------	--------------------	---------	--

**B00J - R0004 - Toilets - Boys (22.14 m2)**

Partition Walls (Cubicles)	Flat AC Sheeting 1290/B00J/R0004/Partition Walls (Cubicles)/S4	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	---	------	------------	--------------------	---------	--

Ceiling Structures/Linings	Flat AC Sheeting 1290/B00J/R0004/Ceiling Structures/Linings/S54	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	------------	--------------------	---------	--

**B00J - R0005 - Staff Toilet (3.74 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1290/B00J/R0005/Ceiling Structures/Linings/S13	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	------------	--------------------	---------	--

**B00J - R0006 - Staff Toilet (3.81 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1290/B00J/R0006/Ceiling Structures/Linings/S14	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	------------	--------------------	---------	--

**B00J - R0007 - Toilets - Girls (21.43 m2)**

Partition Walls (Cubicles)	Flat AC Sheeting 1290/B00J/R0004/Partition Walls (Cubicles)/S4	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	---	------	------------	--------------------	---------	--

Ceiling Structures/Linings	Flat AC Sheeting 1290/B00J/R0007/Ceiling Structures/Linings/S15	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	------------	--------------------	---------	--

**B00J - R0008 - Staff Toilet (2.49 m2)**

No Asbestos

**B00J - R0009 - Canteen Office/Store (6.68 m2)**

No Asbestos

**B00J - R0010 - Canteen Office/Store (6.19 m2)**

No Asbestos

**B00J - R0011 - Canteen (32.02 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00J - R0012 - Movement (43.87 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1290/B00J/R0012/Wall Linings Internal/S2					
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00J/R0012/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>

**B00J - R0013 - External Movement (4.71 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00J/R0013/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>

**B00J - R0014 - Main Switch Board (5.96 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00J/R0014/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - General Learning - 1949 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Infill Panels under windows	Flat AC Sheeting	10m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00K/Infill Panels under windows/S32					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00K - R0001 - External Movement (39.76 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1290/B00K/R0001/Ceiling Structures/Linings/S1					

**B00K - R0002 - General Storeroom (7.87 m2)**

No Asbestos

**B00K - R0003 - General Storeroom (7.38 m2)**

No Asbestos

**B00K - R0004 - Distribution Board Cupboard (0.12 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00K - R0005 - Cleaning Distributed Store (4.81 m2)**

No Asbestos

**B00K - R0006 - External Movement (39.76 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1290/B00K/R0001/Ceiling Structures/Linings/S1					

**B00K - R0007 - Practical Activities - 1hb (20.62 m2)**

No Asbestos

**B00K - R0008 - Home Base (51.15 m2)**

No Asbestos

**B00K - R0009 - Home Base (51.23 m2)**

No Asbestos

**B00K - R0010 - Practical Activities - 1hb (20.62 m2)**

No Asbestos

**B00K - R0011 - External Movement (67.76 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning - 1975 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Infill Panels under windows	Flat AC Sheeting	10m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00L/Infill Panels under windows/S33					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00L - R0001 - External Movement (34.49 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1290/B00K/R0001/Ceiling Structures/Linings/S1					

**B00L - R0002 - Practical Activities - 1hb (20.62 m2)**

No Asbestos

**B00L - R0003 - Home Base (51.15 m2)**

No Asbestos

**B00L - R0004 - Home Base (51.23 m2)**

No Asbestos

**B00L - R0005 - Practical Activities - 1hb (20.62 m2)**

No Asbestos

**B00L - R0006 - External Movement (34.49 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1290/B00K/R0001/Ceiling Structures/Linings/S1					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - General Learning - 1970 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00M/Eaves Linings/S34				<b>Chrysotile (white asbestos)</b>	
Infill panels above Doors and Windows	Flat AC Sheeting	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1290/B00M/Infill panels above Doors and Windows/S35				<b>Chrysotile (white asbestos)</b>	
Infill Panels under windows	Flat AC Sheeting	20m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00M/Infill Panels under windows/S36				<b>Chrysotile (white asbestos)</b>	

**Interior****B00M - R0002 - General Storeroom (4 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00M/R0002/Floor Coverings Res/Textile/S3				<b>Chrysotile (white asbestos)</b>	

**B00M - R0007 - Home Base (71.66 m2)**

No Asbestos

**B00M - R0008 - Practical Activities - 1hb (14.22 m2)**

No Asbestos

**B00M - R0009 - Toilets - Boys/Girls (6.39 m2)**

No Asbestos

**B00M - R0010 - Movement (6.44 m2)**

No Asbestos

**B00M - R0011 - Distribution Board (0.66 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00M - R0012 - Cleaning Distributed Store (4.95 m2)**

No Asbestos

**B00M - R0013 - Deputy Principal (22.38 m2)**

No Asbestos

**B00M - R0014 - External Movement (56.03 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1290/B00M/R0014/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	

**B00M - R0015 - Staff Room Annexe (31.96 m2)**

No Asbestos

**B00M - R0016 - General Learning Space (56.24 m2)**

No Asbestos

**B00M - R0017 - Movement (3.47 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00N - Communal Facilities - 1994 - Steel (Steel)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00N - R0001 - External Movement (7.49 m2)**

No Asbestos

**B00N - R0002 - Shower/Change (30.65 m2)**

No Asbestos

**B00N - R0003 - Communal Space (464.96 m2)**

No Asbestos

**B00N - R0004 - Cleaning Distributed Store (5.98 m2)**

No Asbestos

**B00N - R0005 - Plant (0.52 m2)**

No Asbestos

**B00N - R0006 - Shower/Change (29.76 m2)**

No Asbestos

**B00N - R0007 - Movement (7.42 m2)**

No Asbestos

**B00N - R0008 - External Movement (7.5 m2)**

No Asbestos

**B00N - R0009 - Staff Room Annexe (16.05 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00N - R0010 - Staff Shower/Change (4.44 m2)**

No Asbestos

**B00N - R0011 - Plant (0.54 m2)**

No Asbestos

**B00N - R0012 - Distribution Board (0.75 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00N - R0014 - Canteen Covered Area (8.8 m2)**

No Asbestos

**B00N - R0015 - Movement (22.95 m2)**

No Asbestos

**B00N - R0016 - Raised Platform (46.35 m2)**

No Asbestos

**B00N - R0017 - Ramp (11.25 m2)**

No Asbestos

**B00N - R0018 - Movement (17.41 m2)**

No Asbestos

**B00N - R0019 - Sound Cupboard (2.45 m2)**

No Asbestos

**B00N - R0020 - P.E. Store (45.43 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Agricultural Science - 1975 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B000 - R0001 - Movement (46.12 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Agricultural Science - 1995 - Steel (Steel)**

**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

**Interior**

**B00P - R0001 - Garden Store (104.52 m2)**

No Asbestos

**B00P - R0002 - Garden Store (105.71 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Q - Agricultural Science - 1975 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00Q - R0001 - Animal Space (43.21 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00R - Administration - 1911 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00R - R0001 - Movement (35.55 m2)**

No Asbestos

**B00R - R0002 - Staff Room Annexe (15.23 m2)**

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0003/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0002/Ceiling Structures/Linings/S20				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00R - R0003 - Movement (4.48 m2)**

Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0003/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0003/Ceiling Structures/Linings/S21				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00R - R0004 - Interview (15.79 m2)**

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0003/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0004/Ceiling Structures/Linings/S22				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00R - R0005 - Interview (19.91 m2)**

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0003/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0005/Ceiling Structures/Linings/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00R - R0006 - Interview (15.67 m2)**

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0003/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1290/B00R/R0006/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00R - R0007 - Therapy (14.31 m2)**

No Asbestos

**B00R - R0008 - Staff Kitchen (13.71 m2)**

No Asbestos

**B00R - R0009 - Entry Vestibule (12.71 m2)**

No Asbestos

**B00R - R0010 - Movement (1.46 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00R - R0011 - Pantry (0.84 m2)</b>						
No Asbestos						
<b>B00R - R0012 - Staff Shower/Change (4.6 m2)</b>						
No Asbestos						
<b>B00R - R0013 - Staff Toilet (2.03 m2)</b>						
No Asbestos						
<b>B00R - R0014 - General Storeroom (11.39 m2)</b>						
No Asbestos						
<b>B00R - R0015 - External Movement (1.55 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00S - Technological & Applied Studies - 1955 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00S - R0001 - Materials Store (16.78 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00T - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00T - R0001 - General Learning Space - Type 3 (59.85 m2)**

No Asbestos

**B00T - R0002 - Science Laboratory (59.85 m2)**

No Asbestos

**B00T - R0003 - Preparation - Science (30.06 m2)**

No Asbestos

**B00T - R0004 - Staff Room Annexe (21 m2)**

No Asbestos

**B00T - R0005 - Seminar - Type 2 (21 m2)**

No Asbestos

**B00T - R0006 - Chemical Store (12.12 m2)**

No Asbestos

**B00T - R0007 - Movement (6.14 m2)**

No Asbestos

**B00T - R0008 - Apparatus Store (13.78 m2)**

No Asbestos

**B00T - R0009 - Distribution Board (0.69 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00T - R0010 - Outdoor Learning Space - Type 4 (85.81 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**CW\_AJ - Covered Way between Buildings A&J**

**Exterior**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017