


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bondi Beach Public School (1292)
Region : Sydney
State Electorate : Vaucluse
Local Government Area : Waverley

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : AECOM : 26 - May - 2015

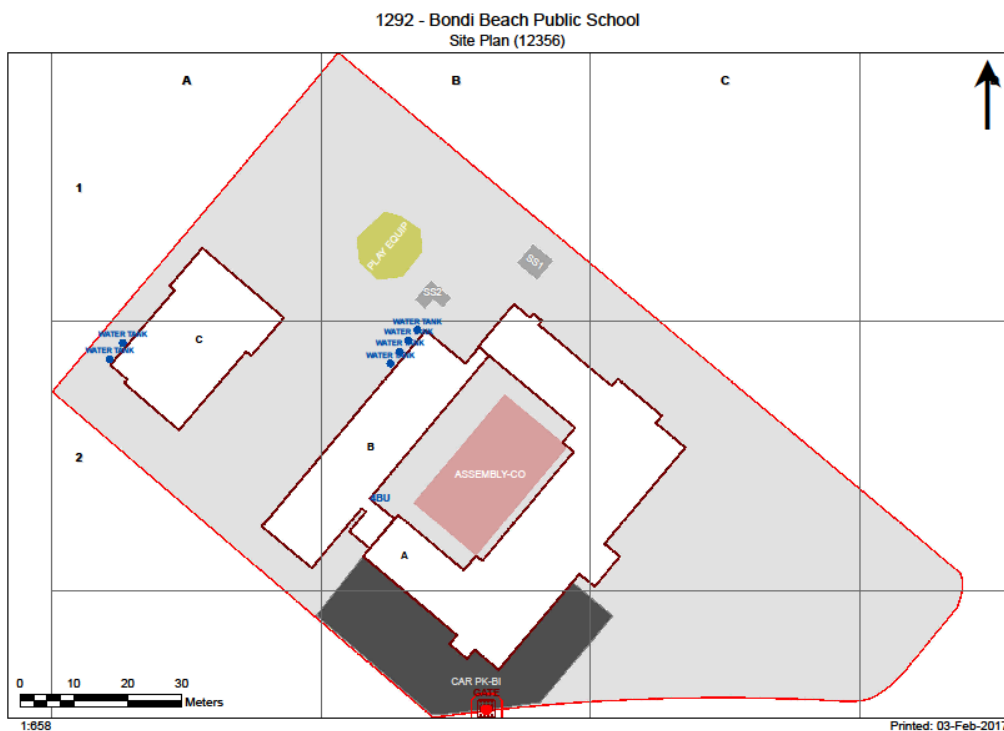

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - Administration/General Learning - 1923 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	120m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible - due to storage and debris.					
Interior						
B00A - R0001 - General Storeroom (12.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1292/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00A - R0002 - General Storeroom (2.07 m2)						
No Asbestos						
B00A - R0003 - Movement (4.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1292/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00A - R0004 - Movement (1.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00A - R0005 - Movement (22.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0006 - Practical Activities - 1hb (40.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	41m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0007 - Home Base (47.46 m2)						
No Asbestos						
B00A - R0008 - Home Base (47.46 m2)						
No Asbestos						
B00A - R0009 - Movement (23.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0010 - Home Base (53.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1292/B00A/R0010/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00A - R0011 - Practical Activities - 1hb (8.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1292/B00A/R0010/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00A - R0012 - Movement (73.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	74m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0013 - Movement (3.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0014 - Out Of School Hours Care Centre (47.44 m2)						
No Asbestos						
B00A - R0015 - Out Of School Hours Care Centre (17.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1292/B00A/R0015/Floor Coverings Res/Textile/S4					No Asbestos Detected	
B00A - R0016 - Practical Activities - 1hb (25.55 m2)						
No Asbestos						
B00A - R0017 - Toilets - Boys/Girls (2.88 m2)						
No Asbestos						
B00A - R0018 - Staff Room (47.09 m2)						
No Asbestos						
B00A - R0019 - Sick Bay (14.81 m2)						
No Asbestos						
B00A - R0020 - General Storeroom (5.5 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R0021 - Clerical Office (14.97 m2)						
No Asbestos						
B00A - R0022 - Entry Vestibule (12.28 m2)						
No Asbestos						
B00A - R0023 - Movement (19.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0024 - Movement (35.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0025 - Home Base (46.95 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	47m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0026 - Home Base (46.95 m2)						
No Asbestos						
B00A - R0027 - Home Base (47.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0028 - Movement (105.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	100m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R0029 - Home Base (47.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
B00A - R0030 - Home Base (96.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	97m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0030/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0031 - Movement (4.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
B00A - R0032 - Cleaning Distributed Store (5.12 m2)						
No Asbestos						
B00A - R0033 - Movement (2.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0010/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)		
B00A - R0034 - Security Store (12.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00A - R0035 - Interview (15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
B00A - R0036 - General Storeroom (22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
B00A - R0037 - Staff Room Annexe (17.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
B00A - R0038 - Principal (22.55 m2)						
No Asbestos						
B00A - R0039 - General Storeroom (18.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)		
B00A - R0040 - Staff Toilet (3.81 m2)						
No Asbestos						
B00A - R0041 - Staff Toilet (3.81 m2)						
No Asbestos						
B00A - R0042 - Movement (2.1 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0010/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R0043 - Movement (7.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0044 - Sports Store (5.23 m2)						
No Asbestos						
B00A - R0045 - Movement (1.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0046 - Stairs (7.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0047 - Stairs (6.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0048 - Stairs (7.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R1001 - General Storeroom (13.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R1002 - Movement (18.06 m2)						
No Asbestos						
B00A - R1003 - General Storeroom (8.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1004 - Other-Community Use (21.46 m2)						
No Asbestos						
B00A - R1005 - Home Base (46.95 m2)						
No Asbestos						
B00A - R1006 - Other-Community Use (40.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	41m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1015/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R1007 - Home Base (47.81 m2)						
No Asbestos						
B00A - R1008 - Home Base (62.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	63m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1015/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R1009 - Practical Activities - 1hb (16.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1015/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R1010 - Home Base (48.9 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1011 - Movement (42.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R1012 - Home Base (48.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	49m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1015/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R1013 - Home Base (46.95 m2)						
No Asbestos						
B00A - R1014 - Home Base (53.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1015/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R1015 - Home Base (48.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	49m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1015/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R1016 - Home Base (48.41 m2)						
No Asbestos						
B00A - R1017 - Home Base (48.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R1018 - General Storeroom (12.96 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R1019 - Home Base (47.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R1020 - Home Base (47.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	48m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00A/R0045/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R1021 - Home Base (47.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	48m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0020/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R1022 - Movement (81.81 m2)						
No Asbestos						
B00A - R1023 - Sports Store (12.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1024 - Communal Space (146.46 m2)						
No Asbestos						
B00A - R1025 - Raised Platform (17.36 m2)						
No Asbestos						
B00A - R1026 - General Storeroom (12.24 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1027 - Movement (4.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R1028 - Stairs (12.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1029 - Stairs (11.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R0012/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1030 - Stairs (7.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1292/B00A/R1002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Pupil Facilities - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Area inaccessible - raked ceiling

Underfloor Voids - Slab on Ground
No Asbestos Found

Interior**B00B - R0001 - Toilets - Boys (38.98 m2)**

Partition Walls (Cubicles) Compressed AC Sheet 15m2 North facing Good Condition (1) Low (1) Low Priority (2-3)
1292/B00B/R1004/Partition Walls (Cubicles)/S13 **Chrysotile (white asbestos)**

B00B - R0002 - Toilets - Girls (32.86 m2)

Partition Walls (Cubicles) Compressed AC Sheet 20m2 North facing Good Condition (1) Low (1) Low Priority (2-3)
1292/B00B/R1004/Partition Walls (Cubicles)/S13 **Chrysotile (white asbestos)**

B00B - R0003 - Shower/Change (6.72 m2)

No Asbestos

B00B - R0004 - Shower/Change (6.78 m2)

No Asbestos

B00B - R0005 - Sports Store (18.18 m2)

No Asbestos

B00B - R0006 - Movement (278.31 m2)

No Asbestos

B00B - R0007 - Canteen (43.38 m2)

No Asbestos

B00B - R0009 - Canteen Office/Store (7.2 m2)

No Asbestos

B00B - R0010 - Canteen Office/Store (2.73 m2)

No Asbestos

B00B - R0011 - Cleaning Distributed Store (8.04 m2)

No Asbestos

B00B - R0012 - Toilets - Boys (41.63 m2)

Partition Walls (Cubicles) Compressed AC Sheet 15m2 East facing Good Condition (1) Low (1) Low Priority (2-3)
1292/B00B/R1004/Partition Walls (Cubicles)/S13 **Chrysotile (white asbestos)**

B00B - R0013 - Toilets - Girls (51.98 m2)

Partition Walls (Cubicles) Compressed AC Sheet 20m2 South facing, West facing Good Condition (1) Low (1) Low Priority (2-3)
1292/B00B/R1004/Partition Walls (Cubicles)/S13 **Chrysotile (white asbestos)**

B00B - R0014 - Garden Store (7.79 m2)

No Asbestos

B00B - R0015 - Stairs (7.84 m2)

Ceiling Structures/Linings Flat AC Sheeting 8m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1292/B00B/R1023/Ceiling Structures/Linings/S7 **Chrysotile (white asbestos)**

B00B - R0016 - Stairs (5.07 m2)

Ceiling Structures/Linings Flat AC Sheeting 6m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
1292/B00B/R1023/Ceiling Structures/Linings/S7 **Chrysotile (white asbestos)**

B00B - R0017 - Toilet - Lobby (1.68 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0018 - Toilets-Unisex (1.7 m2)						
No Asbestos						
B00B - R1001 - Movement (8.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00B/R1001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00B - R1002 - Staff Room Annexe (12.38 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1003 - Cleaning Supplies (8.55 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1004 - Staff Toilet (3.36 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00B/R1004/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00B - R1005 - Staff Toilet (3.53 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00B/R1004/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00B - R1006 - Movement (9.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00B/R1006/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1007 - Home Base (74.75 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1008 - General Storeroom (9.98 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1009 - Home Base (82.39 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1011 - Movement (1.5 m2)						
Ceiling Structures/Linings	Vermiculite					
1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Wall Linings Internal	Flat AC Sheeting	1m2	North facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1292/B00B/R1011/Wall Linings Internal/S14					Chrysotile (white asbestos)	
B00B - R1012 - Toilets - Girls (2.8 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 1292/B00B/R1004/Partition Walls (Cubicles)/S13	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1013 - Distribution Board (0.98 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Flat AC Sheeting 1292/B00B/R1011/Wall Linings Internal/S14	1m2	North facing, East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1014 - Movement (1.36 m2)						
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R1015 - Toilets - Boys (3.04 m2)						
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 1292/B00B/R1004/Partition Walls (Cubicles)/S13	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1016 - Cleaning Distributed Store (1.51 m2)						
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R1017 - Library Office/Workroom (18.7 m2)						
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R1018 - Security Store (12.57 m2)						
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R1019 - Library Office/Workroom (7.66 m2)						
Ceiling Structures/Linings	Vermiculite 1292/B00B/R1006/Ceiling Structures/Linings/S12					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R1022 - Movement (79.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1292/B00B/R1023/Ceiling Structures/Linings/S7	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1023 - Movement (2.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1292/B00B/R1023/Ceiling Structures/Linings/S7	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1024 - Stairs (21.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1292/B00B/R1023/Ceiling Structures/Linings/S7	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1025 - Reading Area (196.18 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings

Vermiculite

1292/B00B/R1006/Ceiling Structures/Linings/S12

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00C - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Communal Space (238.2 m2)

No Asbestos

B00C - R0002 - Hall Chair Store (9.51 m2)

No Asbestos

B00C - R0003 - Communal/Performance Store (9.59 m2)

No Asbestos

B00C - R0004 - P.E. Store (13.08 m2)

No Asbestos

B00C - R0005 - Toilet - Lobby (2.4 m2)

No Asbestos

B00C - R0006 - Toilets - Girls (7.38 m2)

No Asbestos

B00C - R0007 - Sound Cupboard (2.07 m2)

No Asbestos

B00C - R0008 - Toilet - Lobby (3.38 m2)

No Asbestos

B00C - R0009 - Toilets - Boys (5.73 m2)

No Asbestos

B00C - R0010 - Plant (1.61 m2)

No Asbestos

B00C - R0011 - Cleaning Distributed Store (3.59 m2)

No Asbestos

B00C - R0012 - Access Shower/Toilet/Change (6.7 m2)

No Asbestos

B00C - R0013 - Main Switch Board (3.39 m2)

No Asbestos

B00C - R0014 - Covered Outdoor Learning Area (185.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017