


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bonshaw Public School (1296)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Inverell

Initial Survey : Noel Arnold & Associates : 06 - Jun - 2008
Register Issue Date : 22 - Mar - 2017

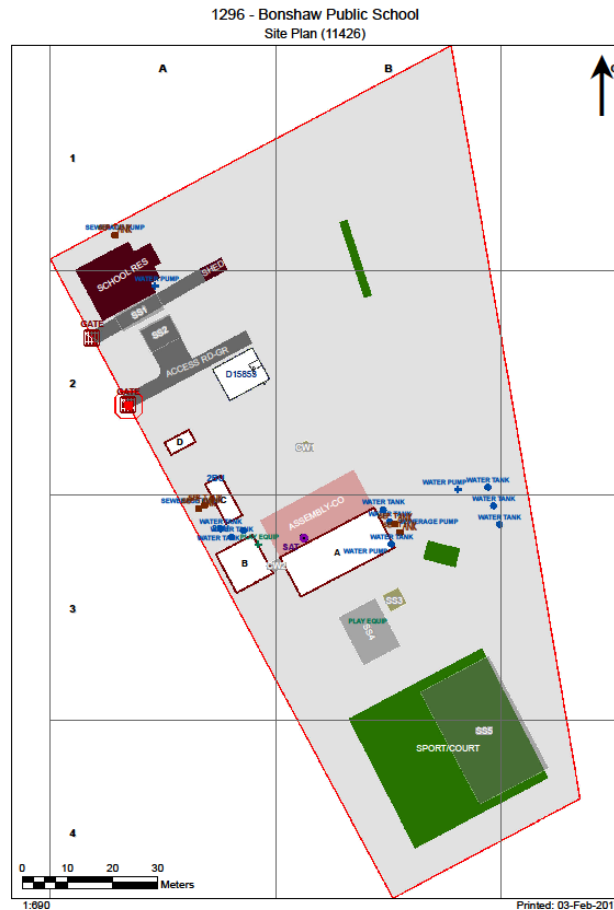

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Staff Facilities - 1975 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior**B00A - R0001 - Toilets - Boys/Girls**

Floor Coverings Res/Textile	Vinyl Tiles					
	1296/B00B/R0002/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0002 - General Storeroom

No Asbestos

B00A - R0003 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles					
	1296/B00B/R0002/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00A/R0009/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00A - R0006 - Staff Room

No Asbestos

B00A - R0007 - Principal

No Asbestos

B00A - R0008 - General Storeroom

No Asbestos

B00A - R0009 - External Movement

Floor Coverings Res/Textile	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00A/R0009/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

	1296/B00A/R0009/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
--	---	--	--	--	--	------------------------------------

Wall Linings Internal	Flat AC Sheeting	20m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	-------------------	--------------------	---------	--------------------

	1296/B00A/R0009/Wall Linings Internal/S7					Chrysotile (white asbestos)
--	--	--	--	--	--	------------------------------------

B00A - R9001 - External Movement

No Asbestos

B00A - R9002 - Drinking Facilities

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/General Learning - 1913 - Timber (Timber)**Exterior**

Wall Cladding	Compressed AC Sheet	20m2	Throughout, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00B/Wall Cladding/S2					Chrysotile (white asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00B - R0001 - Reading Area**

No Asbestos

B00B - R0002 - Practical Activities - 1hb

Panels Below Windows	Compressed AC Sheet	10m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00B/Wall Cladding/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1296/B00B/R0002/Floor Coverings Res/Textile/S3					
Electrical Mounting Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00B/R0002/Electrical Mounting Board/S4					Chrysotile (white asbestos)
Panels Above Doors and Windows	Compressed AC Sheet	4m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00B/Wall Cladding/S2					Chrysotile (white asbestos)

B00B - R0003 - K.L.A. Store

Panels Above and Below Windows	Compressed AC Sheet	20m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00B/Wall Cladding/S2					Chrysotile (white asbestos)

B00B - R9001 - Cleaning Supplies

No Asbestos

B00B - R9002 - Sports Store

No Asbestos

B00B - R9003 - External Movement

No Asbestos

B00B - R9004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Staff Facilities - 1930 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00C - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00C/R0005/Ceiling Structures/Linings/S1 Chrysotile (white asbestos)					

B00C - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00C/R0005/Ceiling Structures/Linings/S1 Chrysotile (white asbestos)					

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00C/R0005/Ceiling Structures/Linings/S1 Chrysotile (white asbestos)					

B00C - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00C/R0005/Ceiling Structures/Linings/S1 Chrysotile (white asbestos)					

B00C - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1296/B00C/R0005/Ceiling Structures/Linings/S1 Chrysotile (white asbestos)					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 1975 - Timber Shed (Timber Shed)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D15853 - Learning Unit - Standard With P.A.A. : Placement Date - 25/01/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017