


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bonville Public School (1297)
Region : North Coast
State Electorate : Coffs Harbour
Local Government Area : Coffs Harbour

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Greencap-NAA : 05 - May - 2016

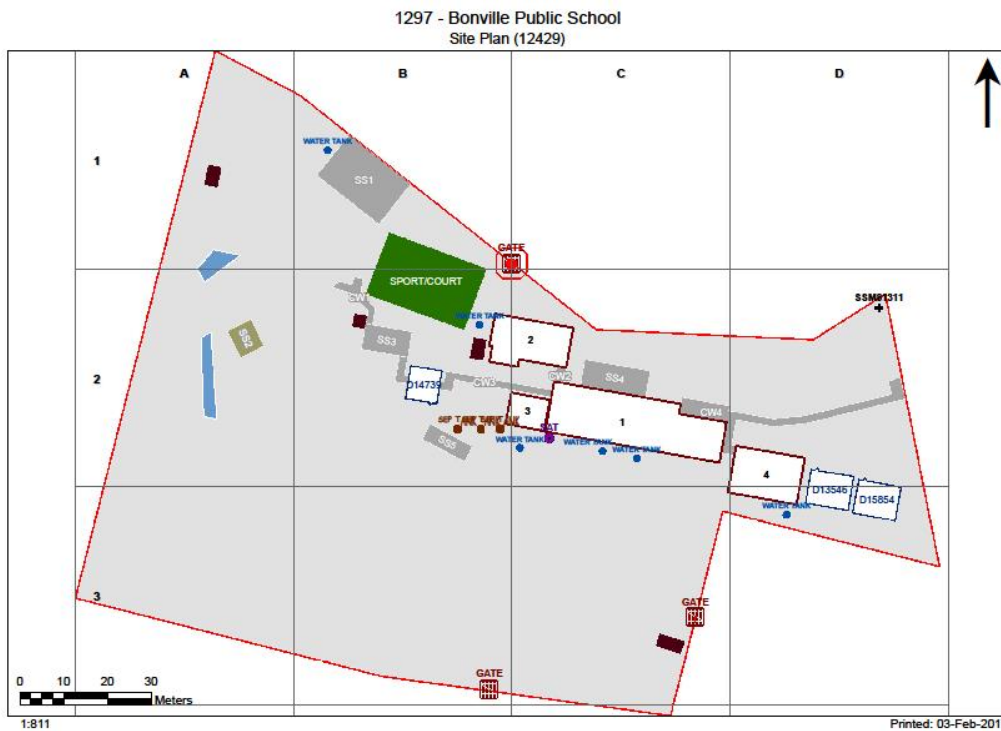

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning/Library - 1951 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1297/B001/R0006/Ceiling Structures/Linings/S10					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B001 - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1297/B001/R0006/Ceiling Structures/Linings/S10					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B001 - R0002 - Cleaning Supplies

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B001/R0013/Wall Linings Internal/S7					Chrysotile (white asbestos)

B001 - R0003 - Security Store

No Asbestos

B001 - R0004 - Home Base

No Asbestos

B001 - R0005 - Practical Activities - 1hb

No Asbestos

B001 - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1297/B001/R0006/Ceiling Structures/Linings/S10					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B001 - R0008 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 1297/B001/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1297/B001/R0012/Floor Coverings Res/Textile/S9					No Asbestos Detected

B001 - R0009 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1297/B001/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1297/B001/R0012/Floor Coverings Res/Textile/S9					No Asbestos Detected

B001 - R0010 - Special Programs Room

Floor Coverings Res/Textile	Adhesive 1297/B001/R0012/Floor Coverings Res/Textile/S9					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1297/B001/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected

B001 - R0011 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 1297/B001/R0012/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 1297/B001/R0013/Floor Coverings Res/Textile/S6					No Asbestos Detected

B001 - R0012 - Home Base

Floor Coverings Res/Textile	Adhesive 1297/B001/R0012/Floor Coverings Res/Textile/S9					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	1297/B001/R0012/Floor Coverings Res/Textile/S8				No Asbestos Detected	
B001 - R0013 - Withdrawal Space - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B001/R0013/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	1297/B001/R0013/Floor Coverings Res/Textile/S6				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B001/R0013/Wall Linings Internal/S7				Chrysotile (white asbestos)	
B001 - R0015 - Canteen						
Wall Linings Internal	Flat AC Sheeting	12m2	South & East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B001/R0013/Wall Linings Internal/S7				Chrysotile (white asbestos)	
B001 - R0016 - External Movement						
No Asbestos						
B001 - R0017 - Staff Kitchen						
No Asbestos						
B001 - R0018 - Staff Room						
No Asbestos						
B001 - R0019 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B001/R0013/Wall Linings Internal/S7				Chrysotile (white asbestos)	
B001 - R0020 - Toilet - Lobby						
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B001/R0013/Wall Linings Internal/S7				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - Administration/General Learning - 1979 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting 1297/B002/Gable Verge Lining/S1					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1297/B002/Eaves Linings/S2	4m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Medium (2)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard

Interior

B002 - R0001 - Principal

No Asbestos

B002 - R0002 - Clerical Office

No Asbestos

B002 - R0003 - Entry Vestibule

No Asbestos

B002 - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1297/B002/Eaves Linings/S2	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B002 - R0005 - Home Base

No Asbestos

B002 - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles 1297/B002/R0008/Floor Coverings Res/Textile/S3	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1297/B002/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected

B002 - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 1297/B002/R0008/Floor Coverings Res/Textile/S3	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1297/B002/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected

B002 - R0008 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles 1297/B002/R0008/Floor Coverings Res/Textile/S3	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 1297/B002/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected

B002 - R0009 - Kiln Room

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Pupil Facilities - 1979 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B003/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible no access point					

Interior

B003 - R0001 - Disabled Toilet

No Asbestos

B003 - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B003/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	

B003 - R0003 - Cleaning Supplies

No Asbestos

B003 - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B003/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B003/R0004/Partition Walls (Cubicles)/S11				Chrysotile (white asbestos)	

B003 - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B003/R0002/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1297/B003/R0004/Partition Walls (Cubicles)/S11				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B004 - R0001 - Reading Area

No Asbestos

B004 - R0002 - Library Office/Workroom

No Asbestos

B004 - R0003 - Communications Room

No Asbestos

B004 - R0004 - K.L.A. Store

No Asbestos

B004 - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13546 - Learning Unit - Standard With P.A.A. : Placement Date - 13/10/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 801 - D14739 - FSU : Placement Date - 15/10/1997

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	45 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

OS 602 - D15854 - Learning Unit - Standard With P.A.A. : Placement Date - 25/02/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017