


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Boolaroo Public School (1302)
Region : Hunter/Central Coast
State Electorate : Lake Macquarie
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 30 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Jun - 2015

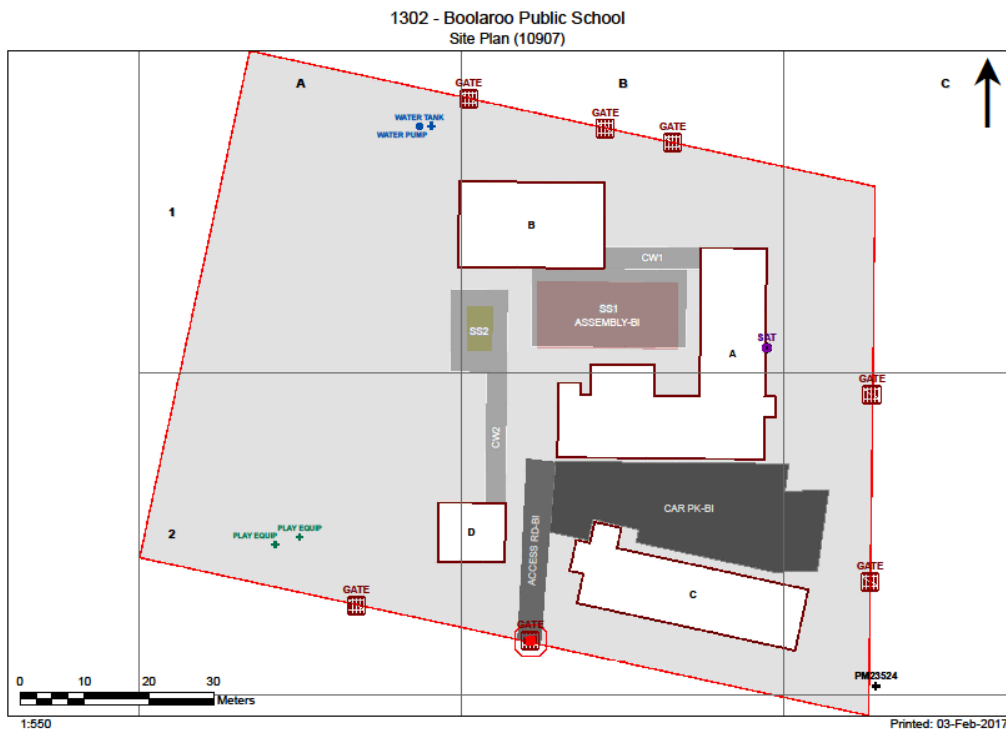

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1902 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Compressed AC Sheet	8m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1302/B00C/Underfloor Voids/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00A - R0001 - Home Base**

No Asbestos

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - Cleaning Supplies

No Asbestos

B00A - R0005 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00A/R0010/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00A - R0006 - Home Base

No Asbestos

B00A - R0012 - Principal

No Asbestos

B00A - R0013 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Sheet					
	1302/B00A/R0013/Floor Coverings Res/Textile/S15					No Asbestos Detected

B00A - R0014 - Sick Bay

No Asbestos

B00A - R0019 - Home Base

No Asbestos

B00A - R0020 - Disabled Shower/Toilet

No Asbestos

B00A - R0021 - Staff Kitchen

Recently Modified Space Requires Inspection

B00A - R0022 - Staff Room

Recently Modified Space Requires Inspection

B00A - R0023 - Staff Toilet

Recently Modified Space Requires Inspection

B00A - R0024 - Toilet - Lobby

Recently Modified Space Requires Inspection

B00A - R0025 - Movement

Recently Modified Space Requires Inspection

B00A - R0026 - Clerical Office

Recently Modified Space Requires Inspection

B00A - R0027 - Practical Activities - 4hb

Recently Modified Space Requires Inspection

B00A - R0028 - Practical Activities - 1hb

Recently Modified Space Requires Inspection

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/Communal Facilities - 1977 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	2m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1302/B00B/Gable Verge Lining/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00B - R0002 - P.E. Store

No Asbestos

B00B - R0003 - Canteen

Floor Coverings Res/Textile	Vinyl Sheet					
	1302/B00B/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0004 - Canteen Office/Store

No Asbestos

B00B - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Sheet					
	1302/B00B/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0006 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Sheet					
	1302/B00B/R0006/Floor Coverings Res/Textile/S14				No Asbestos Detected	

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard - Unable to access**B00B - R0007 - Staff Toilet**

No Asbestos

B00B - R0008 - Communal Space

No Asbestos

B00B - R0009 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	East	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1302/B00B/R0009/Partition Walls (Cubicles)/S17				Chrysotile (white asbestos)	

B00B - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00B - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00B - R0012 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1302/B00B/R0009/Partition Walls (Cubicles)/S17				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - Other-D.E.C. Admin/Pupil Facilities - 1902 - Timber (Timber)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Compressed AC Sheet	6m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1302/B00C/Underfloor Voids/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Interior						
B00C - R0001 - Uniform Shop						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0009/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet				No Asbestos Detected	
	1302/B00C/R0001/Floor Coverings Res/Textile/S16					
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0001/Wall Linings Internal/S2				Chrysotile (white asbestos)	
B00C - R0002 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0009/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0001/Wall Linings Internal/S2				Chrysotile (white asbestos)	
B00C - R0003 - Home Base						
Chalk Board	Flat AC Sheeting	8m2	North, East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0003/Chalk Board/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00C - R0004 - Home Base						
Chalk Board	Flat AC Sheeting	5m2	North, East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0003/Chalk Board/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00C - R0005 - Home Base						
No Asbestos						
B00C - R0006 - Home Base						
Chalk Board	Flat AC Sheeting	6m2	North, East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0003/Chalk Board/S18				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00C - R0007 - Toilets - Boys						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0007/Wall Linings Internal/S11				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0009/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
B00C - R0008 - Entry Vestibule						
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0007/Wall Linings Internal/S11				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0009/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
B00C - R0009 - Staff - Toilet						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)
B00C - R0010 - Store						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0010/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)
B00C - R0011 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1302/B00C/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard - Unable to access
B00C - R0012 - General Assistant/Bulk Store						
Wall Linings Internal	Flat AC Sheeting					
	1302/B00C/R0012/Wall Linings Internal/S13					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 2011 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - Reading Area

No Asbestos

B00D - R0003 - K.L.A. Store

No Asbestos

B00D - R0004 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017