


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Booligal Public School (1303)  
**Region :** Riverina  
**State Electorate :** Murray  
**Local Government Area :** Hay

**Initial Survey :** Noel Arnold & Associates : 09 - May - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

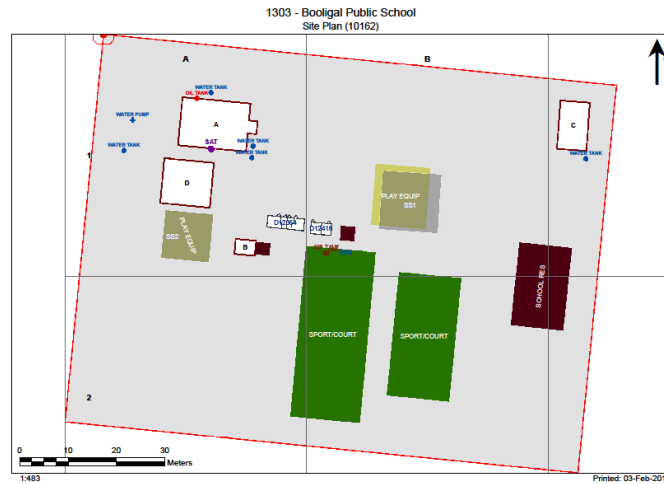

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Library - 1900 - Timber (Timber)****Exterior**

Wall Cladding	Flat AC Sheeting 1303/B00A/R0001/Wall Linings Internal/S2					<b>No Asbestos Detected</b>
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior****B00A - R0001 - Movement**

Floor Coverings Res/Textile	Compressed AC Sheet 1303/B00A/R0001/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting 1303/B00A/R0001/Wall Linings Internal/S2					<b>No Asbestos Detected</b>

**B00A - R0002 - External Movement**

Splashback lining	Flat AC Sheeting	3m2	West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1303/B00A/R0002/splashback/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0003 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1303/B00A/R0003/Floor Coverings Res/Textile/S4	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 1303/B00A/R0003/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>

**B00A - R0005 - General Storeroom**

No Asbestos

**B00A - R0006 - Home Base Store**

No Asbestos

**B00A - R0007 - Clerical Office**

No Asbestos

**B00A - R0008 - Principal**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Building Services - 2007 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00B - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Administration - 2009 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00C - R0001 - Covered Outdoor Learning Area**

No Asbestos

**B00C - R0002 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00D - R0001 - Reading Area**

No Asbestos

**B00D - R0002 - K.L.A. Store**

No Asbestos

**B00D - R0003 - Practical Activities**

No Asbestos

**B00D - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 844 - D12364 - Country Toilet - Reltc - Boys/Girls : Placement Date - 30/06/1995

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

#### Interior

##### R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

##### R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

OS 844 - D12418 - Country Toilet - Reltc - Boys/Girls : Placement Date - 8/02/2005

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

#### Interior

##### R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

##### R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017