


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Boomi Public School (1307)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Moree Plains

Initial Survey : Noel Arnold & Associates : 15 - May - 2008
Reviewed By : Grencap-NAA : 04 - May - 2016

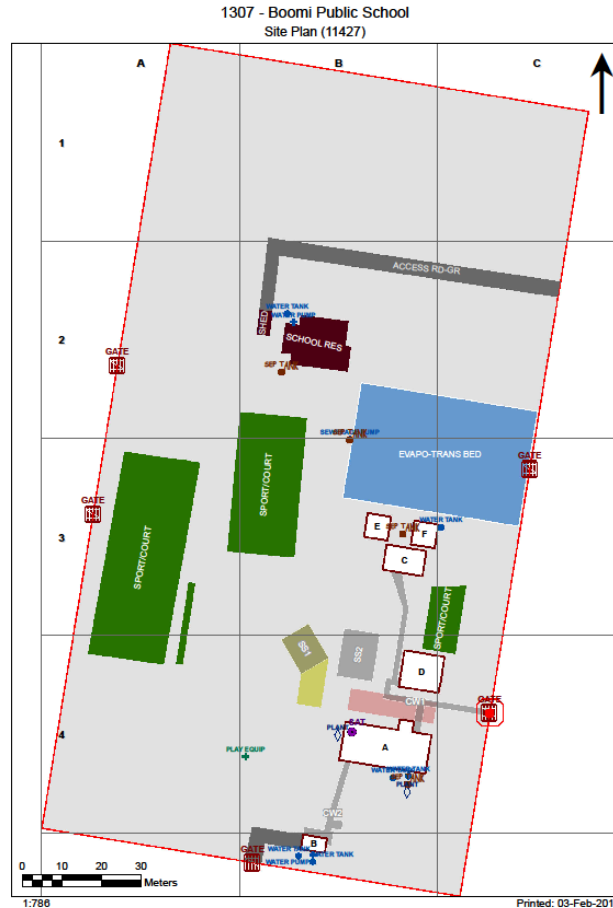

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Admin/General Learning - 1961 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- height - 3.6					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00A - R0001 - Plant

Wall Linings Internal	Flat AC Sheeting	4m2	East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00A/R1006/Wall Linings Internal/S1					Chrysotile (White asbestos)

B00A - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	1307/B00A/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected

B00A - R0003 - External Movement

Recently Modified Space	Requires Inspection					
-------------------------	---------------------	--	--	--	--	--

B00A - R1001 - Clerical Office/Workroom

Ceiling Structures/Linings	Flat AC Sheeting	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00A/R1001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R1002 - Principal

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R1003 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	9m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00A/R1006/Wall Linings Internal/S1					Chrysotile (White asbestos)

B00A - R1004 - Home Base

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R1005 - General Storeroom

Electrical Mounting Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00A/R1005/Electrical Mounting Board/S8					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles					
	1307/B00A/R1010/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00A - R1008 - Reading Area

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R1009 - K.L.A. Store

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R1010 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles					
	1307/B00A/R1010/Floor Coverings Res/Textile/S2					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00A/R1006/Wall Linings Internal/S1					Chrysotile (White asbestos)

B00A - R1011 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	1307/B00A/R1010/Floor Coverings Res/Textile/S2					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00A/R1006/Wall Linings Internal/S1					Chrysotile (White asbestos)

B00A - R1012 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1307/B00A/R1001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1013 - Kitchen - Pre						
Ceiling Structures/Linings	Flat AC Sheeting	7.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1307/B00A/R1001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1307/B00A/R1013/Wall Linings Internal/S9				Chrysotile (white asbestos)		
Heat-proof Mat	Fibrous Membrane					No Asbestos Detected
1307/B00A/R1013/Heat-proof Mat/S10						
B00A - R1014 - Special Programs Room						
Ceiling Structures/Linings	Flat AC Sheeting	14.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1307/B00A/R1001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1015 - External Movement						
Recently Modified Space	Requires Inspection					
B00A - R1016 - External Movement						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1950 - Timber (Timber)**Exterior**

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00B/Electrical Backing Board/S11				Chrysotile (white asbestos)	
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - no man hole access					

Interior**B00B - R0001 - Sports Store**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00B/R0001/Floor Coverings Res/Textile/S5				Chrysotile (White asbestos)	

B00B - R0002 - Canteen

Wall Linings Internal	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00B/R0002/Wall Linings Internal/S4				Chrysotile (White asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1961 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/Eaves Linings/S12					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

Interior

B00C - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0003/Partition Walls (Cubicles)/S6					Chrysotile (White asbestos)

B00C - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0003/Partition Walls (Cubicles)/S6					Chrysotile (White asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0002/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0003/Partition Walls (Cubicles)/S6					Chrysotile (White asbestos)

B00C - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0003/Partition Walls (Cubicles)/S6					Chrysotile (White asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0002/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	9m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0003/Partition Walls (Cubicles)/S6					Chrysotile (White asbestos)

B00C - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1307/B00C/R0002/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - K.L.A. Store

No Asbestos

B00D - R0003 - Practical Activities

No Asbestos

B00D - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Storage - 2015 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00E - R0001 - General Storeroom

No Asbestos

B00E - R0002 - Other

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - 2015 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00F - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017