


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Booral Public School (1311)
Region : North Coast
State Electorate : Upper Hunter
Local Government Area : Great Lakes

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

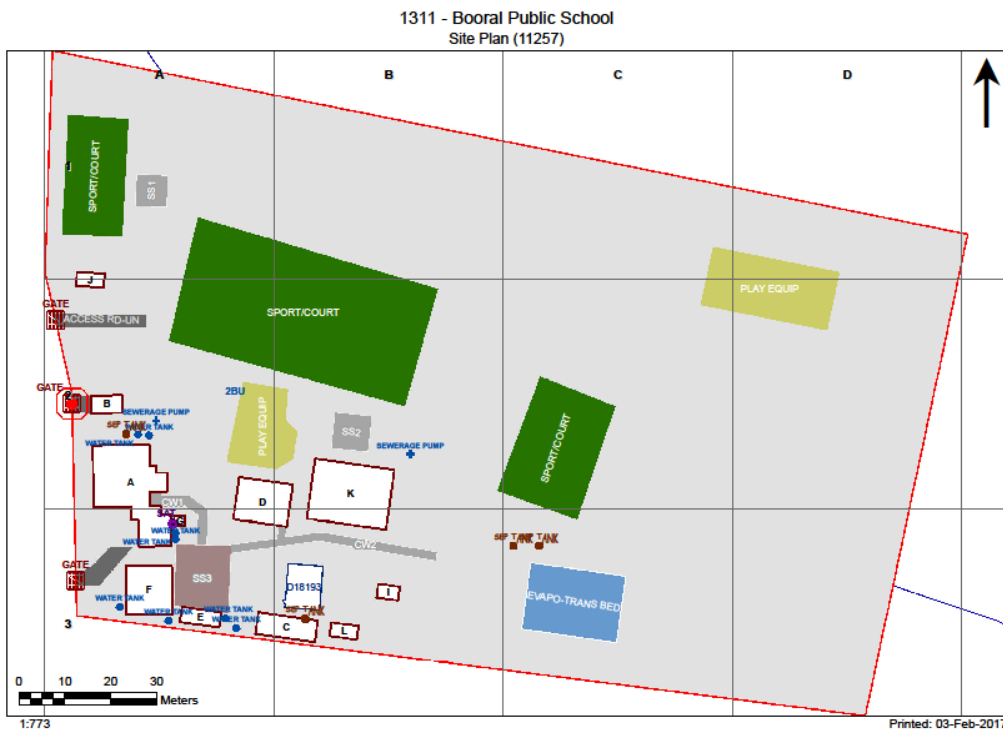

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1883 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1311/B00A/Eaves Linings/S12					No Asbestos Detected
Window Frames	Putty 1311/B00A/Window Frames/S16					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00A - R0001 - Staff Room Annexe**

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00A/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - External Movement

No Asbestos

B00A - R0003 - Canteen

Wall Linings Internal	Flat AC Sheeting 1311/B00A/R0007/Wall Linings Internal/S2					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0004 - Laundry - Type 2

No Asbestos

B00A - R0005 - Staff Toilet

No Asbestos

B00A - R0006 - Cleaning Distributed Store

No Asbestos

B00A - R0007 - Staff Shower/Change

Wall Linings Internal	Flat AC Sheeting 1311/B00A/R0007/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Manhole	Flat AC Sheeting 1311/B00A/R0007/Ceiling Manhole/S15					No Asbestos Detected

B00A - R0008 - Withdrawal Space - 1hb

No Asbestos

B00A - R0009 - Movement

No Asbestos

B00A - R0010 - Clerical Office

No Asbestos

B00A - R0011 - General Storeroom

No Asbestos

B00A - R0012 - External Movement

Wall Linings Internal	Flat AC Sheeting	24m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00A/R0012/Wall Linings Internal/S3					Chrysotile (white asbestos)

B00A - R0013 - Principal

No Asbestos

B00A - R0014 - Interview

No Asbestos

B00A - R0015 - External Movement

No Asbestos

B00A - R0016 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00A/R0016/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0017 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1311/B00A/R0016/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0018 - Staff Room						
Floor Coverings Res/Textile	Vinyl Tiles					
1311/B00A/R0018/Floor Coverings Res/Textile/S5				No Asbestos Detected		
B00A - R0019 - Sports Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration - 1950 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00B/R0001/Wall Linings Internal/S11				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

Interior**B00B - R0001 - General Assistants**

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00B/R0001/Wall Linings Internal/S11				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Staff Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior**B00C - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1311/B00C/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00C - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1311/B00C/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00C - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1311/B00C/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00C - R0005 - Disabled Shower/Toilet

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1311/B00C/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00C - R0006 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1311/B00C/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00C - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1311/B00C/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1912 - Timber (Timber)

Exterior

Window Frames	Putty 1311/B00D/Window Frames/S17					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00D - R0001 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 1311/B00D/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 1311/B00D/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00D - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00D/R0004/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1990 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Canteen Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1959 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00F/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Window Frames	Putty				No Asbestos Detected	
	1311/B00F/Window Frames/S18					
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00F - R0001 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Tiles				No Asbestos Detected	
	1311/B00F/R0001/Floor Coverings Res/Textile/S7					

B00F - R0002 - Withdrawal Space - 1hb

No Asbestos

B00F - R0003 - Home Base

No Asbestos

B00F - R0006 - Practical Activities

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1311/B00F/R0006/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 1980 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00G - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Staff Facilities - 2006 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00I - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Sports Store - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - P.E. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00K - R0001 - External Movement

No Asbestos

B00K - R0002 - Practical Activities - 1hb

No Asbestos

B00K - R0003 - Home Base Store

No Asbestos

B00K - R0004 - Home Base

No Asbestos

B00K - R0005 - Withdrawal Space - 2hb

No Asbestos

B00K - R0006 - Home Base

No Asbestos

B00K - R0007 - Home Base Store

No Asbestos

B00K - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 531 - D18193 - Library : Placement Date - 1/09/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry/classroom

No Asbestos Found.

R2 - Reading Area/workroom

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017