


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Boorowa Central School (1313)  
**Region :** Illawarra and South East  
**State Electorate :** Goulburn  
**Local Government Area :** Boorowa

**Initial Survey :** Noel Arnold & Associates : 12 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 13 - Jul - 2015

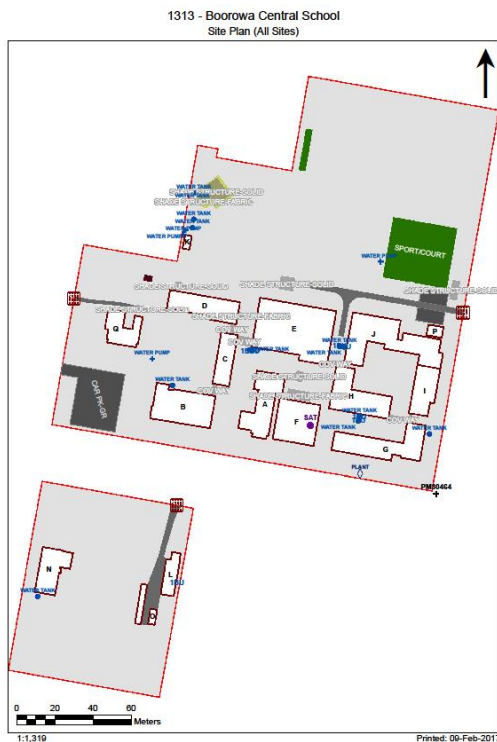

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1993 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00A - R0001 - External Movement (27.77 m2)**

No Asbestos

**B00A - R0002 - Cleaning Supplies (9.21 m2)**

Ceiling access cover	Flat AC Sheeting 1313/B00A/R0002/Ceiling access cover/S10	<b>No Asbestos Detected</b>
----------------------	--------------------------------------------------------------	-----------------------------

**B00A - R0003 - Cleaning Distributed Store (3.6 m2)**

No Asbestos

**B00A - R0004 - Disabled Toilet (6.04 m2)**

No Asbestos

**B00A - R0005 - External Movement (5.94 m2)**

No Asbestos

**B00A - R0006 - Staff Room Annexe (18.71 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00A - R0007 - Staff Room (51.4 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00A - R0008 - Distribution Board (0.66 m2)**

Note: No inspection of live electrical installation.

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00A - R0009 - Movement (50.72 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00A - R0010 - Staff Room Annexe (13.89 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00A - R0011 - Toilets - Girls (4.19 m2)**

No Asbestos

**B00A - R0012 - Sick Bay (13.89 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00A - R0013 - Staff Toilet (5.21 m2)**

No Asbestos

**B00A - R0014 - Staff Toilet (5.25 m2)**

No Asbestos

**B00A - R0015 - Toilets - Boys (4.2 m2)**

No Asbestos

**B00A - R0016 - Sick Bay (13.89 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00A - R0017 - External Movement (1.2 m2)**

No Asbestos

**B00A - R0018 - External Movement (2.03 m2)**

No Asbestos

**B00A - R0019 - Interview (13.89 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R0020 - Duplicating Workroom (31.17 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Clerical Office/Workroom (35.22 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R0022 - Security Store (19.29 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Movement (6.21 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R0024 - Principal (14.55 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R0025 - General Storeroom (1.21 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R0026 - Entry Vestibule (22.21 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R0027 - External Movement (13.78 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1966 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	35m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

**Assumed Asbestos - No access due to height restrictions.**

In-fill-panel	Flat AC Sheeting	6m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-----	------------------------------	--------------------	---------	--------------------

**Assumed Asbestos - No access due to height restrictions.**

Ceiling Voids	Non Accessible Area - Unable to access ceiling void due to height restrictions. Ceiling access point is above 4.2 metres.					
---------------	---------------------------------------------------------------------------------------------------------------------------------	--	--	--	--	--

Underfloor Voids - Slab on Ground	No Asbestos Found					
-----------------------------------	-------------------	--	--	--	--	--

**Interior****B00B - R0001 - Staff Room Annexe (17.58 m2)**

No Asbestos

**B00B - R0002 - Home Base (47.33 m2)**

No Asbestos

**B00B - R0003 - Movement (36.23 m2)**

No Asbestos

**B00B - R0004 - Practical Activities - 1hb (4.24 m2)**

No Asbestos

**B00B - R0005 - Movement (19.53 m2)**

No Asbestos

**B00B - R0006 - Practical Activities - 1hb (3.99 m2)**

No Asbestos

**B00B - R0008 - Home Base (44.59 m2)**

No Asbestos

**B00B - R0009 - Home Base (43.77 m2)**

No Asbestos

**B00B - R0010 - Home Base (44.04 m2)**

No Asbestos

**B00B - R0012 - Staff Study (13.63 m2)**

No Asbestos

**B00B - R0013 - Movement (8.46 m2)**

No Asbestos

**B00B - R0014 - Outdoor Learning Area (181.63 m2)**

No Asbestos

**B00B - R0015 - Special Learning Space (29.87 m2)**

No Asbestos

**B00B - R0016 - Reading Area (13.59 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Special Purpose - 1960 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids Non Accessible Area  
- No ceiling access point to access void.

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00C - R0001 - Handwashing Facilities (15.89 m2)**

No Asbestos

**B00C - R0002 - Toilets - Boys (27.52 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1313/B00C/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>	

**B00C - R0003 - No Access (34.11 m2)**

Floor Coverings Res/Textile	Vinyl Tiles				
1313/B00C/R0003/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>

**B00C - R0004 - General Storeroom (7.32 m2)**

No Asbestos

**B00C - R0005 - Toilets - Girls (24.77 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1313/B00C/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>	

**B00C - R0006 - Handwashing Facilities (15.81 m2)**

No Asbestos

**B00C - R0007 - External Movement (90.79 m2)**

No Asbestos

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1959 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00D/R0012/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Voids	Non Accessible Area - No access due to height restrictions. Ceiling access point above 3.5 meters.					
Underfloor Voids	AC Fragments/Debris					<b>No Asbestos Detected</b>
	1313/B00D/Underfloor Voids/S12					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1313/B00D/Underfloor Voids - Packing to Floor Joists/S13					

**Interior****B00D - R0001 - Home Base (67.17 m2)**

No Asbestos

**B00D - R0002 - Home Base Store (4.18 m2)**

No Asbestos

**B00D - R0003 - Withdrawal Space - 1hb (10.79 m2)**

No Asbestos

**B00D - R0004 - Practical Activities - 1hb (9.88 m2)**

No Asbestos

**B00D - R0005 - Movement (5.42 m2)**

No Asbestos

**B00D - R0006 - Home Base (67.06 m2)**

No Asbestos

**B00D - R0007 - Home Base (47.93 m2)**

No Asbestos

**B00D - R0008 - Practical Activities - 1hb (8.73 m2)**

No Asbestos

**B00D - R0009 - Withdrawal Space - 1hb (4.23 m2)**

No Asbestos

**B00D - R0010 - Home Base Store (4.48 m2)**

No Asbestos

**B00D - R0011 - Movement (3.28 m2)**

No Asbestos

**B00D - R0012 - External Movement (46.04 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00D/R0012/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**B00D - R0013 - External Movement (47.92 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00D/R0012/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**B00D - R0014 - Toilets - Boys (9.64 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1313/B00D/R0014/Wall Linings Internal/S9					
Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1313/B00D/R0014/Wall Linings Internal/S9					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0015 - Toilets - Girls (12.22 m2)</b>						
Wall Linings Internal	Flat AC Sheeting		1313/B00D/R0014/Wall Linings Internal/S9			<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting		1313/B00D/R0014/Wall Linings Internal/S9			<b>No Asbestos Detected</b>
<b>B00D - R0016 - External Movement (27.62 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00E - Communal Facilities/Pupil Facilities - 1990 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00E - M0001 - Plant (5.83 m2)**

No Asbestos

**B00E - R0001 - Sports Store (19.06 m2)**

No Asbestos

**B00E - R0002 - P.E. Store (27.68 m2)**

No Asbestos

**B00E - R0003 - Hall Chair Store (14.04 m2)**

No Asbestos

**B00E - R0004 - Other-Community Use (8.62 m2)**

No Asbestos

**B00E - R0005 - Staff Room Annexe (8.69 m2)**

No Asbestos

**B00E - R0006 - Cleaning Distributed Store (2.99 m2)**

No Asbestos

**B00E - R0007 - Toilets - Girls (19.86 m2)**

No Asbestos

**B00E - R0008 - Shower/Change (35.64 m2)**

No Asbestos

**B00E - R0009 - Plant (0.82 m2)**

No Asbestos

**B00E - R0010 - Movement (58.06 m2)**

No Asbestos

**B00E - R0011 - Movement (5.83 m2)**

No Asbestos

**B00E - R0012 - Movement (5.84 m2)**

No Asbestos

**B00E - R0013 - Raised Platform (65.84 m2)**

No Asbestos

**B00E - R0014 - Shower/Change (35.36 m2)**

No Asbestos

**B00E - R0015 - Plant (0.93 m2)**

No Asbestos

**B00E - R0016 - Toilets - Boys (19.52 m2)**

No Asbestos

**B00E - R0017 - Cleaning Distributed Store (3.24 m2)**

No Asbestos

**B00E - R0018 - Other-Community Use (15.22 m2)**

No Asbestos

**B00E - R0019 - Canteen (50.75 m2)**

No Asbestos

**B00E - R0020 - Canteen Office/Store (3.57 m2)**

No Asbestos

**B00E - R0021 - Canteen Office/Store (6.46 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00E - R0022 - Staff Toilet (2.38 m2)**

No Asbestos

**B00E - R0023 - Other-Community Use (4.82 m2)**

No Asbestos

**B00E - R0024 - Communal Space (480.31 m2)**

No Asbestos

**B00E - R0025 - External Movement (12.03 m2)**

No Asbestos

**B00E - R0026 - External Movement (7.61 m2)**

No Asbestos

**B00E - R0027 - Main Switch Board (8.27 m2)**

No Asbestos

**B00E - R0028 - External Movement (113.06 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - Library - 1990 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
<b>Interior</b>						
<b>B00F - R0001 - General Learning Space (53.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0002 - Reading Area (189.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0003 - Library Office/Workroom (19.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0004 - Library Office/Workroom (5.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0005 - Staff Toilet (2.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0006 - Staff Toilet (3.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0007 - Distribution Board (0.7 m2)</b>						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	2m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00F/R0007/Electrical Backing Board/S15					Chrysotile (white asbestos)
<b>B00F - R0008 - Cleaning Distributed Store (1.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0011 - Seminar/Study (12.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0012 - Special Programs Room (12.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00F - R0013 - External Movement (120.58 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	115m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00F/R0013/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
<b>B00F - R0014 - Library Office/Workroom (25.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite 1313/B00F/R0005/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00G - Senior Learning/Science - 1967 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0010/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - No access due to height restrictions.</b>					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1313/B00G/Underfloor Voids/S17			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1313/B00G/Underfloor Voids - Packing to Floor Joists/S18			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00G - R0001 - Preparation (9.54 m2)**

No Asbestos

**B00G - R0002 - Preparation (29.44 m2)**

No Asbestos

**B00G - R0003 - Laboratory L.S. (92.98 m2)**

No Asbestos

**B00G - R0004 - General Storeroom (10.18 m2)**

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Electrical Backing Board	Resinous Board	1m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0004/Electrical Backing Board/S19			<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	1313/B00G/R0004/Floor Coverings Res/Textile/S20					

**B00G - R0005 - Entry Vestibule (15.18 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00G/R0005/Floor Coverings Res/Textile/S5			<b>Chrysotile (white asbestos)</b>		

**B00G - R0006 - Staff Room Annexe (20.34 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00G/R0005/Floor Coverings Res/Textile/S5			<b>Chrysotile (white asbestos)</b>		

**B00G - R0007 - General Storeroom (5.39 m2)**

No Asbestos

**B00G - R0008 - Staff Toilet (3.55 m2)**

No Asbestos

**B00G - R0009 - General Storeroom (16.07 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Sheet					
	1313/B00G/R0009/Floor Coverings Res/Textile/S21					<b>No Asbestos Detected</b>
<b>B00G - R0010 - External Movement (4.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00G/R0010/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00G - R0011 - Staff Toilet (7.09 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00C/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>
<b>B00G - R0012 - Staff Toilet (7.59 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00C/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>
<b>B00G - R0013 - Cleaning Supplies (6.96 m2)</b>						
No Asbestos						
<b>B00G - R0014 - Distribution Board (0.7 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00G - R0015 - Seminar/Study (24.9 m2)</b>						
No Asbestos						
<b>B00G - R0016 - General Storeroom (13.04 m2)</b>						
No Asbestos						
<b>B00G - R0017 - General Storeroom (6.07 m2)</b>						
No Asbestos						
<b>B00G - R0018 - General Storeroom (6.09 m2)</b>						
No Asbestos						
<b>B00G - R0019 - Design/Technology L.S. (65.6 m2)</b>						
No Asbestos						
<b>B00G - R0020 - Staff Room Annexe (12.82 m2)</b>						
No Asbestos						
<b>B00G - R0021 - Staff Room Annexe (12.82 m2)</b>						
No Asbestos						
<b>B00G - R0022 - External Movement (115.49 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	113m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00G/R0010/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00G - R9001 - General Assistant/Bulk Store (78.83 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Science/Technological & Applied Studies - 1990 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00H - R0001 - Preparation (31.97 m2)**

No Asbestos

**B00H - R0002 - Chemical Store (12.52 m2)**

No Asbestos

**B00H - R0003 - Movement (3.43 m2)**

No Asbestos

**B00H - R0004 - Laboratory L.S. (81.28 m2)**

No Asbestos

**B00H - R0005 - Food Technology L.S. (95.73 m2)**

No Asbestos

**B00H - R0006 - Cleaning Distributed Store (3.2 m2)**

No Asbestos

**B00H - R0007 - Pantry (18.41 m2)**

No Asbestos

**B00H - R0008 - Food/Research Space (10.04 m2)**

No Asbestos

**B00H - R0009 - Staff Room Annexe (29.29 m2)**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00H - R0010 - Distribution Board (0.91 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0011 - General Learning Space (46.51 m2)**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00H - R0015 - External Movement (108.15 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00I - Technological &amp; Applied Studies - 1957 - Brick/Veneer (Brick/Veneer)</b>						
<b>Exterior</b>						
Eaves Linings	Flat AC Sheeting	30m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0010/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - No access due to height restrictions.</b>					
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1313/B00I/Underfloor Voids - Packing to Floor Joists/S22			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1313/B00I/Underfloor Voids/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>Interior</b>						
<b>B00I - R0001 - Materials Technology L.S. (79.73 m2)</b>						
Floor Coverings Res/Textile	Compressed AC Sheet					
	1313/B00I/R0002/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Wall Linings Internal	Compressed AC Sheet					
	1313/B00I/R0002/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00I - R0002 - Materials Technology L.S. (101.41 m2)</b>						
Floor Coverings Res/Textile	Compressed AC Sheet					
	1313/B00I/R0002/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00I - R0004 - External Movement (54.48 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00G/R0010/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00I - R0005 - Distribution Board (0.49 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00I - R0006 - Resource/Project Store (17.9 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	1313/B00I/R0006/Ceiling Structures/Linings/S24					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting					
	1313/B00I/R0006/Ceiling Structures/Linings/S24					<b>No Asbestos Detected</b>
<b>B00I - R0007 - Dust Extraction Space (2.64 m2)</b>						
Non Accessible						
<b>B00I - R0008 - Materials Store (12.8 m2)</b>						
Non Accessible						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Senior Learning/Art - 1963 - Brick/Block (Brick/Block)**

**Exterior**

Wall Cladding	Flat AC Sheeting 1313/B00J/Wall Cladding/S25					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00J - R0001 - Art Learning Space (65.02 m2)**

No Asbestos

**B00J - R0002 - Kiln Room (17.24 m2)**

No Asbestos

**B00J - R0003 - Security Store (8.82 m2)**

No Asbestos

**B00J - R0004 - Resources Store (7.45 m2)**

No Asbestos

**B00J - R0005 - Music Store (7.25 m2)**

No Asbestos

**B00J - R0006 - Music Learning Space (64.99 m2)**

No Asbestos

**B00J - R0007 - General Assistant/Bulk Store (14.76 m2)**

Non Accessible

**B00J - R0008 - Cleaning Distributed Store (6.79 m2)**

No Asbestos

**B00J - R0009 - External Movement (49.51 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00J - R0010 - Toilets - Boys (8.05 m2)**

No Asbestos

**B00J - R0011 - Toilets - Girls (8.17 m2)**

No Asbestos

**B00J - R0012 - Computer Store (6.57 m2)**

No Asbestos

**B00J - R0013 - Computer Learning Space (32.83 m2)**

No Asbestos

**B00J - R0014 - Computer Learning Space (48.13 m2)**

No Asbestos

**B00J - R0015 - General Learning Space (48.06 m2)**

No Asbestos

**B00J - R0016 - Staff Room Annexe (25.47 m2)**

No Asbestos

**B00J - R0017 - Distribution Board (0.71 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1313/B00G/R0014/Wall Linings Internal/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00J - R0018 - Movement (70.02 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - R0019 - General Learning Space (47.52 m2)</b>						
No Asbestos						
<b>B00J - R0020 - General Learning Space (47.81 m2)</b>						
No Asbestos						
<b>B00J - R0021 - External Movement (111.38 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		1313/B00J/R0021/Ceiling Structures/Linings/S26			<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting		1313/B00J/R0021/In-fill-panel/S27			<b>No Asbestos Detected</b>
<b>B00J - R0022 - Staff Study (17.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting		1313/B00J/R0022/Ceiling Structures/Linings/S28			<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting		1313/B00J/R0022/Ceiling Structures/Linings/S29			<b>No Asbestos Detected</b>
<b>B00J - R0023 - Stairs (6.07 m2)</b>						
No Asbestos						
<b>B00J - R1001 - General Learning Space (48.35 m2)</b>						
No Asbestos						
<b>B00J - R1002 - General Learning Space (48.35 m2)</b>						
No Asbestos						
<b>B00J - R1003 - Movement (18.57 m2)</b>						
In-fill-panel	Flat AC Sheeting		1313/B00J/R1003/In-fill-panel/S30			<b>No Asbestos Detected</b>
<b>B00J - R1004 - Stairs (6.06 m2)</b>						
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Building Services - 1964 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00K - R0001 - General Assistant/Bulk Store (25.2 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00L - Technological & Applied Studies/Agricultural Scien - 1960 - Brick/Block (Brick/Block)

#### Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

#### Interior

##### B00L - R0001 - Plant Space (17.77 m2)

No Asbestos

##### B00L - R0002 - Toilets - Boys/Girls (1.43 m2)

No Asbestos

##### B00L - R0003 - Handwashing Facilities (1.21 m2)

No Asbestos

##### B00L - R0004 - Special Learning Space (39.78 m2)

No Asbestos

##### B00L - R0005 - External Movement (7.89 m2)

No Asbestos

##### B00L - R0006 - Class Tools Storage (7.72 m2)

No Asbestos

##### B00L - R0007 - Staff Room Annexe (5.57 m2)

No Asbestos

##### B00L - R0010 - Materials Learning Space - Type 1 (59.93 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Agricultural Science - 1964 - Timber (Timber)**

**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

**Interior**

**B00M - R0001 - T.A.S. Outdoor Area (54.24 m2)**

No Asbestos

**B00M - R0002 - Garden Store (8.12 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00N - Technological & Applied Studies - 2011 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00N - R0001 - Welding Area (6.35 m2)**

No Asbestos

**B00N - R0002 - Welding Area (3.02 m2)**

No Asbestos

**B00N - R0003 - Welding Area (3.04 m2)**

No Asbestos

**B00N - R0004 - Welding Area (3.05 m2)**

No Asbestos

**B00N - R0005 - Welding Area (3.34 m2)**

No Asbestos

**B00N - R0006 - Materials Technology L.S. (162.03 m2)**

No Asbestos

**B00N - R0007 - Welding Area (2.89 m2)**

No Asbestos

**B00N - R0008 - Covered Outdoor Learning Area (45.66 m2)**

No Asbestos

**B00N - R0009 - Garage/Carport (12.98 m2)**

No Asbestos

**B00N - R0010 - Seminar/Technology Space (41.23 m2)**

No Asbestos

**B00N - R0011 - Distribution Board (1 m2)**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Other - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids            No Asbestos Found

Underfloor Voids        No Asbestos Found

**Interior**

**B000 - R0001 - Garage/Carport (25.83 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Storage - 2015 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00P - R0001 - Garage/Carport (43.76 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00Q - Residential Facilities - 1950 - Timber (Timber)****Exterior**

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

**Interior****B00Q - R0001 - Residence - Bedroom (22.75 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0002 - Residence - Movement (7.45 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0003 - Residence - Lounge (22.07 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0004 - Residence - Bedroom (20.58 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0005 - Residence - Bedroom (12.09 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0006 - Residence - Movement (29.93 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0007 - Residence - Toilet (2.77 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0008 - Residence - Kitchen (15.16 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0009 - Residence - Bedroom (20.85 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0010 - Residence - Bathroom (4.07 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0011 - Residence - Laundry (9.44 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0012 - Residence - Movement (27.76 m2)**

Recently Modified Space Requires Inspection

**B00Q - R0013 - Residence - Movement (34.85 m2)**

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017