


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Boree Creek Public School (1318)
Region : Riverina
State Electorate : Albury
Local Government Area : Urana

Initial Survey : Noel Arnold & Associates : 23 - Feb - 2008
Reviewed By : Greencap-NAA : 07 - Jul - 2016

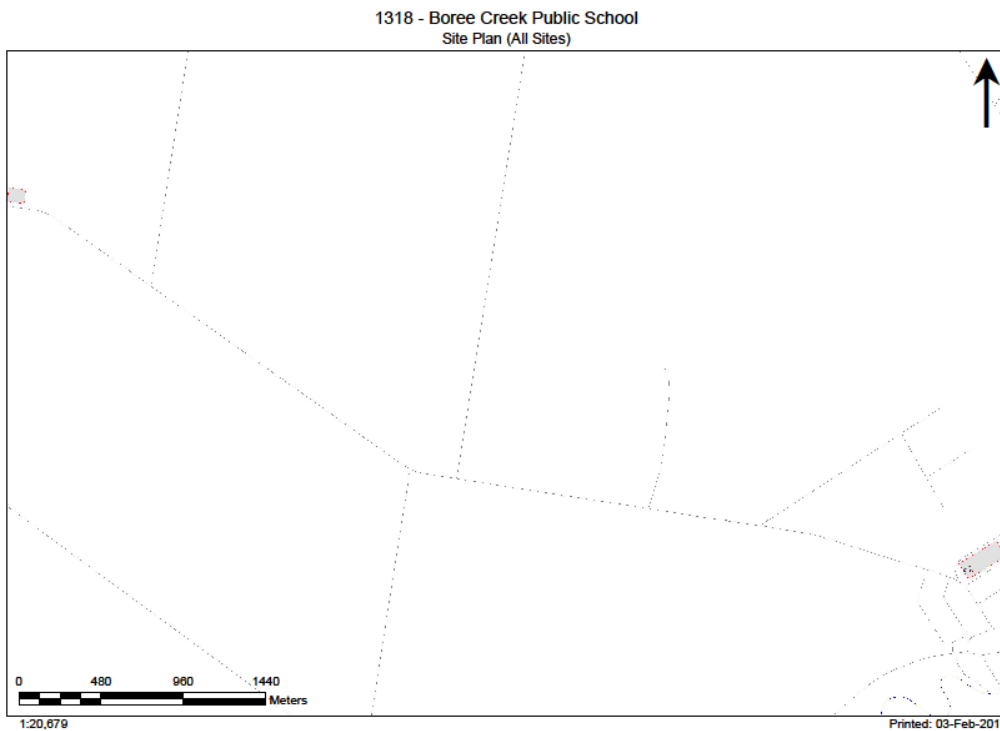

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

In-fill panels below windows	Flat AC Sheeting 1318/B00A/Infill panels to window/S2	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable verge lining	Flat AC Sheeting 1318/B00A/Gable verge lining/S7	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting 1318/B00A/R0001/Ceiling Structures/Linings/S1	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Encapsulated Insulation material within unit 1318/B00A/Ceiling Voids/S10					No Asbestos Detected
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0003 - Principal**

Floor Coverings Res/Textile	Adhesive 1318/B00A/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1318/B00A/R0004/Floor Coverings Res/Textile/S8	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1318/B00A/R0004/Floor Coverings Res/Textile/S8	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive 1318/B00A/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00A - R0005 - Home Base

Floor Coverings Res/Textile	Adhesive 1318/B00A/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1318/B00A/R0004/Floor Coverings Res/Textile/S8	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0009 - Clerical Office

Floor Coverings Res/Textile	Adhesive 1318/B00A/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1318/B00A/R0004/Floor Coverings Res/Textile/S8	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0010 - K.L.A. Store

No Asbestos

B00A - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 1318/B00A/R0001/Ceiling Structures/Linings/S1	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0012 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Staff Facilities - 1930 - Timber (Timber)

Exterior

Switchboard panel	Resinous Board	1Unit(s)	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
-------------------	----------------	----------	-------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Reading Area

Wall Linings Internal	Flat AC Sheeting	1318/B00B/R0002/Wall Linings Internal/S3				No Asbestos Detected
-----------------------	------------------	--	--	--	--	-----------------------------

B00B - R0002 - Staff Kitchen

Wall Linings Internal	Flat AC Sheeting	1318/B00B/R0002/Wall Linings Internal/S3				No Asbestos Detected
-----------------------	------------------	--	--	--	--	-----------------------------

Ceiling Structures/Linings	Flat AC Sheeting	1318/B00B/R0002/Wall Linings Internal/S3				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - General Storeroom

No Asbestos

B00B - R0006 - Drinking Facilities

No Asbestos

B00B - R0007 - External Movement

No Asbestos

B00B - R0008 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00C - R0001 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1318/B00C/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00C - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1318/B00C/R0003/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1318/B00C/R0003/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Shed - 1991 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1318/B00D/Eaves Linings/S4					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00D - R0001 - Sports Store

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1930 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 844 - D10706 - Country Toilet - Reltc - Boys/Girls : Placement Date - 2/02/2005

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2

Interior

R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017