


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Boronia Park Public School (1320)
Region : Northern Sydney
State Electorate : Lane Cove
Local Government Area : Hunters Hill

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Feb - 2017

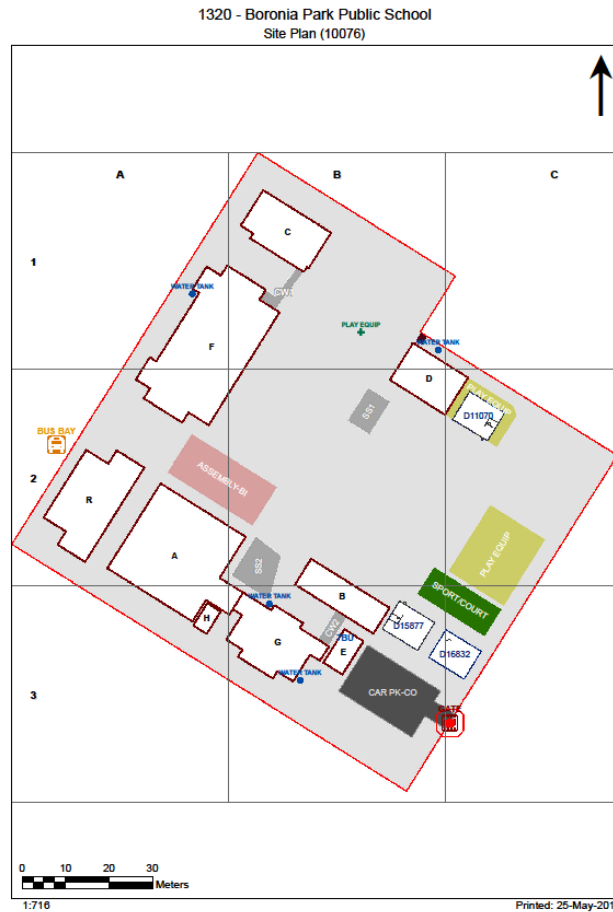

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1988 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00A - R0001 - Staff Toilet (3.87 m2)**

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Distribution Board (0.63 m2)

Note: No inspection of live electrical installation.

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0003 - Staff Toilet (5.64 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Sick Bay (6.96 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Entry Vestibule (12.77 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Movement (9.98 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - Principal (15.96 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - General Storeroom (2.83 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Staff Toilet (4.43 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0015 - Home Base (70.34 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0016 - Home Base Store (0.65 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0017 - Home Base Store (0.63 m2)

Ceiling Structures/Linings Vermiculite
1320/B00A/R0013/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0018 - Home Base (70.73 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Home Base Store (0.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0020 - Home Base Store (0.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0021 - Staff Room (35.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0025 - External Movement (179.54 m2)						
Infill panel below window	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00A/R1011/Panels Beneath Windows/S9					Chrysotile (white asbestos)
B00A - R0026 - General Assistant/Bulk Store (6.43 m2)						
No Asbestos						
B00A - R0027 - Clerical Office (14.75 m2)						
No Asbestos						
B00A - R0028 - Movement (3.2 m2)						
No Asbestos						
B00A - R0029 - Clerical Office (6.04 m2)						
No Asbestos						
B00A - R0030 - Interview/Office - Type 3 (12.83 m2)						
No Asbestos						
B00A - R0031 - Duplicating Workroom (24.61 m2)						
No Asbestos						
B00A - R0032 - Cleaning Distributed Store (1.26 m2)						
No Asbestos						
B00A - R0033 - General Storeroom (1.23 m2)						
No Asbestos						
B00A - R0034 - Security Store (8.09 m2)						
No Asbestos						
B00A - R0035 - Movement (4.85 m2)						
No Asbestos						
B00A - R0036 - Stairs (8.28 m2)						
No Asbestos						
B00A - R1001 - Toilets - Girls (3.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1002 - Toilets - Boys (3.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1003 - Cleaning Distributed Store (0.79 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - Distribution Board (0.79 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1005 - Library Office/Workroom (12.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Library Office/Workroom (12.35 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - K.L.A. Store (19.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - General Storeroom (6 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - Reading Area (52.7 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1010 - Reading Area (213.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	1320/B00A/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1011 - External Movement (178.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	179m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00A/R1011/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Infill panel below windows	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00A/R1011/Panels Beneath Windows/S9					Chrysotile (white asbestos)
B00A - R1012 - External Stairs (11.09 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - Pupil Facilities - 1953 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible - Access Hatch Sealed					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00B/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Ends	Flat AC Sheeting	NA	East facing, West facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1320/B00B/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00B - R0001 - Canteen (22.92 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00B - R0002 - General Storeroom (2.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00B - R0004 - General Storeroom (2.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00B - R0005 - Toilets - Boys/Girls (2.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1320/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00B - R0006 - Sports Store (14.4 m2)

No Asbestos

B00B - R0007 - External Movement (82.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	83m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1320/B00B/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1988 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00C - R0001 - Practical Activities - 1hb (41.35 m2)

No Asbestos

B00C - R0003 - Toilets - Girls (17.81 m2)

No Asbestos

B00C - R0004 - Toilets - Boys (17.81 m2)

No Asbestos

B00C - R0005 - External Movement (25.48 m2)

No Asbestos

B00C - R0006 - Distribution Board (0.15 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0007 - Special Programs Room (31.78 m2)

No Asbestos

B00C - R0008 - Special Programs Store (4.13 m2)

No Asbestos

B00C - R0009 - External Movement (23.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1988 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible due to low clearance < 0.3m.					
Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Ceiling Voids	No Asbestos Found					

Interior

B00D - R0001 - Home Base (54.46 m2)

No Asbestos

B00D - R0002 - Home Base (54.46 m2)

No Asbestos

B00D - R0003 - General Storeroom (5.81 m2)

No Asbestos

B00D - R0004 - External Movement (28.67 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1320/B00D/R0004/Ceiling Structures/Linings/S11				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1988 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Ends	Flat AC Sheeting	20m2	North facing, South facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Ceiling Voids	No Asbestos Found					

Interior**B00E - R0001 - Toilets - Boys (15.6 m2)**

No Asbestos

B00E - R0002 - Toilets - Girls (18.95 m2)

No Asbestos

B00E - R0003 - Cleaning Distributed Store (3.48 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1928 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting 1320/B00F/Eaves Linings/S12	400m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting 1320/B00F/Underfloor Voids/S13	NA	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Crocidolite (blue asbestos)

Interior**B00F - R0001 - External Movement (3.36 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1320/B00F/R0004/Ceiling Structures/Linings/S5	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	--------------	--------------------	---------	--

B00F - R0003 - Movement (16 m2)

No Asbestos

B00F - R0004 - External Movement (3.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1320/B00F/R0004/Ceiling Structures/Linings/S5	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	--------------	--------------------	---------	--

B00F - R0005 - Cleaning Distributed Store (7.52 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1320/B00F/R0005/Floor Coverings Res/Textile/S14					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00F - R0006 - Toilets - Boys/Girls (3.6 m2)

No Asbestos

B00F - R0007 - Practical Activities - 1hb (21.54 m2)

No Asbestos

B00F - R0008 - Home Base (63.27 m2)

No Asbestos

B00F - R0009 - Movement (16.07 m2)

No Asbestos

B00F - R0011 - Cleaning Distributed Store (5.31 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1320/B00F/R0011/Floor Coverings Res/Textile/S6					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00F - R0012 - General Storeroom (17.35 m2)

No Asbestos

B00F - R0013 - Raised Platform (18.35 m2)

No Asbestos

B00F - R0014 - Communal Space (123.46 m2)

No Asbestos

B00F - R0015 - Movement (35.63 m2)

No Asbestos

B00F - R0016 - Uniform Shop (16.9 m2)

No Asbestos

B00F - R0017 - Cleaning Distributed Store (5.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1320/B00F/R0011/Floor Coverings Res/Textile/S6					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0018 - General Storeroom (12.6 m2)						
No Asbestos						
B00F - R0019 - Movement (16.12 m2)						
No Asbestos						
B00F - R0020 - Home Base (63.01 m2)						
No Asbestos						
B00F - R0021 - Practical Activities - 1hb (21.54 m2)						
No Asbestos						
B00F - R0022 - Toilets - Boys/Girls (3.75 m2)						
No Asbestos						
B00F - R0023 - Security Store (7.49 m2)						
No Asbestos						
B00F - R0024 - Movement (16.33 m2)						
No Asbestos						
B00F - R0025 - External Movement (3.15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1320/B00F/R0004/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00F - R0026 - External Movement (3.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1320/B00F/R0004/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00F - R0027 - Staff Toilet (3.83 m2)						
No Asbestos						
B00F - R0028 - General Storeroom (8.15 m2)						
No Asbestos						
B00F - R0029 - Stairs (9.54 m2)						
No Asbestos						
B00F - R0030 - Stairs (9.53 m2)						
No Asbestos						
B00F - R1001 - Staff Room Annexe (18.33 m2)						
No Asbestos						
B00F - R1002 - Movement (5.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1320/B00F/R0011/Floor Coverings Res/Textile/S6					No Asbestos Detected	
B00F - R1003 - Personal Effects Storage (7.38 m2)						
No Asbestos						
B00F - R1004 - Home Base Store (5.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1320/B00F/R1004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00F - R1005 - Home Base (48.92 m2)						
No Asbestos						
B00F - R1006 - Home Base (48.59 m2)						
No Asbestos						
B00F - R1007 - Home Base (48.85 m2)						
No Asbestos						
B00F - R1008 - Home Base (48.65 m2)						
No Asbestos						
B00F - R1010 - Personal Effects Storage (9 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00F - R1011 - Home Base Store (4.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1320/B00F/R1004/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	

B00F - R1012 - Movement (5.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
1320/B00F/R0011/Floor Coverings Res/Textile/S6					No Asbestos Detected	

B00F - R1013 - General Storeroom (18.37 m2)

No Asbestos

B00F - R1014 - Movement (71.5 m2)

No Asbestos

B00F - R1015 - Stairs (11.45 m2)

Ceiling Voids	Flat AC Sheeting	11m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						

B00F - R1016 - Stairs (11.45 m2)

Ceiling Voids	Flat AC Sheeting	11m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1988 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Ends	Flat AC Sheeting	40m2	North facing, South facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Ceiling Voids	No Asbestos Found					

Interior**B00G - R0001 - Home Base Store (2.12 m2)**

No Asbestos

B00G - R0002 - Practical Activities - 1hb (19.49 m2)

No Asbestos

B00G - R0003 - Home Base Store (2.12 m2)

No Asbestos

B00G - R0004 - Personal Effects Storage (25.52 m2)

No Asbestos

B00G - R0005 - Home Base (58.09 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00G - R0006 - Security Store (3.76 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00G - R0007 - Withdrawal Space - 1hb (13.1 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00G - R0008 - Staff Room Annexe (3.76 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00G - R0009 - Home Base (58.09 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00G - R0010 - Distribution Board (0.98 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0011 - External Movement (18.14 m2)

No Asbestos

B00G - R0012 - External Movement (16.94 m2)

No Asbestos

B00G - R1001 - Home Base Store (2.12 m2)

No Asbestos

B00G - R1002 - Practical Activities - 1hb (19.49 m2)

No Asbestos

B00G - R1003 - Home Base Store (2.12 m2)

No Asbestos

B00G - R1004 - Personal Effects Storage (25.52 m2)

No Asbestos

B00G - R1005 - Home Base (58.08 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00G - R1006 - Staff Room Annexe (3.76 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00G - R1007 - Withdrawal Space - 1hb (13.09 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00G - R1008 - Staff Room Annexe (3.76 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00G - R1009 - Home Base (58.08 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00G - R1010 - External Movement (18.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		1320/B00G/R1010/Ceiling Structures/Linings/S10			No Asbestos Detected
B00G - R1011 - External Movement (20.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		1320/B00G/R1010/Ceiling Structures/Linings/S10			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2009 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store (20.68 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00R - R0001 - Home Base (60.55 m2)**

No Asbestos

B00R - R0002 - Home Base (60.38 m2)

No Asbestos

B00R - R0003 - Home Base Store (6.26 m2)

No Asbestos

B00R - R0004 - General Storeroom (9.1 m2)

No Asbestos

B00R - R0005 - Practical Activities - 1hb (19.3 m2)

No Asbestos

B00R - R0006 - Withdrawal Space - 2hb (11.74 m2)

No Asbestos

B00R - R0007 - Practical Activities - 1hb (19 m2)

No Asbestos

B00R - R0008 - General Storeroom (9.1 m2)

No Asbestos

B00R - R0009 - Home Base Store (6.26 m2)

No Asbestos

B00R - R0010 - External Movement (61.36 m2)

No Asbestos

B00R - R0011 - External Stairs (5.11 m2)

No Asbestos

B00R - R0012 - External Stairs (5.11 m2)

No Asbestos

B00R - R1001 - Home Base (60.12 m2)

No Asbestos

B00R - R1002 - Home Base (60.12 m2)

No Asbestos

B00R - R1003 - Home Base Store (6.26 m2)

No Asbestos

B00R - R1004 - Practical Activities - 1hb (19.03 m2)

No Asbestos

B00R - R1005 - Withdrawal Space - 2hb (11.74 m2)

No Asbestos

B00R - R1006 - Practical Activities - 1hb (19.03 m2)

No Asbestos

B00R - R1007 - Home Base Store (6.26 m2)

No Asbestos

B00R - R1008 - External Movement (51.43 m2)

No Asbestos

B00R - R1009 - External Stairs (15.68 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00R - R1010 - External Stairs (15.68 m2)						

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11070 - Learning Unit - Standard With P.A.A. : Placement Date - 30/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15877 - Learning Unit - Standard With P.A.A. : Placement Date - 1/12/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

- D16832 - : Placement Date - 19/12/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017