


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bourke Public School (1326)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Bourke

Initial Survey : Noel Arnold & Associates : 03 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Aug - 2016

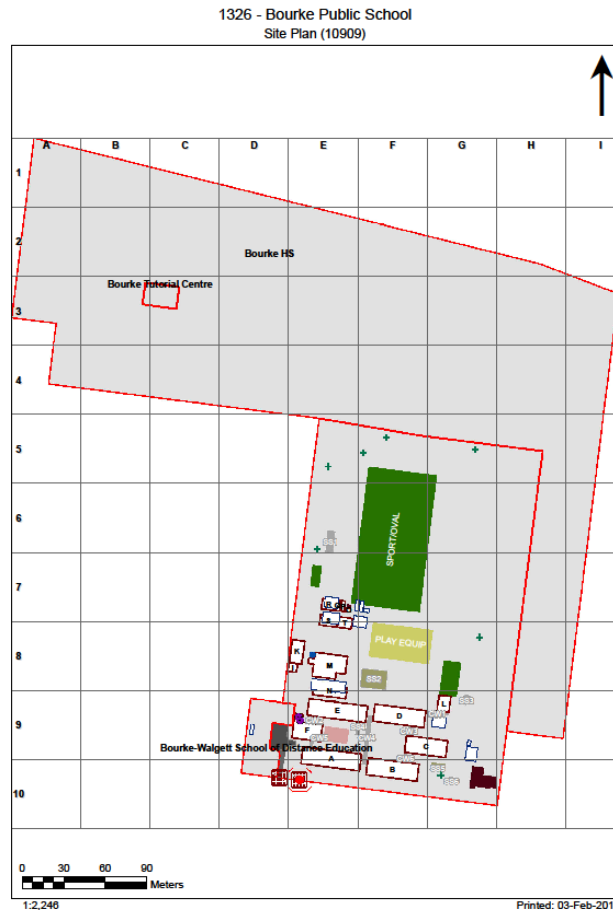

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/Gable Verge Lining/S19				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	14m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4				Chrysotile (white asbestos)	

B00A - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0022/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0004/Partition Walls (Cubicles)/S13				Chrysotile (white asbestos)	

B00A - R0003 - Disabled Shower/Toilet

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0022/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00A - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0022/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00A - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

B00A - R0006 - Withdrawal Space - 1hb

No Asbestos

B00A - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

B00A - R0008 - General Storeroom

No Asbestos

B00A - R0009 - Staff Room

Wall Linings Internal	Flat AC Sheeting					
	1326/B00A/R0009/Wall Linings Internal/S3				No Asbestos Detected	

B00A - R0010 - Duplicating Workroom

No Asbestos

B00A - R0011 - Sick Bay

No Asbestos

B00A - R0012 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0014 - General Storeroom						
No Asbestos						
B00A - R0016 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0022/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
B00A - R0017 - Entry Vestibule						
No Asbestos						
B00A - R0018 - Clerical Office						
No Asbestos						
B00A - R0019 - Clerical Office/Workroom						
No Asbestos						
B00A - R0020 - Plant						
No Asbestos						
B00A - R0021 - Movement						
No Asbestos						
B00A - R0022 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0022/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
B00A - R0024 - Staff Toilet						
No Asbestos						
B00A - R0025 - Main Switch Board						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0025/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	South	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1326/B00A/R0025/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0025/Electrical Backing Board/S23				Chrysotile (white asbestos)	
B00A - R0026 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	8m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4				Chrysotile (white asbestos)	
B00A - R0027 - Staff Toilet						
No Asbestos						
B00A - R0028 - Handwashing Facilities						
No Asbestos						
B00A - R0029 - Staff Toilet						
No Asbestos						
B00A - R0030 - Principal						
No Asbestos						
B00A - R0031 - General Storeroom						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R0032 - Handwashing Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/Gable Verge Lining/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Void	No Asbestos Found					
Ceiling Void	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1326/B00B/Ceiling Void/S20					Chrysotile (white asbestos)

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	16m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4					Chrysotile (white asbestos)

B00B - R0002 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B00B - R0003 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0003/Ceiling Structures/Linings/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					

B00B - R0005 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					

B00B - R0006 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

B00B - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0003/Ceiling Structures/Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0008 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0003/Ceiling Structures/Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0009 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					
B00B - R0010 - Special Programs Room						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					
B00B - R0011 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)		
B00B - R0012 - Distribution Board						
No Asbestos				Note: No inspection of live electrical installation.		
B00B - R0013 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0002/Floor Coverings Res/Textile/S17			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00B/R0003/Ceiling Structures/Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00C/R0011/Ceiling Structures/Linings/S15			Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	20m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Support Unit/General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/Gable Verge Lining/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00C - R0002 - Home Base**

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00C - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R0004 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00C - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R0006 - Home Base - S

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00C - R0007 - Movement

No Asbestos

B00C - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0009 - Home Base Store - S

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0005/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	160m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

In-fill-panel	Flat AC Sheeting	24m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/Gable Verge Lining/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00D/R0001/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	20m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4					Chrysotile (white asbestos)

B00D - R0002 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00D - R0003 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0005/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0004 - Personal Effects Storage

No Asbestos

B00D - R0005 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Medium (2)	Medium Priority (4-5)
						Assumed Asbestos - Encapsulated material within unit

B00D - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0005/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0007 - Personal Effects Storage

No Asbestos

B00D - R0008 - Home Base

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00D - R0009 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0005/Ceiling Structures/Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0010 - Personal Effects Storage						
No Asbestos						
B00D - R0011 - Home Base						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					
B00D - R0012 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0005/Ceiling Structures/Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0013 - Distribution Board						
No Asbestos						
B00D - R0014 - Personal Effects Storage						
No Asbestos						
B00D - R0015 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00D/R0001/Ceiling Structures/Linings/S14			Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	16m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library/Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/Gable Verge Lining/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0014/Ceiling Structures/Linings/S11			Chrysotile (white asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B00E - R0005 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0005/Ceiling Structures/Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0007 - Shower/Change

No Asbestos

B00E - R0008 - General Storeroom

No Asbestos

B00E - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0010 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0016/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		

B00E - R0011 - Reading Area

No Asbestos

B00E - R0012 - Special Programs Room

No Asbestos

B00E - R0013 - K.L.A. Store

No Asbestos

B00E - R0014 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0014/Ceiling Structures/Linings/S11			Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	14m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00A/R0001/In-fill-panel/S4			Chrysotile (white asbestos)		

B00E - R0015 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0015/Ceiling Structures/Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0016 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0015/Ceiling Structures/Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1326/B00E/R0016/Partition Walls (Cubicles)/S24			Chrysotile (white asbestos)		

B00E - R0017 - Withdrawal Space - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - R0018 - Withdrawal Space - 1hb

No Asbestos

B00E - R0019 - External Movement

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Building Services - 1975 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
In-fill-panel	Flat AC Sheeting 1326/B00F/In-fill-panel/S7					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 1326/B00A/Gable Verge Lining/S19	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting 1326/B00F/Eaves Linings/S8					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior**B00F - R0001 - Movement**

In-fill-panel	Flat AC Sheeting 1326/B00F/In-fill-panel/S7					No Asbestos Detected
---------------	--	--	--	--	--	-----------------------------

B00F - R0002 - General Assistant/Bulk Store

No Asbestos

B00F - R0003 - Garden Store

Ceiling Structures/Linings	Flat AC Sheeting 1326/B00F/R0007/Ceiling Structures/Linings/S9	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00F - R0004 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting 1326/B00F/R0007/Ceiling Structures/Linings/S9	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00F - R0005 - Canteen

In-fill-panel	Flat AC Sheeting 1326/B00F/R0005/In-fill-panel/S10					No Asbestos Detected
---------------	---	--	--	--	--	-----------------------------

B00F - R0006 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting 1326/B00F/R0007/Ceiling Structures/Linings/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00F - R0007 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 1326/B00F/R0007/Ceiling Structures/Linings/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 1992 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B001 - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other - 2009 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Other-Community Use - 2009 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00L - R0001 - Aboriginal Resource Centre

No Asbestos

B00L - R0002 - Practical Activities

No Asbestos

B00L - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Access Shower/Toilet/Change

No Asbestos

B00M - R0002 - Main Switch Board

No Asbestos

B00M - R0003 - Cleaning Distributed Store

No Asbestos

B00M - R0004 - Plant

No Asbestos

B00M - R0005 - Toilet - Lobby

No Asbestos

B00M - R0006 - Toilets - Boys

No Asbestos

B00M - R0007 - Sound Cupboard

No Asbestos

B00M - R0008 - Toilets - Girls

No Asbestos

B00M - R0009 - Toilet - Lobby

No Asbestos

B00M - R0010 - P.E. Store

No Asbestos

B00M - R0011 - Communal/Performance Store

No Asbestos

B00M - R0012 - Communal Space

No Asbestos

B00M - R0013 - Covered Outdoor Learning Area

No Asbestos

B00M - R0014 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning/Administration - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00N - R0001 - Clerical Office

No Asbestos

B00N - R0002 - Clerical Office

No Asbestos

B00N - R0003 - Clerical Office

No Asbestos

B00N - R0004 - Breakout Area

No Asbestos

B00N - R0005 - Computer Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B000 - R0001 - Disabled Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00P - R0001 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Pupil Facilities - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00Q - R0001 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00R - R0001 - Practical Activities

No Asbestos

B00R - R0002 - Home Base

No Asbestos

B00R - R0003 - Movement

No Asbestos

B00R - R0004 - Movement

No Asbestos

B00R - R0005 - Toilets - Boys

No Asbestos

B00R - R0006 - Toilets - Girls

No Asbestos

B00R - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - General Learning - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00S - R0001 - Clerical Office

No Asbestos

B00S - R0002 - Movement

No Asbestos

B00S - R0003 - Home Base Store

No Asbestos

B00S - R0004 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - General Learning - 2015 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00T - R0001 - Movement

No Asbestos

B00T - R0002 - Withdrawal Space - 1hb

No Asbestos

B00T - R0003 - Home Base

No Asbestos

B00T - R0004 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 841 - D10387 - Boys Toilet : Placement Date - 14/08/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Toilets-Boys

No Asbestos Found.

OS 507 - D10406 - Administration - Library : Placement Date - 14/08/2013

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	14.4 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Reading Area

End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

OS 535 - D12463 - Library/Group Study/Office/A V Store : Placement Date - 3/10/2014

Exterior

No Asbestos Found.

Interior

R1 - Clerical Office

No Asbestos Found.

R2 - Staff Room

No Asbestos Found.

R3 - Security Store

No Asbestos Found.

R4 - Principal

No Asbestos Found.

R5 - Staff Toilet

No Asbestos Found.

R6 - Staff Toilet

No Asbestos Found.

R7 - Reading Area

No Asbestos Found.

R8 - Entry

No Asbestos Found.

OS 840 - D13000 - Girls Toilet : Placement Date - 14/08/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Toilets-Girls

No Asbestos Found.

OS 602 - D13296 - Learning Unit - Standard With P.A.A. : Placement Date - 20/08/2013

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D13733 - Learning Unit - Standard/Withdrawal : Placement Date - 10/01/2017						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						
OS 601 - D13775 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D13924 - Learning Unit - Standard/Withdrawal : Placement Date - 15/01/2013						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 970 - D15341 - Store - Single Module : Placement Date - 30/06/1995						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Exterior

No Asbestos Found.

Interior

R1 - Bulk Store

No Asbestos Found.

OS 523 - D15552 - Staff Study With Toilets : Placement Date - 14/08/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - Staff Room

No Asbestos Found.

R3 - Staff Toilet

No Asbestos Found.

OS 837 - D17103 - Hcap Shower/Change/Toilet : Placement Date - 6/02/2014

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Disabled Shower/Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	12 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

OS 837 - D18168 - Hcap Shower/Change/Toilet : Placement Date - 22/08/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017