


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bowning Public School (1334)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Yass Valley

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Grencap-NAA : 01 - Aug - 2016

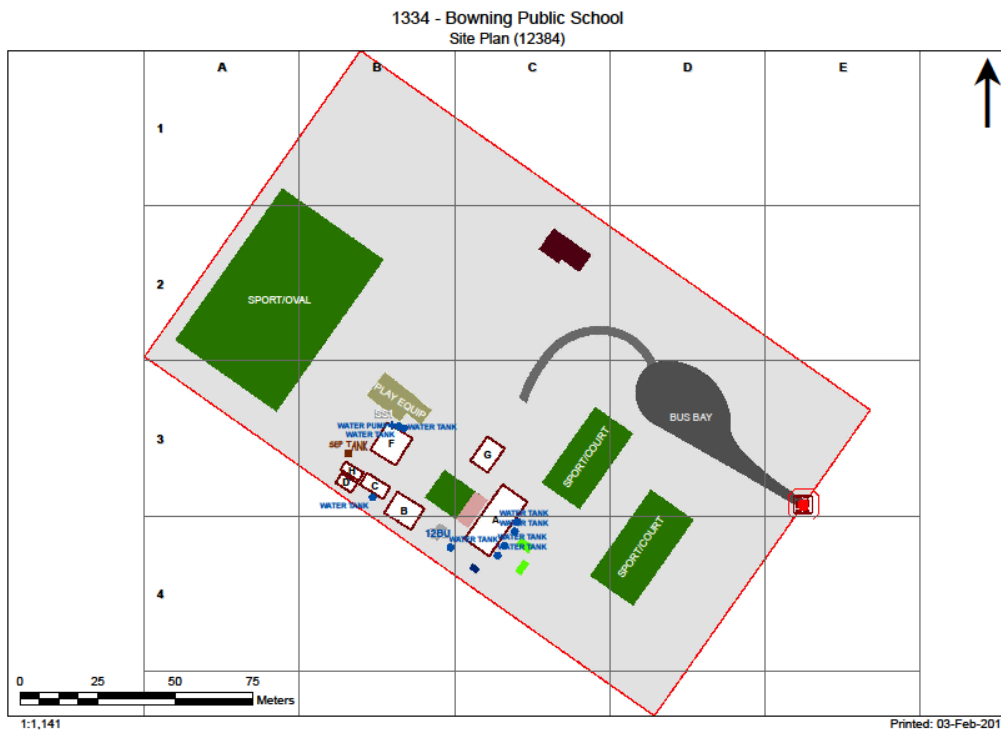

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1914 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible

Interior

B00A - R0001 - Principal

No Asbestos

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - Clerical Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1334/B00A/R0003/Floor Coverings Res/Textile/S7	18.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive 1334/B00A/R0003/Floor Coverings Res/Textile/S8					
						No Asbestos Detected

B00A - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 1334/B00A/R0004/Floor Coverings Res/Textile/S5	11m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0005 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1334/B00A/R0004/Floor Coverings Res/Textile/S5	49.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0006 - Staff Room Annexe

No Asbestos

B00A - R0007 - Shelter

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Communal Facilities - 1955 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00B/Eaves Linings/S10					Chrysotile (white asbestos)

Interior**B00B - R0001 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00B/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00B - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	1334/B00B/R0002/Floor Coverings Res/Textile/S2					
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00B/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	1334/B00B/R0002/In-fill-panel/S3					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Pupil Facilities - 1966 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00C/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00C - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00C/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00C/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

In-fill-panel	Flat AC Sheeting	5m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00C/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00C/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

In-fill-panel	Flat AC Sheeting	5m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/B00C/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 1978 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Stored redundant step	Compressed AC Sheet	1Unit(s)	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1334/B00D/Stored redundant step/S4					Chrysotile (white asbestos)	

Interior

B00D - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - External Movement

No Asbestos

B00F - R0002 - Home Base

No Asbestos

B00F - R0003 - K.L.A. Store

No Asbestos

B00F - R0004 - Practical Activities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - External Movement

No Asbestos

B00G - R0002 - Entry Vestibule

No Asbestos

B00G - R0003 - Clerical Office/Workroom

No Asbestos

B00G - R0004 - Principal

No Asbestos

B00G - R0005 - General Storeroom

No Asbestos

B00G - R0006 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Building Services - 2010 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Sports Store

No Asbestos

B00H - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

BOOI - Pupil Water Station

Exterior

Gable Ends	Flat AC Sheeting	4m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/BOOI/Exterior/Gable Ends/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

BOOI - R0001 - Boys

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/BOOI/R0001/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

BOOI - R0002 - Girls

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1334/BOOI/R0001/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017