


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bowral Public School (1335)
Region : Illawarra and South East
State Electorate : Wollondilly
Local Government Area : Wingecarribee

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Greencap-NAA : 16 - Jun - 2015

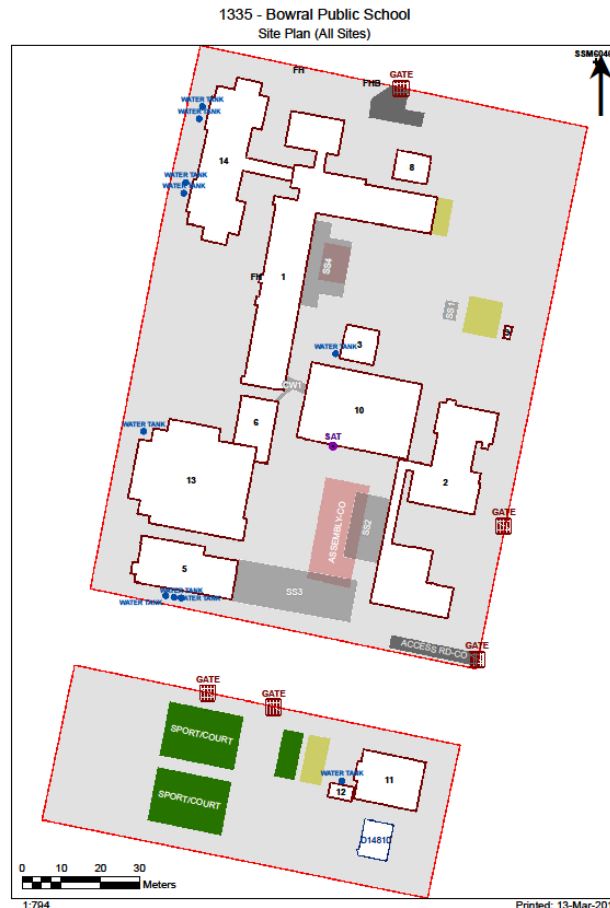

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B001 - General Learning - 1972 - Brick/Block (Brick/Block)						
Exterior						
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B001 - R0001 - External Movement (14.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B001 - R0002 - Home Base (55.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	55.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B001 - R0003 - Withdrawal Space - 1hb (12.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B001 - R0004 - Home Base Store (3.93 m2)						
No Asbestos						
B001 - R0005 - Practical Activities - 1hb (20.8 m2)						
No Asbestos						
B001 - R0006 - Security Store (2.72 m2)						
No Asbestos						
B001 - R0007 - Distribution Board Cupboard (0.85 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B001 - R0008 - Home Base (57.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1335/B001/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	57.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B001 - R0009 - Home Base Store (5.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B001 - R0010 - Personal Effects Storage (7.51 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1335/B001/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B001 - R0011 - Movement (15.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B001 - R0012 - Home Base (56.95 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1335/B001/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	56.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B001 - R0013 - Home Base Store (6.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B001 - R0014 - Home Base (85.71 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1335/B001/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	85.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B001 - R0015 - Toilets-Unisex (3.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B001 - R0016 - Home Base Store (4.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B001 - R0017 - Personal Effects Storage (6.9 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	1335/B001/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B001 - R0018 - Movement (76.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B001 - R0019 - Movement (19.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B001 - R0020 - General Storeroom (8.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B001 - R0021 - Cleaning Distributed Store (6 m2)						
	No Asbestos					
B001 - R0022 - Movement (10.08 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0022/Wall Linings Internal/S7				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	10.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0023 - Home Base (69.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	69.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0024 - Practical Activities (6.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0025 - Withdrawal Space - 1hb (15.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0026 - Cleaning Supplies (11.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0027 - Movement (4.36 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0028 - Practical Activities (7.74 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
1335/B001/R0008/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0029 - Movement (15.65 m2)						
No Asbestos						
B001 - R0030 - Home Base (80.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	80.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0031 - Practical Activities (6.5 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
B001 - R0032 - Sports Store (3.28 m2)						
No Asbestos						
B001 - R0033 - Movement (2.16 m2)						
No Asbestos						
B001 - R0034 - Cleaning Distributed Store (6.87 m2)						
No Asbestos						
B001 - R0035 - Toilets - Boys (27.51 m2)						
No Asbestos						
B001 - R0036 - Drinking Facilities (30.82 m2)						
No Asbestos						
B001 - R0037 - Movement (3.64 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B001 - R0038 - General Storeroom (7.51 m2)						
No Asbestos						
B001 - R0039 - Movement (2.15 m2)						
No Asbestos						
B001 - R0040 - Toilets - Girls (32.73 m2)						
No Asbestos						
B001 - R0041 - Movement (27.47 m2)						
No Asbestos						
B001 - R0042 - General Assistant/Bulk Store (9.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B001 - R0043 - Stairs (13.08 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0042/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B001 - R0044 - Stairs (19.01 m2)						
No Asbestos						
B001 - R9001 - General Storeroom (140.03 m2)						
No Asbestos						
B001 - R9002 - Music Store (32.78 m2)						
No Asbestos						
B001 - R9003 - General Storeroom (8.12 m2)						
No Asbestos						
B001 - R9004 - Music Store (37.16 m2)						
No Asbestos						
B001 - R9005 - Practical Activities - 1hb (107.62 m2)						
Infill Panels	Flat AC Sheeting					
1335/B001/R9005/Infill Panels/S8					No Asbestos Detected	
B001 - R9006 - Withdrawal Space - 1hb (33.51 m2)						
No Asbestos						
B001 - R9007 - General Storeroom (13.23 m2)						
No Asbestos						
B001 - R9008 - Staff Kitchen (13.99 m2)						
Ceiling Structures/Linings	Vermiculite					
1335/B001/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B001 - R9009 - Movement (27.88 m2)						
Ceiling Structures/Linings	Vermiculite					
1335/B001/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B001 - R9010 - Cleaning Distributed Store (6.37 m2)						
No Asbestos						
B001 - R9011 - Home Base (98.78 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite					
	1335/B001/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	98.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B001 - R9012 - Practical Activities (6.76 m2)

Ceiling Structures/Linings	Vermiculite					
	1335/B001/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B001 - R9013 - Toilets-Unisex (3.26 m2)

Ceiling Structures/Linings	Vermiculite					
	1335/B001/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B001 - R9014 - Stairs (9.36 m2)

No Asbestos

B001 - R9015 - Stairs (12.15 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B002 - Administration - 1893 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior**B002 - R0001 - External Movement (2.4 m2)**

No Asbestos

B002 - R0002 - Cleaning Distributed Store (3.63 m2)

No Asbestos

B002 - R0003 - Movement (14.22 m2)

No Asbestos

B002 - R0004 - Staff Toilet (3.15 m2)

No Asbestos

B002 - R0005 - Staff Toilet (3.15 m2)

No Asbestos

B002 - R0006 - Security Store (9.69 m2)

No Asbestos

B002 - R0007 - Movement (5.56 m2)

No Asbestos

B002 - R0008 - Home Base (59.94 m2)

No Asbestos

B002 - R0009 - External Movement (2.55 m2)

No Asbestos

B002 - R0010 - Duplicating Workroom (37.21 m2)

No Asbestos

B002 - R0011 - Clerical Office (12.8 m2)

No Asbestos

B002 - R0012 - Sick Bay (9.05 m2)

No Asbestos

B002 - R0013 - Entry Vestibule (15.59 m2)

No Asbestos

B002 - R0014 - Movement (4.56 m2)

No Asbestos

B002 - R0015 - Deputy Principal (13.36 m2)

No Asbestos

B002 - R0016 - Principal (18.66 m2)

No Asbestos

B002 - R0017 - Interview (10.37 m2)

No Asbestos

B002 - R0018 - Movement (12.74 m2)

No Asbestos

B002 - R0019 - General Storeroom (1.67 m2)

No Asbestos

B002 - R0020 - Distribution Board Cupboard (0.91 m2)

Note: No inspection of live electrical installation.

No Asbestos

B002 - R0021 - Movement (19.37 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B002/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B002 - R0022 - Movement (11.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B002/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B002 - R0023 - Home Base (61.28 m2)						
No Asbestos						
B002 - R0024 - Movement (49.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B002/R0021/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B002 - R0025 - Disabled Shower/Toilet (4.44 m2)						
No Asbestos						
B002 - R0026 - Movement (14.73 m2)						
No Asbestos						
B002 - R0027 - Movement (12.22 m2)						
No Asbestos						
B002 - R0028 - Distribution Board Cupboard (0.28 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B002 - R0029 - Practical Activities - 1hb (29.96 m2)						
No Asbestos						
B002 - R0030 - Kiln Space (0.59 m2)						
No Asbestos						
B002 - R0031 - Security Store (15.97 m2)						
No Asbestos						
B002 - R0032 - Security Store (3.48 m2)						
No Asbestos						
B002 - R0033 - Home Base (70.6 m2)						
No Asbestos						
B002 - R0034 - Home Base (70.77 m2)						
No Asbestos						
B002 - R0035 - Stairs (2.1 m2)						
No Asbestos						
B002 - R1001 - Staff Room (63.85 m2)						
No Asbestos						
B002 - R1002 - Staff Room Annexe (16.55 m2)						
No Asbestos						
B002 - R1003 - Movement (2.07 m2)						
No Asbestos						
B002 - R1004 - Movement (9.21 m2)						
No Asbestos						
B002 - R1005 - Stairs (10.46 m2)						
Electrical Backing Board	Resinous Board	0.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Museum - 1885 - Brick/Block (Brick/Block)**Exterior**

Electrical Backing Board	Resinous Board	0.4m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-----------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

Ceiling Voids	Non Accessible Area - Height Restriction
---------------	---

Underfloor Voids	Non Accessible Area - Height Restriction
------------------	---

Interior**B003 - M0001 - Museum (8.08 m2)**

No Asbestos

B003 - M0002 - Stairs (2.52 m2)

No Asbestos

B003 - R0001 - Museum (51.62 m2)

No Asbestos

B003 - R0002 - Museum (10.39 m2)

No Asbestos

B003 - R0003 - Museum (5.1 m2)

No Asbestos

B003 - R0004 - Stairs (0.39 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B005 - General Learning/Pupil Facilities - 1940 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B005/R0008/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior**B005 - R0002 - Home Base (51.9 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	1335/B005/R9005/Floor Coverings Res/Textile/S2					No Asbestos Detected

B005 - R0003 - Home Base (52.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1335/B005/R9005/Floor Coverings Res/Textile/S2					No Asbestos Detected

B005 - R0004 - Home Base Store (10.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1335/B005/R9005/Floor Coverings Res/Textile/S2					No Asbestos Detected

B005 - R0005 - General Storeroom (10.74 m2)

No Asbestos

B005 - R0006 - Home Base (53.07 m2)

No Asbestos

B005 - R0007 - External Stairs (8.61 m2)

No Asbestos

B005 - R0008 - External Movement (64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	64.m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B005/R0008/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B005 - R9001 - Movement (13.27 m2)

No Asbestos

B005 - R9002 - General Storeroom (9.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	1335/B005/R0008/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B005 - R9003 - Canteen (19.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B005/R0008/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles					
	1335/B005/R9005/Floor Coverings Res/Textile/S2					No Asbestos Detected

B005 - R9004 - Canteen Office/Store (6.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B005/R0008/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles					
	1335/B005/R9005/Floor Coverings Res/Textile/S2					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B005 - R9005 - Canteen Office/Store (1.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B005/R0008/Ceiling Structures/Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	1335/B005/R9005/Floor Coverings Res/Textile/S2			No Asbestos Detected		
B005 - R9006 - External Movement (3.94 m2)						
No Asbestos						
B005 - R9008 - External Movement (12.32 m2)						
No Asbestos						
B005 - R9009 - External Stairs (7.63 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B006 - Pupil Facilities/Building Services - 1987 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 1335/B006/Eaves Linings/S9					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B006 - R0008 - Toilets - Girls (36.18 m2)

No Asbestos

B006 - R0009 - Toilets - Boys (33.86 m2)

No Asbestos

B006 - R0010 - External Movement (49.6 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - Museum - 1885 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	4m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B008/R0003/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior**B008 - R0001 - Museum (43.18 m2)**

No Asbestos

B008 - R0002 - Museum (12.45 m2)

No Asbestos

B008 - R0003 - External Movement (3.7 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B008/R0003/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - Museum - 1927 - Timber (Timber)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab
on Ground

Interior

B009 - R0001 - Movement (3.1 m2)

No Asbestos

B009 - R0002 - Museum (1.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B010 - Library/Tiered Learning - 1987 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B010 - R0001 - Reading Area (228.47 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B010 - R0002 - Resource/Toy Space (11.99 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B010 - R0003 - Library Office/Workroom (25.9 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B010 - R0004 - Special Programs Room (44.24 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B010 - R0005 - Audio Visual Workroom (4.03 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B010 - R0006 - Plant (5.56 m2)

No Asbestos

B010 - R0007 - Cleaning Distributed Store (2.66 m2)

No Asbestos

B010 - R0008 - Main Switch Board Cupboard (5.54 m2)

No Asbestos

B010 - R0009 - External Movement (30.1 m2)

No Asbestos

B010 - R0013 - External Movement (15.4 m2)

No Asbestos

B010 - R0015 - Resource/Toy Space (10.78 m2)

No Asbestos

B010 - R0016 - External Movement (152.04 m2)

Wall Cladding	Flat AC Sheeting 1335/B010/R0016/Wall Cladding/S5
---------------	--

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B011 - General Learning - 1914 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting	6m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/Wall Cladding/S14					Chrysotile (white asbestos)
Ceiling Voids	Flat AC Sheeting	0.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0006/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B011 - R0001 - Interview/Office - Type 3 (23 m2)**

No Asbestos

B011 - R0002 - Special Programs Room (14.92 m2)

No Asbestos

B011 - R0003 - Special Programs Room (14.41 m2)

No Asbestos

B011 - R0004 - General Storeroom (13.23 m2)

No Asbestos

B011 - R0005 - Toilets - Boys/Girls (3.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0006/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0006/Wall Linings Internal/S12					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B001/R0010/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B011 - R0006 - Access Shower/Toilet - Type 2 (4.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0006/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0006/Wall Linings Internal/S12					Chrysotile (white asbestos)

B011 - R0007 - General Assistant/Bulk Store (3.61 m2)

No Asbestos

B011 - R0008 - Movement (3.23 m2)

No Asbestos

B011 - R0009 - Staff Kitchen (13.78 m2)

No Asbestos

B011 - R0010 - Laundry (8.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0006/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0006/Wall Linings Internal/S12					Chrysotile (white asbestos)

Splashback	Flat AC Sheeting	0.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1335/B011/R0010/Splashback/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B011 - R0011 - Interview/Office - Type 3 (24.92 m2)						
No Asbestos						
B011 - R0012 - General Storeroom (7.05 m2)						
No Asbestos						
B011 - R0013 - Movement (18.97 m2)						
No Asbestos						
B011 - R0014 - External Movement (21.8 m2)						
Electrical Backing Board	Resinous Board	0.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B011 - R0015 - External Movement (2.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1335/B011/R0006/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B011 - R0016 - Special Programs Room (13.26 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B012 - Staff Facilities - 1935 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting 1335/B012/Wall Cladding/S15					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground						

Interior**B012 - R0002 - Sports Store (16.43 m2)**

Wall Linings Internal	Flat AC Sheeting 1335/B012/R0003/Wall Linings Internal/S16					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B012 - R0003 - Toilets - Boys/Girls (4.15 m2)

Wall Linings Internal	Flat AC Sheeting 1335/B012/R0003/Wall Linings Internal/S16					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B013 - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Area inaccessible

Underfloor Voids - Slab on Ground

Interior

B013 - R0001 - Communal Space (203.55 m2)

No Asbestos

B013 - R0002 - Raised Platform (61.06 m2)

No Asbestos

B013 - R0003 - Chair Storeroom (11.36 m2)

No Asbestos

B013 - R0004 - Movement (2.96 m2)

No Asbestos

B013 - R0005 - Cleaning Distributed Store (7.93 m2)

No Asbestos

B013 - R0006 - Toilet - Lobby (3.65 m2)

No Asbestos

B013 - R0007 - Toilets - Girls (10.24 m2)

No Asbestos

B013 - R0008 - Sound Cupboard (2.69 m2)

No Asbestos

B013 - R0009 - Toilet - Lobby (1.81 m2)

No Asbestos

B013 - R0010 - Toilets - Boys (7.34 m2)

No Asbestos

B013 - R0011 - P.E. Store (16.75 m2)

No Asbestos

B013 - R0012 - Movement (2.57 m2)

No Asbestos

B013 - R0013 - Communal/Performance Store (10.75 m2)

No Asbestos

B013 - R0014 - Movement (14.04 m2)

No Asbestos

B013 - R0015 - Movement (5.43 m2)

No Asbestos

B013 - R0016 - Ramp (12.99 m2)

No Asbestos

B013 - R0017 - Covered Outdoor Learning Area (181.02 m2)

No Asbestos

B013 - R0018 - External Movement (57.74 m2)

No Asbestos

B013 - R0019 - Access Shower/Toilet/Change (7 m2)

No Asbestos

B013 - R0020 - Main Switch Board (3.36 m2)

No Asbestos

B013 - R0021 - Plant (0.81 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B013 - R0022 - External Movement (6.76 m2)

No Asbestos

B013 - R0023 - External Movement (3.47 m2)

No Asbestos

B013 - R0024 - Canteen (42.02 m2)

No Asbestos

B013 - R0025 - Canteen Office/Store (10.02 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D14810 - Learning Unit - Standard With P.A.A. : Placement Date - 21/10/2010

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017