


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Braidwood Central School (1340)
Region : Illawarra and South East
State Electorate : Monaro
Local Government Area : Palerang

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : AECOM : 16 - Jun - 2015

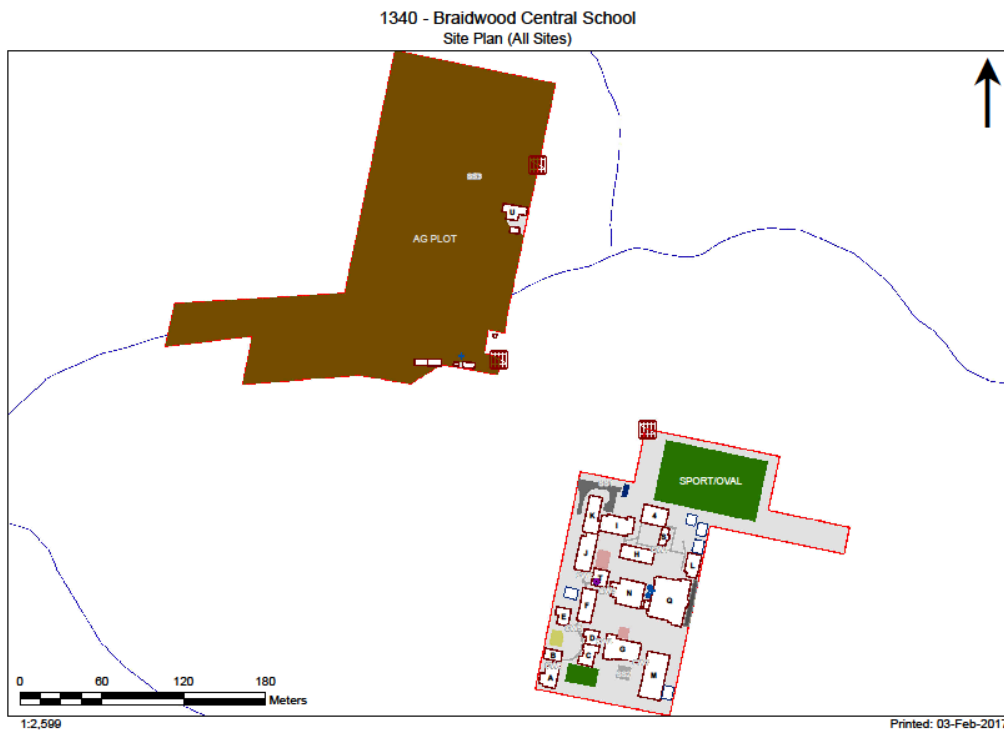

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Agricultural Science - 1996 - Greenhouse (Greenhouse)

Exterior

No Asbestos

Interior

B001 - R0001 - Plant Space (9.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - Agricultural Science - 1995 - Metal Shed (Metal Shed)

Exterior

No Asbestos

Interior

B002 - R0001 - Class Tools Storage (35.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Agricultural Science - 1995 - Metal Shed (Metal Shed)

Exterior

No Asbestos

Interior

B003 - R0001 - Animal Space (5.28 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - General Learning/Other - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B004 - R0001 - Practical Activities - 1hb (19.16 m2)

No Asbestos

B004 - R0002 - Home Base Store (6.28 m2)

No Asbestos

B004 - R0003 - Home Base (60.99 m2)

No Asbestos

B004 - R0004 - Withdrawal Space - 2hb (12.19 m2)

No Asbestos

B004 - R0005 - Home Base (61.12 m2)

No Asbestos

B004 - R0006 - Home Base Store (6.29 m2)

No Asbestos

B004 - R0007 - Practical Activities - 1hb (19.14 m2)

No Asbestos

B004 - R0008 - External Movement (43.34 m2)

No Asbestos

B004 - R9001 - Garden Store (11.52 m2)

No Asbestos

B004 - R9002 - General Assistant/Bulk Store (15.36 m2)

No Asbestos

B004 - R9003 - Sports Store (11.93 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration - 1878 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - External Movement (16.11 m2)**

No Asbestos

B00A - R0002 - Staff Room (13.85 m2)

No Asbestos

B00A - R0003 - Interview (13.84 m2)

No Asbestos

B00A - R0004 - Teachers Aides (11.64 m2)

No Asbestos

B00A - R0005 - Distribution Board (0.48 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board No Asbestos Found

B00A - R0006 - Movement (3.19 m2)

No Asbestos

B00A - R0007 - Staff Toilet (2.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	5m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0008 - Staff Toilet (2.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	5m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0009 - Sick Bay (8.67 m2)

No Asbestos

B00A - R0010 - Sick Bay - Shower/Toilet (2.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	5m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0011 - Movement (4.3 m2)

No Asbestos

B00A - R0012 - Movement (12.43 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0013 - Entry Vestibule (7.52 m2)						
No Asbestos						
B00A - R0014 - Clerical Office (19.44 m2)						
No Asbestos						
B00A - R0015 - General Storeroom (2.45 m2)						
No Asbestos						
B00A - R0016 - Clerical Office/Workroom (20.38 m2)						
Wall Linings Internal	Flat AC Sheeting	14m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0017 - Principal (18.99 m2)						
No Asbestos						
B00A - R0018 - External Movement (1.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00A/R0016/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0019 - External Movement (4.99 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1991 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00B - R0001 - Toilets - Boys (21.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00B/R0001/Ceiling Structures/Linings/S17	No Asbestos Detected
----------------------------	--	-----------------------------

B00B - R0002 - Security Store (18.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00B/R0001/Ceiling Structures/Linings/S17	No Asbestos Detected
----------------------------	--	-----------------------------

B00B - R0003 - Toilets - Girls (21.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00B/R0001/Ceiling Structures/Linings/S17	No Asbestos Detected
----------------------------	--	-----------------------------

B00B - R0004 - External Movement (27.28 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1990 - Brick/Block (Brick/Block)

Exterior

Window Shade	Compressed AC Sheet 1340/B00C/Window Shade/S16					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Withdrawal Space - 1hb (6.4 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0002 - Home Base Store (6.1 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0003 - Home Base (60.5 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0004 - Practical Activities - 1hb (18.05 m2)

No Asbestos

B00C - R0005 - Cleaning Distributed Store (0.63 m2)

No Asbestos

B00C - R0006 - External Movement (58.02 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1990 - Brick/Block (Brick/Block)

Exterior

Window Shade	Compressed AC Sheet 1340/B00C/Window Shade/S16					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - External Movement (12.72 m2)

No Asbestos

B00D - R0002 - Distribution Board (0.58 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0003 - Practical Activities - 1hb (17.88 m2)

No Asbestos

B00D - R0004 - Home Base (60.65 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00D - R0005 - Withdrawal Space - 1hb (6.4 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00D - R0006 - Home Base Store (6.12 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1990 - Brick/Block (Brick/Block)

Exterior

Window Shade	Compressed AC Sheet 1340/B00C/Window Shade/S16					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - External Movement (16.66 m2)

No Asbestos

B00E - R0002 - Distribution Board (0.56 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0003 - Practical Activities - 1hb (18.32 m2)

No Asbestos

B00E - R0004 - Home Base (60.49 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0005 - Withdrawal Space - 1hb (6.35 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0006 - Home Base Store (6.1 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Staff Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting	16m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/In-fill-panel/S10					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	22m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/Eaves Linings/S11					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/Gable Verge Lining/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0002 - Staff Room (42.72 m2)**

No Asbestos

B00F - R0003 - Staff Kitchen (13.44 m2)

No Asbestos

B00F - R0004 - Distribution Board (1.24 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/R0004/Wall Linings Internal/S19					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1340/B00M/R0001/Ceiling Structures/Linings/S22					

Electrical Backing Board No Asbestos Found

B00F - R0005 - Staff Room Annexe (86.58 m2)

No Asbestos

B00F - R0007 - General Storeroom (4.75 m2)

No Asbestos

B00F - R0008 - Movement (1.52 m2)

No Asbestos

B00F - R0009 - Staff Toilet (1.61 m2)

No Asbestos

B00F - R0011 - Interview (21.37 m2)

No Asbestos

B00F - R0012 - Staff Toilet (3.97 m2)

No Asbestos

B00F - R0014 - Staff Study (16.71 m2)

No Asbestos

B00F - R0015 - Movement (13.64 m2)

No Asbestos

B00F - R0016 - Movement (21.66 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1854 - Brick/Block (Brick/Block)**Exterior**

Window Shade	Compressed AC Sheet 1340/B00C/Window Shade/S16					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1340/B00F/Eaves Linings/S11	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00G - R0001 - Home Base (57.9 m2)**

No Asbestos

B00G - R0002 - Withdrawal Space - 1hb (13.42 m2)

No Asbestos

B00G - R0003 - Practical Activities - 1hb (24.61 m2)

No Asbestos

B00G - R0004 - Home Base (57.96 m2)

No Asbestos

B00G - R0005 - Withdrawal Space - 1hb (6.79 m2)

No Asbestos

B00G - R0006 - Deputy Principal (17.27 m2)

No Asbestos

B00G - R0007 - Movement (17.68 m2)

No Asbestos

B00G - R0008 - Movement (9.54 m2)

No Asbestos

B00G - R0009 - Distribution Board (0.63 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0010 - General Storeroom (10.03 m2)

No Asbestos

B00G - R0011 - Movement (11.96 m2)

No Asbestos

B00G - R0012 - Home Base (63.84 m2)

No Asbestos

B00G - R0013 - Special Programs Room (18.9 m2)

No Asbestos

B00G - R0014 - External Movement (31.34 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1991 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/Eaves Linings/S11					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/Gable Verge Lining/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - General Storeroom (6.43 m2)**

No Asbestos

B00H - R0002 - Cleaning Distributed Store (6.53 m2)

No Asbestos

B00H - R0003 - External Movement (3.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00H/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

B00H - R0005 - General Learning Space (39.41 m2)

No Asbestos

B00H - R0006 - General Learning Space (39.61 m2)

No Asbestos

B00H - R0007 - Materials Store (5.51 m2)

No Asbestos

B00H - R0008 - Distribution Board (0.52 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/R0004/Wall Linings Internal/S19					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	1340/B00M/R0001/Ceiling Structures/Linings/S22					

B00H - R0009 - General Storeroom (6.04 m2)

No Asbestos

B00H - R0010 - General Learning Space (53.44 m2)

No Asbestos

B00H - R0011 - External Movement (10.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00H/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

B00H - R0012 - Movement (3.9 m2)

No Asbestos

B00H - R0013 - General Storeroom (15.31 m2)

No Asbestos

B00H - R0014 - Movement (11.41 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning/Art - 1990 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1340/B00J/R1001/Ceiling Structures/Linings/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00I - R0001 - Seminar/Technology Space (31.1 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0002 - Resources Store (5.73 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0003 - Cleaning Supplies (17.73 m2)

No Asbestos

B00I - R0004 - Art Learning Space (62.4 m2)

No Asbestos

B00I - R0005 - Workshop (49.39 m2)

No Asbestos

B00I - R0006 - Kiln Room (10.01 m2)

No Asbestos

B00I - R0007 - Distribution Board (0.79 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Flat AC Sheeting
1340/B00I/R0007/Ceiling Structures/Linings/S18

No Asbestos Detected

B00I - R0008 - External Movement (44.27 m2)

No Asbestos

B00I - R0009 - Materials Store (32.19 m2)

No Asbestos

B00I - R0010 - External Movement (16.3 m2)

No Asbestos

B00I - R0011 - Garden Store (13.74 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Technological & Applied Studies - 1991 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1340/B00J/R1001/Ceiling Structures/Linings/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00J - M0001 - External Movement (7.92 m2)**

No Asbestos

B00J - M0002 - External Stairs (3.15 m2)

No Asbestos

B00J - R0001 - External Movement (45.66 m2)

No Asbestos

B00J - R0002 - Laundry (11.37 m2)

No Asbestos

B00J - R0003 - T.A.S. Outdoor Area (6.32 m2)

No Asbestos

B00J - R0004 - Staff Study (26.13 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00J - R0005 - Food Technology L.S. (110.02 m2)**

No Asbestos

B00J - R0006 - Food/Research Space (23.01 m2)

No Asbestos

B00J - R0007 - Movement (5.74 m2)

No Asbestos

B00J - R0008 - General Storeroom (14.46 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00J - R0009 - Distribution Board (0.85 m2)**

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0010 - External Stairs (3.96 m2)

No Asbestos

B00J - R0011 - External Stairs (16.78 m2)

No Asbestos

B00J - R1001 - External Movement (52.25 m2)Ceiling Structures/Linings Flat AC Sheeting
1340/B00J/R1001/Ceiling Structures/Linings/S20**No Asbestos Detected****B00J - R1002 - Distribution Board (0.76 m2)**

Note: No inspection of live electrical installation.

No Asbestos

B00J - R1003 - Staff Toilet (5.45 m2)

No Asbestos

B00J - R1004 - Staff Toilet (5.41 m2)

No Asbestos

B00J - R1005 - Staff Study (26.04 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00J - R1006 - General Learning Space (54.36 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R1007 - Computer Learning Space (54.36 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00J - R1008 - Study Space (22.92 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00J - R1009 - Study Space (14.55 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00J - R1010 - External Stairs (3.15 m2)						
No Asbestos						
B00J - R1011 - External Stairs (14.79 m2)						
No Asbestos						
B00J - R9001 - External Movement (11.79 m2)						
No Asbestos						
B00J - R9002 - Cleaning Distributed Store (6.81 m2)						
No Asbestos						
B00J - R9003 - Dust Extraction Space (8.88 m2)						
No Asbestos						
B00J - R9004 - External Stairs (4.07 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Technological & Applied Studies - 1990 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 1340/B00J/R1001/Ceiling Structures/Linings/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00K - M0001 - Materials Store (26.8 m2)

No Asbestos

B00K - R0002 - Security Store (3.35 m2)

No Asbestos

B00K - R0004 - Materials Technology L.S. (105.68 m2)

No Asbestos

B00K - R0005 - Wood Technology Bay (23.67 m2)

No Asbestos

B00K - R0006 - Metal Technology Bay (23.88 m2)

No Asbestos

B00K - R0007 - Distribution Board (0.61 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0008 - External Movement (21.89 m2)

No Asbestos

B00K - R0009 - Materials Store (5.97 m2)

No Asbestos

B00K - R0010 - Materials Workshop - Type 3 (53.87 m2)

No Asbestos

B00K - R0011 - Welding Area (16.19 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
Electrical Backing Board	No Asbestos Found

Interior

B00L - R0001 - General Learning Space (36.29 m2)

No Asbestos

B00L - R0002 - External Movement (4.25 m2)

No Asbestos

B00L - R0003 - Movement (20.85 m2)

No Asbestos

B00L - R0004 - Study Space (36.5 m2)

No Asbestos

B00L - R0005 - General Learning Space (41.51 m2)

No Asbestos

B00L - R0006 - External Movement (20.46 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Communal Facilities/Pupil Facilities - 1986 - Brick/Veneer (Brick/Veneer)**Exterior**

Wall Cladding	Flat AC Sheeting 1340/B00M/R0007/Wall Linings Internal/S21					No Asbestos Detected
Gable Ends	Flat AC Sheeting 1340/B00M/R0007/Wall Linings Internal/S21					No Asbestos Detected
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00M - R0001 - Distribution Board (1.5 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00F/R0004/Wall Linings Internal/S19	6m2	Throughout	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

B00M - R0002 - Shower/Change (2.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 1340/B00S/R0005/Partition Walls (Cubicles)/S3	2m2	Throughout	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

B00M - R0003 - Movement (7.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected

B00M - R0004 - No Access (11.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 1340/B00S/R0005/Partition Walls (Cubicles)/S3	6m2	Throughout	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)

B00M - R0005 - Movement (2.68 m2)

No Asbestos

B00M - R0006 - Raised Platform (50.9 m2)

No Asbestos

B00M - R0007 - External Movement (16.36 m2)

Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00M - R0008 - Movement (7.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected

B00M - R0009 - Cleaning Distributed Store (1.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected
B00M - R0010 - Plant (0.91 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected
B00M - R0011 - Shower/Change (2.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 1340/B00S/R0005/Partition Walls (Cubicles)/S3	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00M - R0012 - Toilets - Girls (10.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0003/Wall Linings Internal/S24					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 1340/B00S/R0005/Partition Walls (Cubicles)/S3	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00M - R0013 - Movement (2.68 m2)						
No Asbestos						
B00M - R0014 - Communal Space (186.23 m2)						
No Asbestos						
B00M - R0017 - Movement (3.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
B00M - R0018 - Sports Store (14.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
B00M - R0019 - Canteen Office/Store (5.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
B00M - R0021 - Canteen (43.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
B00M - R0023 - External Movement (21.69 m2)						
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0007/Wall Linings Internal/S21					No Asbestos Detected
B00M - R0024 - Movement (45.54 m2)						
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0007/Wall Linings Internal/S21					No Asbestos Detected
B00M - R0025 - External Movement (28.61 m2)						
Wall Linings Internal	Flat AC Sheeting 1340/B00M/R0007/Wall Linings Internal/S21					No Asbestos Detected
B00M - R0026 - Canteen Office/Store (15.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00M/R0026/Ceiling Structures/Linings/S23					No Asbestos Detected
B00M - R0027 - Sound Cupboard (5.81 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting		1340/B00M/R0026/Ceiling Structures/Linings/S23			No Asbestos Detected
B00M - R0028 - General Storeroom (7.56 m2)						
Wall Linings Internal	No Asbestos Found					
B00M - R0029 - External Movement (25.78 m2)						
No Asbestos						
B00M - R0030 - General Storeroom (7.77 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Library/Science Learning - 1965 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting 1340/B00N/Wall Cladding/S9					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1340/B00N/R1016/Ceiling Structures/Linings/S7	48m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00N - R0001 - Staff Toilet (1.74 m2)

Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00N - R0002 - General Storeroom (3.42 m2)

Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00N - R0003 - Distribution Board (0.53 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles 1340/B00N/R0011/Floor Coverings Res/Textile/S5	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00N - R0004 - Movement (2.49 m2)

Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1340/B00N/R0011/Floor Coverings Res/Textile/S5	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00N - R0005 - Chemical Store (14.43 m2)

No Asbestos

B00N - R0010 - General Learning Space (59.16 m2)

Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 1340/B00N/R0011/Floor Coverings Res/Textile/S5	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00N - R0011 - Movement (13.12 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1340/B00N/R0011/Floor Coverings Res/Textile/S5	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00N - R0014 - External Stairs (12.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1340/B00N/R1016/Ceiling Structures/Linings/S7	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00N - R0015 - External Movement (20.73 m2)

No Asbestos

B00N - R0016 - Lift (1.96 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R0017 - Laboratory L.S. (86.64 m2)						
Floor Coverings Res/Textile	No Asbestos Found					
B00N - R0020 - Laboratory L.S. (86.35 m2)						
No Asbestos						
B00N - R0021 - Preparation - Science (46.85 m2)						
No Asbestos						
B00N - R1001 - Seminar (13.1 m2)						
Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00N - R1002 - Seminar/Study (12.81 m2)						
Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00N - R1003 - Seminar (13.07 m2)						
Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00N - R1004 - Seminar (12.71 m2)						
Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00N - R1005 - Toilets - Girls (3.12 m2)						
No Asbestos						
B00N - R1006 - Cleaning Distributed Store (2.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00N/R0011/Ceiling Structures/Linings/S6					No Asbestos Detected
B00N - R1007 - Distribution Board (0.75 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00N/R0011/Ceiling Structures/Linings/S6					No Asbestos Detected
B00N - R1008 - Toilets - Boys (3.12 m2)						
No Asbestos						
B00N - R1009 - Movement (1.41 m2)						
No Asbestos						
B00N - R1010 - Movement (1.39 m2)						
No Asbestos						
B00N - R1011 - Movement (26.34 m2)						
Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00N - R1014 - Reading Area (214.21 m2)						
Ceiling Structures/Linings	Vermiculite 1340/B00N/R0011/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00N - R1016 - External Stairs (14.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 1340/B00N/R1016/Ceiling Structures/Linings/S7	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						
B00N - R1017 - Library Administration (25.99 m2)						
No Asbestos						
B00N - R1018 - External Movement (13.14 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00N/R1016/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Compressed AC Sheet					
	1340/B00N/R1018/Floor Coverings Res/Textile/S8				No Asbestos Detected	

B00N - R1019 - Movement (5.61 m2)

No Asbestos

B00N - R1020 - Lift (1.96 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 1950 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00P - R0001 - General Assistant/Bulk Store (30.63 m2)

No Asbestos

B00P - R0002 - General Assistant/Bulk Store (38.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00Q - Physical Education - 2007 - Brick/Veneer (Brick/Veneer)**Exterior**

No Asbestos

Interior**B00Q - M0001 - General Storeroom (11.13 m2)**

No Asbestos

B00Q - M0002 - Movement (179.33 m2)

No Asbestos

B00Q - M0003 - Stairs (9.13 m2)

No Asbestos

B00Q - M0004 - General Storeroom (9.33 m2)

No Asbestos

B00Q - R0004 - Movement (33.06 m2)

No Asbestos

B00Q - R0005 - General Storeroom (3.44 m2)

No Asbestos

B00Q - R0006 - Stairs (0.15 m2)

No Asbestos

B00Q - R0007 - Change (57.58 m2)

No Asbestos

B00Q - R0008 - Disabled Shower/Toilet (7.78 m2)

No Asbestos

B00Q - R0009 - Large Equipment Store (40.65 m2)

No Asbestos

B00Q - R0010 - Gymnasium (526.18 m2)

No Asbestos

B00Q - R0011 - External Movement (2.51 m2)

No Asbestos

B00Q - R0012 - External Movement (7.61 m2)

No Asbestos

B00Q - R0013 - External Movement (2.78 m2)

No Asbestos

B00Q - R0014 - External Movement (2.46 m2)

No Asbestos

B00Q - R0015 - External Movement (2.51 m2)

No Asbestos

B00Q - R0016 - Entry Vestibule (3.57 m2)

No Asbestos

B00Q - R0017 - Change (20.53 m2)

No Asbestos

B00Q - R0018 - Shower/Change (25.91 m2)

No Asbestos

B00Q - R0019 - Sports Store (26.15 m2)

No Asbestos

B00Q - R0020 - Fitness Laboratory (46.83 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	26m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Live - no access
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00S - R0001 - Staff Toilet (4.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Sealed unit

B00S - R0002 - Toilets - Girls (24.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00S - R0003 - Plant (0.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00S - R0004 - Drinking Facilities (5.56 m2)

No Asbestos

B00S - R0005 - Toilets - Boys (24.95 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00S - R0006 - Plant (0.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00S - R0007 - Staff Toilet (4.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1340/B00S/R0005/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Tiered Learning/Electrical Services - 1965 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1340/B00F/Eaves Linings/S11					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00T - M0001 - Plant (21.34 m2)

No Asbestos

B00T - R0001 - Special Programs Room (67.67 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00T - R0002 - Special Programs Store (19.66 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00T - R0003 - External Movement (6.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1340/B00J/R1001/Ceiling Structures/Linings/S20					No Asbestos Detected

B00T - R0004 - Main Switch Board (7.45 m2)

Electrical Backing Board No Asbestos Found

B00T - R0005 - External Movement (20.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00U - Agricultural Science - 1995 - Steel (Steel)

Exterior

No Asbestos

Interior

B00U - R0001 - Garden Store (35.46 m2)

No Asbestos

B00U - R0002 - General Storeroom (34.92 m2)

No Asbestos

B00U - R0003 - Animal Space (34.92 m2)

No Asbestos

B00U - R0004 - Animal Space (40.66 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - Agricultural Science - 1975 - Metal Shed (Metal Shed)

Exterior

No Asbestos

Interior

B00V - R0001 - Animal Space (29.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00X - Agricultural Science - 1995 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00X - R0001 - Plant Space (43.13 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Agricultural Science - 1995 - Greenhouse (Greenhouse)

Exterior

No Asbestos

Interior

B00Z - R0001 - Plant Space (49.06 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10152 - Learning Unit - Standard With P.A.A. : Placement Date - 27/03/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos		70 m2
---------	---------------	------------------	--	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		3 m2

OS 601 - D11758 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

NS 110 - D12639 - Learning Unit - Single Secondary/Secure : Placement Date - 2/01/2007

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

R2 - Entry

No Asbestos Found.

R3 - Secure Storeroom

No Asbestos Found.

OS 601 - D13430 - Learning Unit - Standard/Withdrawal : Placement Date - 14/11/2005

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 600 - D15271 - Learning Unit - Small : Placement Date - 27/04/2011						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017