


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Branxton Public School (1341)  
**Region :** Hunter/Central Coast  
**State Electorate :** Cessnock  
**Local Government Area :** Cessnock

**Initial Survey :** Noel Arnold & Associates : 16 - May - 2008  
**Register Issue Date :** 22 - Mar - 2017

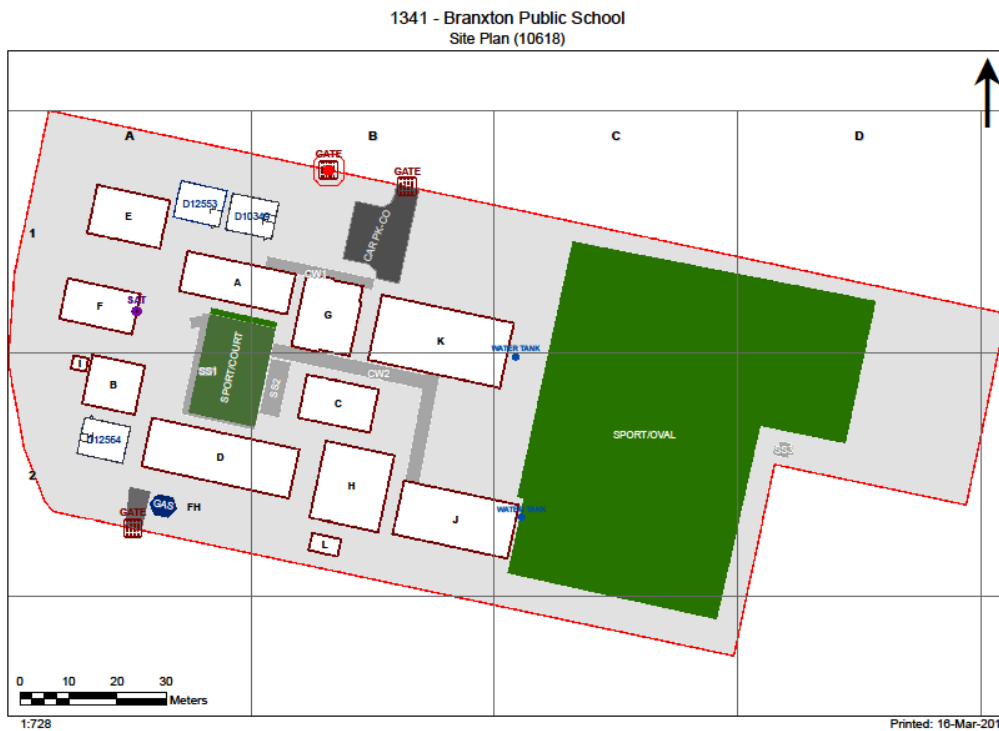

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	-------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior**

**B00A - R0001 - Cleaning Distributed Store**

Non Accessible

**B00A - R0002 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

1341/B00E/R0002/Ceiling Structures/Linings/S7 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00A - R0003 - Security Store**

No Asbestos

**B00A - R0004 - Movement**

No Asbestos

**B00A - R0005 - Sick Bay**

No Asbestos

**B00A - R0006 - Clerical Office**

No Asbestos

**B00A - R0007 - Principal**

No Asbestos

**B00A - R0008 - Interview**

No Asbestos

**B00A - R0009 - Staff Toilet**

No Asbestos

**B00A - R0010 - Staff Toilet**

No Asbestos

**B00A - R0011 - Duplicating Workroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior**

**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

1341/B00B/R0001/Ceiling Structures/Linings/S4

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00B - R0002 - Home Base**

No Asbestos

**B00B - R0003 - Home Base Store**

No Asbestos

**B00B - R0004 - Practical Activities - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	-------	--------------------	---------	--------------------

1341/B00B/R0001/Ceiling Structures/Linings/S4

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		1341/B00B/R0004/Wall Linings Internal/S5				

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior**

**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	1341/B00G/R0001/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>

**B00C - R0002 - Special Programs Room**

No Asbestos

**B00C - R0003 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Pupil Facilities - 1984 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior****B00D - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	1341/B00D/R0003/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>

**B00D - R0002 - Shower/Change**

Ceiling Structures/Linings	Flat AC Sheeting					
	1341/B00D/R0003/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>

**B00D - R0003 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1341/B00D/R0003/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting					
	1341/B00D/R0003/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>

**B00D - R0004 - Plant**

No Asbestos

**B00D - R0005 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1341/B00D/R0003/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting					
	1341/B00D/R0003/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>

**B00D - R0006 - Home Base**

No Asbestos

**B00D - R0007 - Home Base**

No Asbestos

**B00D - R0008 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior**

**B00E - R0001 - Home Base**

No Asbestos

**B00E - R0002 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

1341/B00E/R0002/Ceiling Structures/Linings/S7

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00E - R0003 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Staff Facilities - 1984 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	-------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00F - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	1341/B00F/R0001/Ceiling Structures/Linings/S6					<b>No Asbestos Detected</b>

**B00F - R0002 - Staff Room**

No Asbestos

**B00F - R0003 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 1984 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

**Assumed Asbestos**

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

**Interior****B00G - R0002 - Sports Store**

Non Accessible

**B00G - R0003 - Canteen**

No Asbestos

**B00G - R0004 - Canteen Office/Store**

No Asbestos

**B00G - R0005 - Canteen Office/Store**

No Asbestos

**B00G - R0006 - Movement**

No Asbestos

**B00G - R0007 - Canteen Covered Area**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 1994 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00H - R0001 - Covered Outdoor Learning Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Communal Facilities - 1984 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00I - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Library/Staff Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00J - R0001 - External Movement**

No Asbestos

**B00J - R0002 - Reading Area**

No Asbestos

**B00J - R0003 - Library Office/Workroom**

No Asbestos

**B00J - R0004 - Communications Room**

No Asbestos

**B00J - R0005 - K.L.A. Store**

No Asbestos

**B00J - R0006 - Main Switch Board**

No Asbestos

**B00J - R0007 - Toilet - Lobby**

No Asbestos

**B00J - R0008 - Cleaning Distributed Store**

No Asbestos

**B00J - R0009 - Staff Toilet**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00K - R0001 - External Movement**

No Asbestos

**B00K - R0002 - Practical Activities - 1hb**

No Asbestos

**B00K - R0003 - Home Base**

No Asbestos

**B00K - R0004 - Home Base Store**

No Asbestos

**B00K - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00K - R0006 - Practical Activities - 1hb**

No Asbestos

**B00K - R0007 - Home Base**

No Asbestos

**B00K - R0008 - Home Base Store**

No Asbestos

**B00K - R0009 - Practical Activities - 1hb**

No Asbestos

**B00K - R0010 - Withdrawal Space - 1hb**

No Asbestos

**B00K - R0011 - Home Base**

No Asbestos

**B00K - R0012 - Home Base Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Building Services - 2010 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00L - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

### Demountable details as per the AMS records as of 15 Feb 2017.

#### OS 602 - D10349 - Learning Unit - Standard With P.A.A. : Placement Date - 10/07/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Learning space/withdrawal/entry

No Asbestos Found.

##### R2 - Home Base Store

No Asbestos Found.

#### OS 602 - D12553 - Learning Unit - Standard With P.A.A. : Placement Date - 14/02/2008

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

#### Interior

##### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

##### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

#### OS 603 - D12564 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 12/01/2001

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

#### Interior

##### R1 - Learning space/withdrawal/entry

No Asbestos Found.

##### R2 - Home Base Store

No Asbestos Found.

#### OS 602 - D12808 - Learning Unit - Standard With P.A.A. : Placement Date - 27/04/2006

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

#### Interior

##### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

##### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

#### OS 602 - D16066 - Learning Unit - Standard With P.A.A. : Placement Date - 6/02/2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017