


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bringelly Public School (1360)
Region : South Western Sydney
State Electorate : Camden
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 08 - May - 2008
Reviewed By : Parsons Brinckerhoff : 03 - Jan - 2017

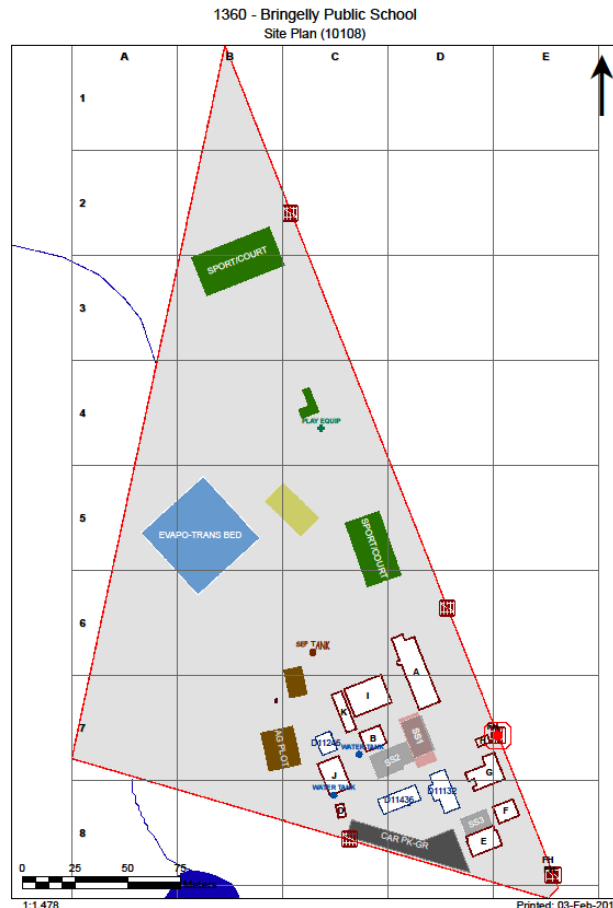

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - General Learning/Administration - 1971 - Brick/Veneer (Brick/Veneer)						
Exterior						
Wall Cladding	Flat AC Sheeting 1360/B00A/Wall Cladding/S5				No Asbestos Detected	
Eaves Linings	Flat AC Sheeting 1360/B00A/Eaves Linings/S18	30m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Gable Verge Lining	Flat AC Sheeting 1360/B00A/Gable Verge Lining/S22	5m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Underfloor Voids	Flat AC Sheeting 1360/B00A/Underfloor Voids/S24	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
Ceiling Void	No Asbestos Found					
Interior						
B00A - R0001 - Personal Effects Storage						
No Asbestos						
B00A - R0002 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting 1360/B00A/R0013/Wall Linings Internal/S6	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 1360/B00A/R0013/Ceiling Structures/Linings/S7	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0003 - Home Base						
Electric Off Peak Heater	Encapsulated Insulation material within unit Assumed Asbestos - Encapsulated material within unit	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	High Priority (6-8)
B00A - R0004 - Toilets - Boys/Girls						
No Asbestos						
B00A - R0005 - Home Base						
Electric Off Peak Heater	Encapsulated Insulation material within unit Assumed Asbestos - Encapsulated material within units	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
B00A - R0006 - Home Base Store						
No Asbestos						
B00A - R0007 - Personal Effects Storage						
No Asbestos						
B00A - R0010 - Movement						
No Asbestos						
B00A - R0011 - General Storeroom						
No Asbestos						
B00A - R0012 - Main Switch Board						
Electrical Backing Board	Resinous Board 1360/B00A/R0012/Electrical Backing Board/S11	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0014 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles 1360/B00A/R0014/Floor Coverings Res/Textile/S8	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0017 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 1360/B00A/R0017/Ceiling Structures/Linings/S9	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Flat AC Sheeting	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0017/In-fill-panel/S10					Chrysotile (white asbestos)	
B00A - R0018 - Movement						
No Asbestos						
B00A - R0019 - Home Base Store						
No Asbestos						
B00A - R0020 - Movement						
No Asbestos						
B00A - R0021 - Access Shower/Toilet						
No Asbestos						
B00A - R0022 - Toilet - Lobby						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Wall Linings Internal/S28					Chrysotile (white asbestos)	
B00A - R0023 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Wall Linings Internal/S28					Chrysotile (white asbestos)	
B00A - R0024 - Toilet - Lobby						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Wall Linings Internal/S28					Chrysotile (white asbestos)	
B00A - R0025 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Wall Linings Internal/S28					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1360/B00A/R0024/Wall Linings Internal/S28					Chrysotile (white asbestos)	
B00A - R0026 - Staff Room						
Recently Modified Space	Requires Inspection					
B00A - R9001 - General Storeroom						
No Asbestos						
B00A - R9002 - Movement						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1952 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/Gable Verge Lining/S23					Chrysotile (white asbestos)
Ceiling Void	AC Fragments/Debris					No Asbestos Detected
	1360/B00B/Ceiling Void/S25					

Interior**B00B - R0001 - Drinking Facilities**

No Asbestos

B00B - R0002 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00B - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00B - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00B - R0005 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00B - R0006 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00B - R0007 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00B - R0008 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Tiered Learning - 1944 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00D/Eaves Linings/S19				Chrysotile (white asbestos)	
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00D/R0001/Wall Linings Internal/S15				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1964 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1360/B00E/Eaves Linings/S20					No Asbestos Detected
Electrical Backing Board	Resinous Board 1360/B00E/Electrical Backing Board/S30					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1360/B00E/R0003/Ceiling Structures/Linings/S1	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 1360/B00E/R0003/In-fill-panel/S2	4m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Administration - 1896 - Brick/Block (Brick/Block)

Exterior

Gable Ends	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
------------	------------------	-----	------------	--------------------	---------	--------------------

Assumed Asbestos - Not Accessible >6m high

Ceiling Void	Non Accessible Area - Manhole not accessible because of fitted kitchen units					
Underfloor Voids	Non Accessible Area - No manhole located in building					

Interior

B00F - R0001 - Movement

Electrical Backing Board	Flat AC Sheeting	1360/B00F/R0001/Electrical Backing Board/S29				No Asbestos Detected
--------------------------	------------------	--	--	--	--	-----------------------------

B00F - R0002 - Special Programs Room

No Asbestos

B00F - R0003 - Entry Vestibule

No Asbestos

B00F - R0004 - Community Clinic

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration/Staff Facilities - 1896 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/Eaves Linings/S21					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior**B00G - R0001 - Other-Vacant**

Wall Linings Internal	Flat AC Sheeting	25m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0002 - Other-Vacant

Wall Linings Internal	Flat AC Sheeting	15m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0003 - Other-Vacant

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0004 - Other-Vacant

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0005 - Other-Vacant

No Asbestos

B00G - R0006 - Other-Vacant

No Asbestos

B00G - R0007 - Other-Vacant

No Asbestos

B00G - R0008 - Other-Vacant

No Asbestos

B00G - R0009 - Other-Vacant

No Asbestos

B00G - R0010 - Other-Vacant

No Asbestos

B00G - R0011 - Other-Vacant

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1360/B00G/R0002/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Backing Board	Resinous Board	1Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1360/B00G/R0011/Electrical Backing Board/S31					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 1956 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 1360/B00H/Wall Cladding/S13					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1360/B00H/Eaves Linings/S14	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Cladding	Flat AC Sheeting 1360/B00H/R0001/Wall Linings Internal/S17					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior

B00H - R0001 - Vacant

Wall Linings Internal	Flat AC Sheeting 1360/B00H/Wall Cladding/S13					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1360/B00H/R0001/Wall Linings Internal/S17					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0002 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0003 - Practical Activities - 1hb

No Asbestos

B00I - R0004 - Movement

No Asbestos

B00I - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0007 - Practical Activities - 1hb

No Asbestos

B00I - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0009 - Movement

No Asbestos

B00I - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1360/B00I/R0010/Ceiling Structures/Linings/S27
----------------------------	--

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Movement

No Asbestos

B00J - R0002 - Reading Area

No Asbestos

B00J - R0003 - Library Office/Workroom

No Asbestos

B00J - R0004 - Communications Room

No Asbestos

B00J - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other - 2016 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00K - R0001 - Garage/Carport

No Asbestos

B00K - R0002 - Garage/Carport

No Asbestos

B00K - R0003 - Covered Outdoor Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 810 - D11132 - FSU/Shelter/Stores : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		25.92 m2

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		28 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		109 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2
---------	---------------	------------------	--	------

R4 - Sports Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

R5 - Garden Store

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

R6 - Change Room

Ceiling	Flat AC Sheet	Assumed Asbestos		3 m2
---------	---------------	------------------	--	------

R7 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		2 m2
---------	---------------	------------------	--	------

OS 602 - D11246 - Learning Unit - Standard With P.A.A. : Placement Date - 26/04/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 502 - D11436 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 27/04/2000

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		23.04 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Clerical Office						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R10 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
R2 - Security Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
R3 - Duplicating Wookroom						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
R4 - Clinic-Waiting						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R5 - Staff Room						
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
R6 - Principal						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R7 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
R8 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
R9 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017