


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Brocklesby Public School (1363)  
**Region :** Riverina  
**State Electorate :** Albury  
**Local Government Area :** Greater Hume

**Initial Survey :** Noel Arnold & Associates : 02 - May - 2008  
**Reviewed By :** Greencap-NAA : 07 - Jul - 2016

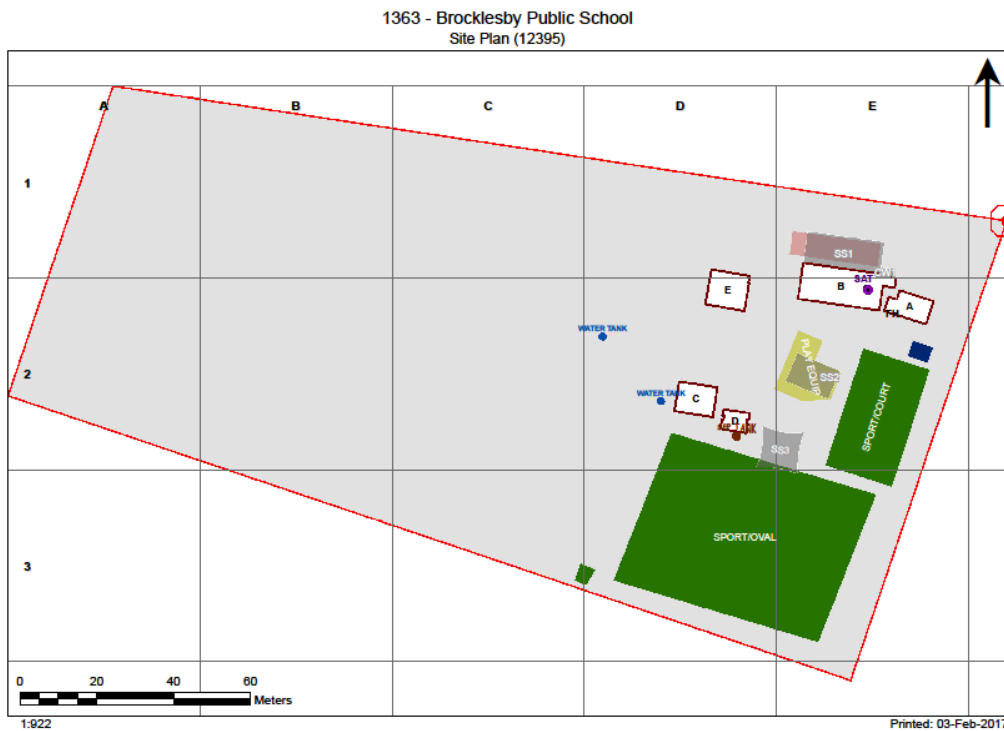

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Library - 1897 - Timber (Timber)**

**Exterior**

Electrical backing board	Resinous Board	1Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	----------	--------------	--------------------	---------	--------------------

**Assumed Asbestos - Electrical Hazard**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - General Storeroom**

No Asbestos

**B00A - R0002 - Reading Area**

No Asbestos

**B00A - R0003 - External Movement**

No Asbestos

**B00A - R0004 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/General Learning - 1950 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 1363/B00B/Eaves Linings/S1					<b>No Asbestos Detected</b>
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00B - R0002 - General Storeroom**

No Asbestos

**B00B - R0003 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1363/B00B/R0003/Floor Coverings Res/Textile/S6	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 1363/B00B/R0003/Floor Coverings Res/Textile/S7	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	<b>Chrysotile (white asbestos)</b>

**B00B - R0004 - Home Base**

Floor Coverings Res/Textile	Adhesive 1363/B00B/R0003/Floor Coverings Res/Textile/S7	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1363/B00B/R0003/Floor Coverings Res/Textile/S6	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - External Movement**

No Asbestos

**B00B - R0006 - Staff Room**

No Asbestos

**B00B - R0007 - Sick Bay**

No Asbestos

**B00B - R0008 - Principal**

No Asbestos

**B00B - R0009 - Clerical Office**

No Asbestos

**B00B - R0010 - Movement**

No Asbestos

**B00B - R0011 - Staff Toilet**

No Asbestos

**B00B - R0012 - Staff Toilet**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Building Services - 1950 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 1363/B00C/R0001/Wall Linings Internal/S5					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Movement**

Floor Coverings Res/Textile	Compressed AC Sheet 1363/B00C/R0001/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting 1363/B00C/R0001/Wall Linings Internal/S5					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 1363/B00C/R0001/Wall Linings Internal/S5					<b>No Asbestos Detected</b>

**B00C - R0002 - General Assistant/Bulk Store**

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1363/B00D/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1363/B00D/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00C - R0003 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1974 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1363/B00D/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**Interior****B00D - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1363/B00D/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00D - R0002 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1363/B00D/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00D - R0003 - Disabled Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1363/B00D/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00D - R0004 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1363/B00D/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Reading Area**

No Asbestos

**B00E - R0002 - K.L.A. Store**

No Asbestos

**B00E - R0003 - Practical Activities**

No Asbestos

**B00E - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017