


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bronte Public School (1372)
Region : Sydney
State Electorate : Coogee
Local Government Area : Waverley

Initial Survey : Noel Arnold & Associates : 12 - Jun - 2008
Reviewed By : AECOM : 26 - May - 2015

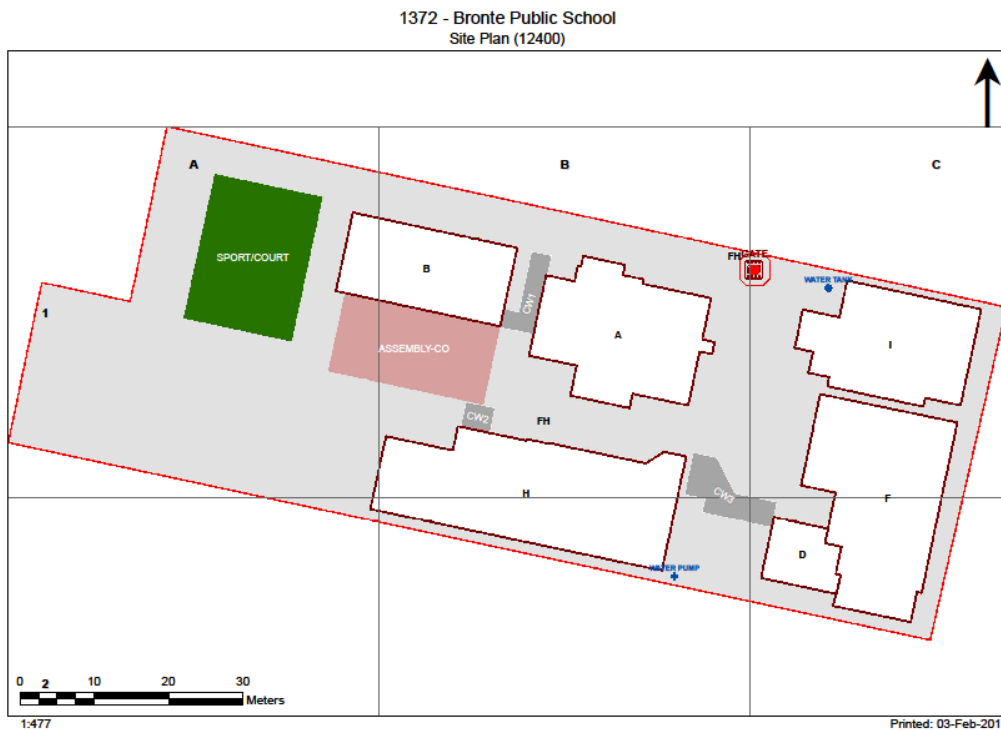

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1926 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Obstructed Area - To tight to access with ladder					
Gable Ends	Flat AC Sheeting	25m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Gable Verge Lining	Non Accessible Area - Extreme Access Issue - Height Restricted - >76m					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Obstructed Area - To tight to access with ladder					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Home Base (50.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00A - R0002 - Movement (2.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00A - R0003 - Withdrawal Space - 1hb (46.51 m2)

No Asbestos

B00A - R0004 - Home Base (61.56 m2)

No Asbestos

B00A - R0005 - Toilets - Boys/Girls (4.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0005/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00A - R0006 - Clerical Office (4.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0005/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00A - R0007 - Movement (25.26 m2)

In-fill-panel	Flat AC Sheeting 1372/B00A/R0007/In-fill panel under windows/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00A - R0008 - Principal (12.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

B00A - R0009 - Movement (5.45 m2)

No Asbestos

B00A - R0010 - Movement (6.77 m2)

No Asbestos

B00A - R0011 - Movement (26.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0012 - Cleaning Distributed Store (3.02 m2)						
No Asbestos						
B00A - R0013 - Duplicating Workroom (12.73 m2)						
No Asbestos						
B00A - R0014 - Personal Effects Storage (6.62 m2)						
No Asbestos						
B00A - R0015 - General Storeroom (4.59 m2)						
No Asbestos						
B00A - R0016 - Toilets - Boys/Girls (3.99 m2)						
No Asbestos						
B00A - R0017 - Stairs (4.94 m2)						
No Asbestos						
B00A - R1001 - Home Base (52.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1002 - Staff Room (49.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1003 - Home Base (50.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1004 - Home Base Store (5.15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
1372/B00A/R1012/Floor Coverings Res/Textile/S10					No Asbestos Detected	
B00A - R1005 - Personal Effects Storage (7.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1006 - Movement (9.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1007 - Staff Room Annexe (17.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1008 - Staff Toilet (4.88 m2)						
No Asbestos						
B00A - R1009 - Movement (16.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1010 - Security Store (13.35 m2)						
No Asbestos						
B00A - R1011 - Personal Effects Storage (6.47 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00A - R1012 - Home Base Store (5.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
1372/B00A/R1012/Floor Coverings Res/Textile/S10					No Asbestos Detected	
B00A - R1013 - Stairs (12.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00A/R0007/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1971 - Brick/Block (Brick/Block)**Exterior**

Gable Ends	Flat AC Sheeting 1372/B00B/R1003/Ceiling Structures/Linings/S5	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 1372/B00B/R1003/Ceiling Structures/Linings/S5	20m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00B - R0001 - Main Switch Board (7.1 m2)**

No Asbestos

B00B - R0002 - General Assistant/Bulk Store (12.68 m2)

No Asbestos

B00B - R0003 - Movement (42.14 m2)

No Asbestos

B00B - R0004 - Practical Activities - 1hb (20.62 m2)

Ceiling Structures/Linings	Vermiculite 1372/B00B/R0007/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 1372/B00B/R0004/Floor Coverings Res/Textile/S4	2m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0005 - Home Base (51.74 m2)

Ceiling Structures/Linings	Vermiculite 1372/B00B/R0007/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00B - R0006 - Home Base (47.79 m2)

Ceiling Structures/Linings	Vermiculite 1372/B00B/R0007/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00B - R0007 - Practical Activities - 1hb (20.7 m2)

Ceiling Structures/Linings	Vermiculite 1372/B00B/R0007/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00B - R0008 - Stairs (6.28 m2)

No Asbestos

B00B - R1001 - General Storeroom (6.16 m2)

No Asbestos

B00B - R1002 - Distribution Board (0.69 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R1003 - Movement (57.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1372/B00B/R1003/Ceiling Structures/Linings/S5	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 1372/B00B/R1003/In-fill panel under windows/S6	5m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R1004 - Practical Activities - 1hb (20.67 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00B/R0004/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00B - R1005 - Home Base (51.88 m2)						
No Asbestos						
B00B - R1006 - Home Base (47.95 m2)						
No Asbestos						
B00B - R1007 - Practical Activities - 1hb (20.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1372/B00B/R0004/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00B - R1008 - Stairs (6.28 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1912 - Timber (Timber)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00D - R0001 - Movement (12.25 m2)

No Asbestos

B00D - R0002 - Home Base (46.91 m2)

No Asbestos

B00D - R0003 - Practical Activities - 1hb (8.7 m2)

No Asbestos

B00D - R0004 - No Access (5.54 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities/Pupil Facilities - 1993 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Hall Chair Store (11.15 m2)

No Asbestos

B00F - R0002 - General Storeroom (3.18 m2)

No Asbestos

B00F - R0003 - General Storeroom (9.79 m2)

No Asbestos

B00F - R0004 - Uniform Shop (11.77 m2)

No Asbestos

B00F - R0005 - Distribution Board (0.46 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0006 - General Storeroom (7.12 m2)

No Asbestos

B00F - R0007 - Canteen (18.34 m2)

No Asbestos

B00F - R0012 - Covered Outdoor Learning Area (95.84 m2)

No Asbestos

B00F - R0013 - Communal Space (187.1 m2)

No Asbestos

B00F - R0014 - Raised Platform (38.38 m2)

No Asbestos

B00F - R0015 - Movement (8.43 m2)

No Asbestos

B00F - R0016 - Movement (6.74 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - General Learning/Library - 2000 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00H - R0002 - Distribution Board (0.78 m2)**

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0003 - Reading Area (160.46 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0004 - Library Office/Workroom (25.08 m2)

No Asbestos

B00H - R0005 - Communications Room (17.3 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0006 - Movement (82.49 m2)

No Asbestos

B00H - R0007 - Practical Activities - 1hb (19.37 m2)

No Asbestos

B00H - R0008 - Home Base Store (6 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0009 - Home Base (60.6 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0010 - Withdrawal Space - 2hb (11.64 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0011 - Home Base (60.32 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0012 - Home Base Store (6 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0013 - Practical Activities - 1hb (18.74 m2)

No Asbestos

B00H - R9002 - Covered Outdoor Learning Area (213.5 m2)

No Asbestos

B00H - R9003 - Practical Activities - 1hb (18.93 m2)

No Asbestos

B00H - R9004 - Home Base Store (5.93 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R9005 - Home Base (60.29 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R9006 - Withdrawal Space - 2hb (11.76 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R9007 - Home Base (59.96 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00H - R9008 - Home Base Store (6.05 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00H - R9009 - Practical Activities - 1hb (19.13 m2)						
No Asbestos						
B00H - R9010 - Kiln Room (6.72 m2)						
No Asbestos						
B00H - R9011 - Distribution Board (0.35 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00H - R9012 - Toilets - Girls (37.5 m2)						
No Asbestos						
B00H - R9013 - Toilets - Boys (23.66 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00I - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00I - R0001 - Home Base Store (6.12 m2)**

No Asbestos

B00I - R0002 - Practical Activities - 1hb (18.21 m2)

No Asbestos

B00I - R0003 - Home Base (60.62 m2)

No Asbestos

B00I - R0004 - Withdrawal Space - 2hb (12.68 m2)

No Asbestos

B00I - R0005 - Home Base (60.5 m2)

No Asbestos

B00I - R0006 - Practical Activities - 1hb (18.19 m2)

No Asbestos

B00I - R0007 - Home Base Store (6.12 m2)

No Asbestos

B00I - R0008 - External Movement (52.17 m2)

No Asbestos

B00I - R0009 - External Stairs (7.4 m2)

No Asbestos

B00I - R0010 - External Stairs (26.5 m2)

No Asbestos

B00I - R1001 - Home Base Store (6.12 m2)

No Asbestos

B00I - R1002 - Practical Activities - 1hb (18.48 m2)

No Asbestos

B00I - R1003 - Home Base (60.51 m2)

No Asbestos

B00I - R1004 - Withdrawal Space - 2hb (12.24 m2)

No Asbestos

B00I - R1005 - Home Base (60.59 m2)

No Asbestos

B00I - R1006 - Practical Activities - 1hb (18.42 m2)

No Asbestos

B00I - R1007 - Home Base Store (6.16 m2)

No Asbestos

B00I - R1008 - External Movement (50.02 m2)

No Asbestos

B00I - R1009 - External Stairs (7.4 m2)

No Asbestos

B00I - R1010 - External Stairs (26.51 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1372_ASB_050813_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017