


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Brookvale Public School (1379)
Region : Northern Sydney
State Electorate : Wakehurst
Local Government Area : Warringah

Initial Survey : Noel Arnold & Associates : 21 - Jan - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Nov - 2016

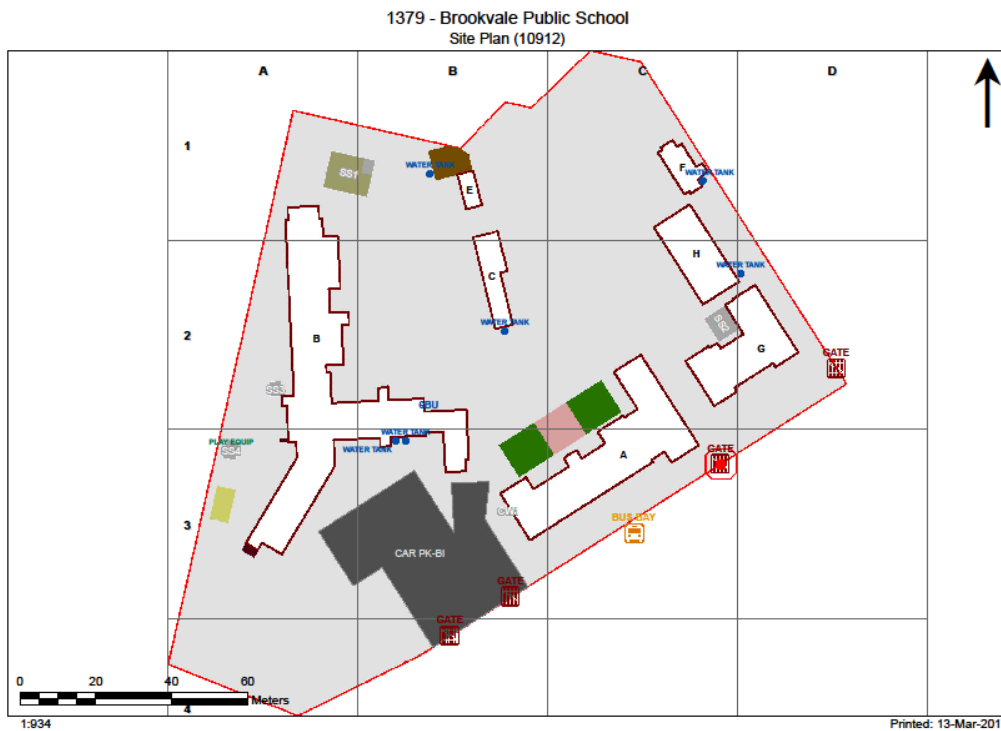

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - Administration/General Learning - 1967 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	250m2	Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00A/Eaves Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Wall Cladding	Flat AC Sheeting	10m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00A/Wall Cladding/S19				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1379/B00A/Underfloor Voids/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Infill Panels Below Windows	Flat AC Sheeting	16m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00A/Infill Panels Below Windows/S20				Chrysotile (white asbestos)	

Interior**B00A - R0001 - Personal Effects Storage**

No Asbestos

B00A - R0002 - Home Base Store

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - Personal Effects Storage

No Asbestos

B00A - R0005 - Home Base Store

No Asbestos

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Home Base

No Asbestos

B00A - R0008 - Personal Effects Storage

No Asbestos

B00A - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00A/R0009/Electrical Mounting Board/S23				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	3m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00A/R0009/Wall Linings Internal/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0010 - Home Base Store

No Asbestos

B00A - R0011 - Staff Room

No Asbestos

B00A - R0012 - K.L.A. Store

No Asbestos

B00A - R0013 - Library Office/Workroom

No Asbestos

B00A - R0020 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0021 - Duplicating Workroom						
Floor Coverings Res/Textile	Vinyl Tiles					
1379/B00A/R0021/Floor Coverings Res/Textile/S6					No Asbestos Detected	
B00A - R0022 - Interview						
No Asbestos						
B00A - R0023 - Staff Toilet						
No Asbestos						
B00A - R0026 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00A/R0026/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R0027 - Cleaning Distributed Store						
No Asbestos						
B00A - R0028 - Movement						
No Asbestos						
B00A - R0029 - Staff Toilet						
No Asbestos						
B00A - R0030 - Movement						
No Asbestos						
B00A - R0031 - Stairs						
No Asbestos						
B00A - R0032 - Stairs						
No Asbestos						
B00A - R0033 - Principal						
No Asbestos						
B00A - R0034 - Special Programs Room						
Infill Panels Below Windows	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00A/R0037/Infill Panels Below Windows/S21					Chrysotile (white asbestos)	
B00A - R0035 - Movement						
No Asbestos						
B00A - R0036 - Special Programs Room						
Infill Panels Below Windows	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00A/R0037/Infill Panels Below Windows/S21					Chrysotile (white asbestos)	
B00A - R0037 - Special Programs Room						
Infill Panels Below Windows	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00A/R0037/Infill Panels Below Windows/S21					Chrysotile (white asbestos)	
B00A - R0038 - Movement						
No Asbestos						
B00A - R0039 - Clerical Office/Workroom						
No Asbestos						
B00A - R0040 - Clerical Office						
No Asbestos						
B00A - R0041 - Sick Bay						
No Asbestos						
B00A - R1001 - Cleaning Distributed Store						
No Asbestos						
B00A - R1002 - Personal Effects Storage						
No Asbestos						
B00A - R1003 - Home Base Store						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - R1004 - Home Base

No Asbestos

B00A - R1005 - Personal Effects Storage

No Asbestos

B00A - R1006 - Home Base Store

No Asbestos

B00A - R1007 - Home Base

No Asbestos

B00A - R1008 - Home Base

No Asbestos

B00A - R1009 - Personal Effects Storage

No Asbestos

B00A - R1010 - Home Base Store

No Asbestos

B00A - R1011 - Home Base - M

No Asbestos

B00A - R1012 - Cleaning Distributed Store

No Asbestos

B00A - R1013 - Home Base Store - M

No Asbestos

B00A - R1014 - Cleaning Distributed Store

No Asbestos

B00A - R1015 - Movement

No Asbestos

B00A - R1016 - Stairs

No Asbestos

B00A - R1017 - Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	300m2	Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00B/Eaves Linings/S12					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Communal Space**

No Asbestos

B00B - R0002 - Raised Platform

No Asbestos

B00B - R0004 - Clerical Office

No Asbestos

B00B - R0005 - Home Base - Pre

No Asbestos

B00B - R0006 - Toilets - Boys/Girls - Pre

No Asbestos

B00B - R0007 - General Storeroom

No Asbestos

B00B - R0008 - Home Base - Pre

No Asbestos

B00B - R0009 - Practical Activities - Pre

No Asbestos

B00B - R0010 - Clerical Office

No Asbestos

B00B - R0011 - Kitchen - Pre

No Asbestos

B00B - R0012 - Kitchen - Pre

No Asbestos

B00B - R0013 - Movement

No Asbestos

B00B - R0014 - Home Base

No Asbestos

B00B - R0015 - Movement

No Asbestos

B00B - R0016 - Staff Room

No Asbestos

B00B - R0017 - Staff Toilet

No Asbestos

B00B - R0018 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00B/R0018/Electrical Mounting Board/S24					Chrysotile (white asbestos)

B00B - R0019 - General Storeroom

No Asbestos

B00B - R0020 - General Storeroom

No Asbestos

B00B - R0021 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0022 - Personal Effects Storage						
No Asbestos						
B00B - R0024 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R0024/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0025 - Music Store						
No Asbestos						
B00B - R0026 - Cleaning Distributed Store						
No Asbestos						
B00B - R0028 - Movement						
No Asbestos						
B00B - R0029 - Home Base						
No Asbestos						
B00B - R0030 - Home Base						
No Asbestos						
B00B - R0031 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R0024/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0032 - Movement						
No Asbestos						
B00B - R0033 - Staff Toilet						
No Asbestos						
B00B - R0034 - Movement						
No Asbestos						
B00B - R0035 - General Storeroom						
No Asbestos						
B00B - R0036 - Deputy Principal						
No Asbestos						
B00B - R0037 - Staff Toilet						
No Asbestos						
B00B - R0038 - Home Base						
No Asbestos						
B00B - R0039 - Withdrawal Space - 1hb						
No Asbestos						
B00B - R0040 - Withdrawal Space - 1hb						
No Asbestos						
B00B - R0041 - Personal Effects Storage						
No Asbestos						
B00B - R0042 - Home Base						
No Asbestos						
B00B - R0043 - Movement						
No Asbestos						
B00B - R0044 - Sports Store						
No Asbestos						
B00B - R0046 - Staff Room						
No Asbestos						
B00B - R0047 - Movement						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0048 - Stairs						
No Asbestos						
B00B - R0049 - Communal/Performance Store						
No Asbestos						
B00B - R0050 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R0024/Ceiling Structures/Linings/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0051 - Canteen						
No Asbestos						
B00B - R0052 - Hall Chair Store						
No Asbestos						
B00B - R0053 - Kiln Room						
No Asbestos						
B00B - R0054 - Movement						
No Asbestos						
B00B - R9001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9002 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
1379/B00B/R9007/Floor Coverings Res/Textile/S9				No Asbestos Detected		
B00B - R9003 - Canteen Office/Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
1379/B00B/R9007/Floor Coverings Res/Textile/S9				No Asbestos Detected		
Electrical Mounting Board	Resinous Board	1Unit	North facing, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access - Metal cased Unit -						
B00B - R9004 - Distribution Board						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9005 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
1379/B00B/R9007/Floor Coverings Res/Textile/S9				No Asbestos Detected		
B00B - R9006 - Canteen						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
1379/B00B/R9007/Floor Coverings Res/Textile/S9				No Asbestos Detected		
B00B - R9007 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
1379/B00B/R9007/Floor Coverings Res/Textile/S9				No Asbestos Detected		
B00B - R9008 - Communal Space						
Ceiling Structures/Linings	Flat AC Sheeting	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00B/R9008/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9009 - Movement						
No Asbestos						
B00B - R9010 - Handwashing Facilities						
No Asbestos						
B00B - R9011 - Toilets - Boys						
No Asbestos						
B00B - R9012 - Movement						
No Asbestos						
B00B - R9013 - Handwashing Facilities						
No Asbestos						
B00B - R9014 - Toilets - Girls						
No Asbestos						
B00B - R9015 - Handwashing Facilities						
No Asbestos						
B00B - R9016 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1967 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00C/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B00C - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00C/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00C/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1967 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1379/B00E/Eaves Linings/S13	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	AC Fragments/Debris 1379/B00E/Ceiling Void/S15	1m2	Around Manhole	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00E - R0001 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting 1379/B00C/R0001/Ceiling Structures/Linings/S2	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00C/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00F - R0001 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1379/B00C/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0002 - Toilets - Boys

No Asbestos

B00F - R0003 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1379/B00F/R0003/Ceiling Structures/Linings/S17			Chrysotile (white asbestos)		

B00F - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1379/B00F/R0004/Ceiling Structures/Linings/S18			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1902 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - No Access without damaging Lino floor
Ceiling Void	No Asbestos Found

Interior

B00G - R0001 - Seminar/Study

No Asbestos

B00G - R0002 - Seminar/Study

No Asbestos

B00G - R0003 - Seminar/Study

Chalk Board	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1379/B00G/R0003/Chalk Board/S22					Chrysotile (white asbestos)	

B00G - R0004 - Seminar/Study

No Asbestos

B00G - R0005 - Movement

No Asbestos

B00G - R0006 - Movement

No Asbestos

B00G - R0007 - Staff Toilet

No Asbestos

B00G - R0008 - Staff Toilet

No Asbestos

B00G - R0009 - Deputy Principal

No Asbestos

B00G - R0011 - Movement

No Asbestos

B00G - R0012 - Movement

No Asbestos

B00G - R0013 - Interview

No Asbestos

B00G - R0014 - Seminar/Study

No Asbestos

B00G - R0015 - Clerical Office

No Asbestos

B00G - R0016 - Movement

No Asbestos

B00G - R0017 - General Storeroom

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - External Movement

No Asbestos

B00H - R0002 - Reading Area

No Asbestos

B00H - R0003 - Toilet - Lobby

No Asbestos

B00H - R0004 - Cleaning Distributed Store

No Asbestos

B00H - R0005 - Staff Toilet

No Asbestos

B00H - R0006 - K.L.A. Store

No Asbestos

B00H - R0007 - Communications Room

No Asbestos

B00H - R0008 - Library Office/Workroom

No Asbestos

B00H - R0009 - Main Switch Board Cupboard

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1379_ASB_030113_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017