


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Brunswick Heads Public School (1389)  
**Region :** North Coast  
**State Electorate :** Ballina  
**Local Government Area :** Byron

**Initial Survey :** Noel Arnold & Associates : 10 - Jun - 2008  
**Reviewed By :** Grencap-NAA : 04 - May - 2016

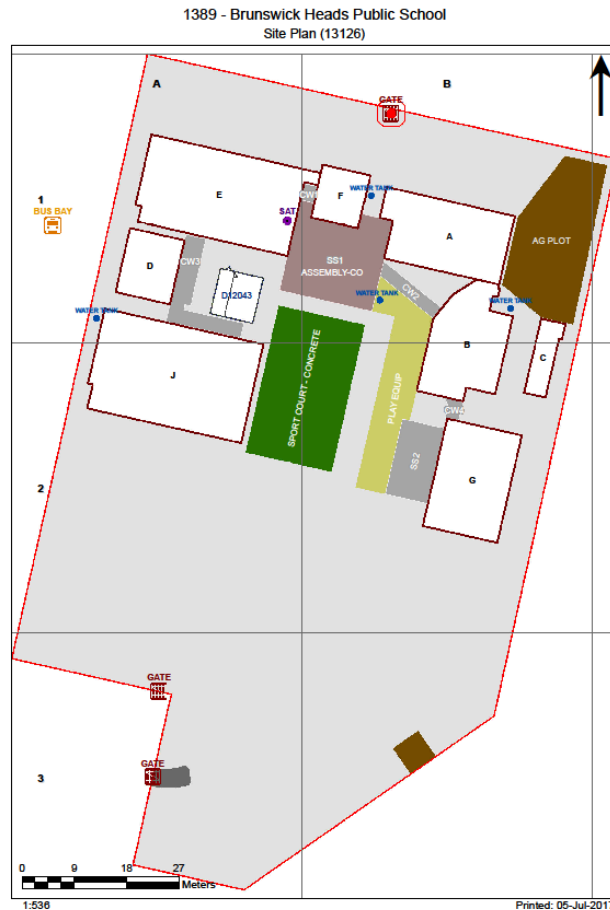

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1916 - Timber (Timber)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1389/B00A/Eaves Linings/S19					<b>No Asbestos Detected</b>

**Interior****B00A - R0001 - Sick Bay (13.1 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 1389/B00A/R0001/Floor Coverings Res/Textile/S6	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1389/B00F/R0001/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 1389/B00F/R0001/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>

**B00A - R0002 - Security Store (8.67 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 1389/B00A/R0001/Floor Coverings Res/Textile/S6	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting 1389/B00A/R0002/Wall Linings Internal/S20					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles 1389/B00F/R0001/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 1389/B00F/R0001/Floor Coverings Res/Textile/S8					<b>No Asbestos Detected</b>

**B00A - R0003 - Principal (10.69 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1389/B00A/R0014/Floor Coverings Res/Textile/S21	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 1389/B00A/R0008/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

**B00A - R0004 - Deputy Principal (9.66 m2)**

Wall Linings Internal	Flat AC Sheeting 1389/B00A/R0002/Wall Linings Internal/S20					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1389/B00A/R0014/Floor Coverings Res/Textile/S21	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 1389/B00A/R0008/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

**B00A - R0008 - Withdrawal Space - 2hb (38.27 m2)**

Wall Linings Internal	Flat AC Sheeting 1389/B00A/R0002/Wall Linings Internal/S20					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 1389/B00A/R0008/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 1389/B00A/R0014/Floor Coverings Res/Textile/S21	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0009 - Home Base Store (8.84 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Poor Condition (4)	Low (1)	Low Priority (2-3)
	1389/B00A/R0001/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1389/B00A/R0002/Wall Linings Internal/S20					
<b>B00A - R0010 - Practical Activities - 1hb (14.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00A/R0001/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1389/B00A/R0002/Wall Linings Internal/S20					
<b>B00A - R0013 - External Movement (85.03 m2)</b>						
No Asbestos						
<b>B00A - R0014 - Clerical Office (20.08 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1389/B00A/R0002/Wall Linings Internal/S20					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00A/R0014/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	1389/B00A/R0008/Floor Coverings Res/Textile/S15					
<b>B00A - R0015 - Security Store (5.09 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1389/B00A/R0002/Wall Linings Internal/S20					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00A/R0014/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	1389/B00A/R0008/Floor Coverings Res/Textile/S15					
<b>B00A - R0016 - Entry Vestibule (12.37 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Clerical/Printing (8.89 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	1389/B00A/R0002/Wall Linings Internal/S20					
<b>B00A - R0018 - Movement (3.82 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Pupil Facilities - 1960 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restricted, greater 4m

**Interior****B00B - R0001 - Toilets - Girls (1.64 m2)**

No Asbestos

**B00B - R0002 - Toilets - Girls (22.98 m2)**

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1389/B00B/R0002/Wall Linings Internal/S16					<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Drinking Facilities (7.48 m2)**

No Asbestos

**B00B - R0004 - Toilets - Boys (28.55 m2)**

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1389/B00B/R0002/Wall Linings Internal/S16					<b>Chrysotile (white asbestos)</b>	

**B00B - R0005 - Toilets - Boys (1.62 m2)**

No Asbestos

**B00B - R0006 - Special Programs Room (32.89 m2)**

No Asbestos

**B00B - R0008 - Stairs (4.75 m2)**

No Asbestos

**B00B - R0009 - Stairs (3.8 m2)**

No Asbestos

**B00B - R0010 - External Movement (96.55 m2)**

No Asbestos

**B00B - R1001 - Movement (1.16 m2)**

No Asbestos

**B00B - R1005 - Home Base Store (7.92 m2)**

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1389/B00B/R1009/Wall Linings Internal/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R1006 - Practical Activities - 1hb (7.15 m2)**

No Asbestos

**B00B - R1007 - Movement (1.16 m2)**

No Asbestos

**B00B - R1008 - Home Base (60.78 m2)**

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1389/B00B/R1009/Wall Linings Internal/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R1009 - Duplicating Workroom (18.1 m2)**

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1389/B00B/R1009/Wall Linings Internal/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R1010 - Movement (11.7 m2)**

Wall Linings Internal	Flat AC Sheeting	15m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)
1389/B00B/R1009/Wall Linings Internal/S17					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - R1011 - Stairs (2.68 m2)**

No Asbestos

**B00B - R1012 - Stairs (3.66 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1983 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction 4 metres					
Eaves Linings	Flat AC Sheeting 1389/B00C/Eaves Linings/S22					<b>No Asbestos Detected</b>

**Interior**

**B00C - R0001 - Shower/Change (10.37 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1389/B00C/R0001/Ceiling Structures/Linings/S18					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00C - R0002 - Shower/Change (10.37 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1389/B00C/R0001/Ceiling Structures/Linings/S18					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00C - R0003 - Other (11.17 m2)**

No Asbestos

**B00C - R0004 - General Assistant/Bulk Store (12.21 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 1927 - Timber (Timber)****Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restricted, greater 4m					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/Eaves Linings/S23					<b>Chrysotile (white asbestos)</b>

**Interior****B00D - R0001 - K.L.A. Store (8.94 m2)**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0002/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>

**B00D - R0002 - Reading Area (72.18 m2)**

Wall Linings Internal	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0002/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>

**B00D - R0003 - K.L.A. Store (6.45 m2)**

Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0002/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0003/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos)</b>

**B00D - R0004 - Library Office/Workroom (9.22 m2)**

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0002/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0003/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos)</b>

**B00D - R0005 - Movement (4.13 m2)**

Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0002/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00D/R0003/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1971 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- No entry gate					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00E - R0004 - General Storeroom (4.3 m2)**

Ceiling Structures/Linings	Vermiculite					
	1389/B00E/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00E - R0006 - External Movement (21.86 m2)**

No Asbestos

**B00E - R0007 - Home Base (60.59 m2)**

Ceiling Structures/Linings	Vermiculite					
	1389/B00E/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Chalk Board	Flat AC Sheeting					
	1389/B00E/R0007/Chalk Board/S2					<b>No Asbestos Detected</b>

**B00E - R0008 - Home Base Store (6.23 m2)**

Ceiling Structures/Linings	Vermiculite					
	1389/B00E/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00E - R0009 - Movement (6.47 m2)**

Ceiling Structures/Linings	Vermiculite					
	1389/B00E/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00E - R0011 - Library Office/Workroom (111.83 m2)**

Ceiling Structures/Linings	Vermiculite					
	1389/B00E/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00E - R0012 - Resource/Toy Space (23.83 m2)**

Ceiling Structures/Linings	Vermiculite					
	1389/B00E/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00E - R0014 - Movement (17.38 m2)**

Ceiling Structures/Linings	Vermiculite					
	1389/B00E/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00E - R0015 - External Movement (64.09 m2)**

No Asbestos

**B00E - R0016 - External Movement (70.81 m2)**

No Asbestos

**B00E - R1001 - Movement (52.78 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R1002 - Home Base (84.17 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00E - R1003 - Withdrawal Space - 1hb (8.18 m2)</b>						
No Asbestos						
<b>B00E - R1004 - Practical Activities - 1hb (4.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1008/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	1389/B00E/R1008/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Low Density Board	4.5m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
	1389/B00E/R1005/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00E - R1005 - Home Base Store (5.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1008/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	1389/B00E/R1008/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Low Density Board	5m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
	1389/B00E/R1005/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00E - R1006 - Toilets - Boys/Girls (1.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1008/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	1389/B00E/R1008/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Low Density Board	2m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
	1389/B00E/R1005/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00E - R1007 - Home Base (60.43 m2)</b>						
No Asbestos						
<b>B00E - R1008 - Home Base Store (6.28 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1008/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	1389/B00E/R1008/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	
<b>B00E - R1009 - Movement (6.5 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1008/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	1389/B00E/R1008/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	
<b>B00E - R1010 - Stairs (13.98 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1389/B00E/R1001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Administration/Building Services - 1892 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

**Interior**

**B00F - R0001 - Staff Room (33.93 m2)**

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)  
1389/B00F/R0001/Floor Coverings Res/Textile/S7 **No Asbestos Detected**

Floor Coverings Res/Textile Adhesive  
1389/B00F/R0001/Floor Coverings Res/Textile/S8 **No Asbestos Detected**

**B00F - R0005 - Movement (5.55 m2)**

Wall Linings Internal Flat AC Sheeting  
1389/B00F/R0006/Wall Linings Internal/S4 **No Asbestos Detected**

**B00F - R0007 - Raised Platform (20.92 m2)**

No Asbestos

**B00F - R0008 - Staff Toilet (2.04 m2)**

Wall Linings Internal Flat AC Sheeting  
1389/B00F/R0006/Wall Linings Internal/S4 **No Asbestos Detected**

**B00F - R0009 - Toilet - Lobby (2.93 m2)**

Wall Linings Internal Flat AC Sheeting  
1389/B00F/R0006/Wall Linings Internal/S4 **No Asbestos Detected**

**B00F - R0010 - Toilet - Lobby (1.92 m2)**

Wall Linings Internal Flat AC Sheeting  
1389/B00F/R0006/Wall Linings Internal/S4 **No Asbestos Detected**

**B00F - R0011 - Staff Toilet (1.63 m2)**

Wall Linings Internal Flat AC Sheeting  
1389/B00F/R0006/Wall Linings Internal/S4 **No Asbestos Detected**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1998 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Packing to Floor Joists      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior****B00G - R0001 - External Movement (39.31 m2)**

No Asbestos

**B00G - R0002 - Practical Activities - 1hb (19.97 m2)**

No Asbestos

**B00G - R0003 - Home Base Store (7.87 m2)**

No Asbestos

**B00G - R0004 - Communications Cupboard (0.2 m2)**

No Asbestos

**B00G - R0005 - Home Base (59.05 m2)**

No Asbestos

**B00G - R0006 - Withdrawal Space - 1hb (9.71 m2)**

No Asbestos

**B00G - R0007 - Home Base (59.05 m2)**

No Asbestos

**B00G - R0008 - Home Base Store (8.89 m2)**

No Asbestos

**B00G - R0009 - Practical Activities - 1hb (19.99 m2)**

No Asbestos

**B00G - R0010 - Distribution Board (0.57 m2)**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B00J - R0001 - Communal Space (145.26 m2)**

No Asbestos

**B00J - R0002 - Raised Platform (60.06 m2)**

No Asbestos

**B00J - R0003 - Chair Storeroom (9.53 m2)**

No Asbestos

**B00J - R0004 - Communal/Performance Store (9.08 m2)**

No Asbestos

**B00J - R0005 - P.E. Store (12.6 m2)**

No Asbestos

**B00J - R0006 - Toilet - Lobby (2.37 m2)**

No Asbestos

**B00J - R0007 - Toilets - Girls (7.31 m2)**

No Asbestos

**B00J - R0008 - Communications Cupboard (2.06 m2)**

No Asbestos

**B00J - R0009 - Toilet - Lobby (3.3 m2)**

No Asbestos

**B00J - R0010 - Toilets - Boys (5.71 m2)**

No Asbestos

**B00J - R0011 - Cleaning Distributed Store (3.51 m2)**

No Asbestos

**B00J - R0012 - Plant (1.6 m2)**

No Asbestos

**B00J - R0013 - Distribution Board (3.23 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00J - R0014 - Access Shower/Toilet (6.87 m2)**

No Asbestos

**B00J - R0015 - External Movement (143.64 m2)**

No Asbestos

**B00J - R0016 - Movement (6.17 m2)**

No Asbestos

**B00J - R0017 - Ramp (12.43 m2)**

No Asbestos

**B00J - R0018 - Movement (12.99 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 801 - D12043 - FSU : Placement Date - 17/05/2010

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2

#### Interior

##### R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	45 m2

##### R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017