


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bulahdelah Central School (1402)
Region : North Coast
State Electorate : Myall Lakes
Local Government Area : Great Lakes

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 24 - Feb - 2015

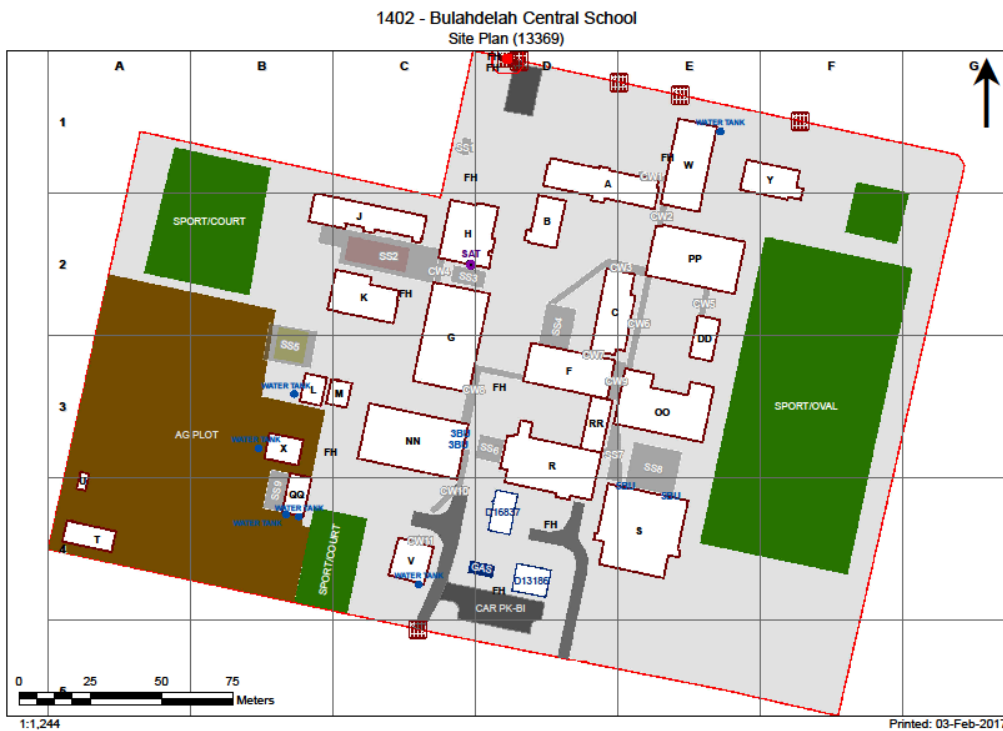

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Technological & Applied Studies/General Learning - 1955 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00A/Eaves Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Void	Flat AC Sheeting Debris					
	1402/B00A/Underfloor Void/S23			No Asbestos Detected		

Interior**B00A - R0001 - External Movement (41.94 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00A/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0004 - Staff Room Annexe (22.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	1402/B00A/R0004/Floor Coverings Res/Textile/S7			No Asbestos Detected		

B00A - R0005 - General Learning Space (53.79 m2)

No Asbestos

B00A - R0006 - General Storeroom (14.64 m2)

No Asbestos

B00A - R0007 - General Storeroom (7.47 m2)

No Asbestos

B00A - R0008 - Computer Learning Space (53.48 m2)

No Asbestos

B00A - R0009 - External Movement (40.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00A/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0010 - External Movement (10.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00A/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0011 - External Movement (7.05 m2)

No Asbestos

B00A - R0012 - Food Technology L.S. (133.93 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Staff Facilities - 1965 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00B/Eaves Linings/S24					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Void	Flat AC Sheeting Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1402/B00B/Underfloor Void/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00B - R0002 - Staff Lounge (97.09 m2)**

No Asbestos

B00B - R0003 - Access Shower/Toilet (9.16 m2)

No Asbestos

B00B - R0005 - External Movement (5.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00B/R0005/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00B - R0008 - Staff Kitchen (9.39 m2)

No Asbestos

B00B - R0009 - Utility Space (17.71 m2)

No Asbestos

B00B - R0010 - Movement (7.57 m2)

No Asbestos

B00B - R0011 - Staff Room Annexe (9.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Science - 1981 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - R0005 - External Movement (72.97 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
1402/B00C/R0005/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)	

B00C - R0006 - Interview/Office - Type 1 (27.01 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0007 - Seminar/Study (12.83 m2)

No Asbestos

B00C - R0008 - General Learning Space - Type 2 (129.62 m2)

No Asbestos

B00C - R0009 - Entry Vestibule (22.04 m2)

No Asbestos

B00C - R0010 - Careers Advisers Office (14.44 m2)

No Asbestos

B00C - R0011 - Ancillary Staff (13.29 m2)

No Asbestos

B00C - R0012 - Distribution Board (0.93 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies/Staff Facilities - 1955 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - R0001 - External Movement (164.81 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	158m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
1402/B00F/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	

B00F - R0002 - Cleaning Distributed Store (4.1 m2)

No Asbestos

B00F - R0003 - Staff Toilet (5.56 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00F/R0003/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	

B00F - R0004 - Staff Toilet (5.63 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00F/R0003/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)	

B00F - R0005 - Plant (12.58 m2)

No Asbestos

B00F - R0006 - Distribution Board (2.15 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0007 - Withdrawal Space - 1hb (14.26 m2)

No Asbestos

B00F - R0008 - Welding Area (13.39 m2)

No Asbestos

B00F - R0009 - Metal Technology Bay (4.33 m2)

No Asbestos

B00F - R0010 - Materials Technology L.S. (127.57 m2)

No Asbestos

B00F - R0011 - Materials Store (32.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities/Library - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00G - R0001 - External Movement (177.8 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	170m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00G/R0025/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

B00G - R0002 - Main Switch Board (9.26 m2)

No Asbestos

B00G - R0003 - Cleaning Supplies (7.49 m2)

No Asbestos

B00G - R0004 - General Assistant/Bulk Store (7.57 m2)

No Asbestos

B00G - R0005 - Staff Toilet (1.6 m2)

No Asbestos

B00G - R0006 - Canteen Office/Store (6.38 m2)

No Asbestos

B00G - R0008 - Plant (3.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
1402/B00G/R0017/Floor Coverings Res/Textile/S2					No Asbestos Detected	

B00G - R0009 - Canteen (31.9 m2)

No Asbestos

B00G - R0011 - P.E. Store (10.33 m2)

No Asbestos

B00G - R0012 - Communal Space (163.23 m2)

No Asbestos

B00G - R0013 - Shower/Change (16.5 m2)

No Asbestos

B00G - R0014 - Shower/Change (2.19 m2)

No Asbestos

B00G - R0015 - Toilets - Boys (13.62 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00G/R0018/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	

B00G - R0016 - Plant (0.78 m2)

No Asbestos

B00G - R0017 - Movement (38.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
1402/B00G/R0017/Floor Coverings Res/Textile/S2					No Asbestos Detected	

Ceiling Structures/Linings	Vermiculite					
1402/B00G/R0017/Ceiling Structures/Linings/S3					Limited Samples Taken	

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00G - R0018 - Toilets - Girls (12.09 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00G/R0018/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	

B00G - R0019 - Shower/Change (20.46 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00G - R0020 - Plant (0.75 m2)						
No Asbestos						
B00G - R0021 - Distribution Board (1.61 m2)					Note: No inspection of live electrical installation.	
Floor Coverings Res/Textile	Vinyl Tiles					
	1402/B00G/R0017/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00G - R0025 - Hall Chair Store (11.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00G/R0025/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00G - R0026 - Stairs (14.23 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	1402/B00G/R0026/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00G - R0027 - Stairs (8.97 m2)						
No Asbestos						
B00G - R0028 - Stage (78 m2)						
No Asbestos						
B00G - R0029 - Control Room (3.86 m2)						
No Asbestos						
B00G - R0031 - Preparation (12.31 m2)						
Recently Modified Space	Requires Inspection					
B00G - R0032 - Cleaning Store - Distributed (6.44 m2)						
Recently Modified Space	Requires Inspection					
B00G - R1001 - Movement (8 m2)						
No Asbestos						
B00G - R1006 - Staff Kitchen (15.29 m2)						
No Asbestos						
B00G - R1009 - Disabled Shower/Toilet (6.05 m2)						
No Asbestos						
B00G - R1010 - Staff - Toilet (5.35 m2)						
No Asbestos						
B00G - R1011 - Staff Study (191.83 m2)						
No Asbestos						
B00G - R1012 - Interview/Office - Type 1 (19.43 m2)						
No Asbestos						
B00G - R1013 - Stairs (14.23 m2)						
No Asbestos						
B00G - R1014 - Stairs (8.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00G/R1014/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration/Staff Facilities - 1981 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Interview/Meeting (24.44 m2)

No Asbestos

B00H - R0002 - External Movement (74.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00H/R0002/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00H - R0005 - Duplicating Workroom (21.37 m2)

No Asbestos

B00H - R0008 - Staff Toilet (2.31 m2)

No Asbestos

B00H - R0009 - Staff Toilet (2.36 m2)

No Asbestos

B00H - R0011 - Staff Room Annexe (12.4 m2)

No Asbestos

B00H - R0015 - Sick Bay (12.05 m2)

No Asbestos

B00H - R0016 - Distribution Board (0.67 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0021 - Principal (18.96 m2)

No Asbestos

B00H - R0022 - Entry Vestibule (22.43 m2)

No Asbestos

B00H - R0023 - Interview/Office - Type 1 (13.3 m2)

No Asbestos

B00H - R0024 - Movement (15.41 m2)

No Asbestos

B00H - R0025 - Administration - Clerical (61.61 m2)

No Asbestos

B00H - R0026 - Staff Kitchen (5.16 m2)

No Asbestos

B00H - R0027 - Disabled Shower/Toilet (4.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1402/B00H/R0027/Ceiling Structures/Linings/S33				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00H - R0028 - Cleaning Distributed Store (2.83 m2)

No Asbestos

B00H - R0029 - Student Reception (10.09 m2)

No Asbestos

B00H - R0030 - Movement (11.82 m2)

No Asbestos

B00H - R0031 - Deputy Principal (13.3 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning/Pupil Facilities - 1965 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00J/Eaves Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00J - R0001 - Home Base Store (4.57 m2)**

No Asbestos

B00J - R0002 - Movement (9.92 m2)

No Asbestos

B00J - R0003 - Home Base (56.36 m2)

No Asbestos

B00J - R0004 - Home Base (56.43 m2)

No Asbestos

B00J - R0005 - Home Base Store (4.21 m2)

No Asbestos

B00J - R0006 - Movement (17.27 m2)

No Asbestos

B00J - R0007 - Craft Store (2.91 m2)

No Asbestos

B00J - R0008 - Home Base Store (2.65 m2)

No Asbestos

B00J - R0009 - Home Base (56.52 m2)

No Asbestos

B00J - R0010 - Home Base (78.2 m2)

No Asbestos

B00J - R0011 - Home Base Store (3.29 m2)

No Asbestos

B00J - R0012 - Personal Effects Storage (11.21 m2)

No Asbestos

B00J - R0013 - External Movement (23.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	1402/B00J/R0013/Wall Linings Internal/S19					

B00J - R0014 - External Movement (5.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00J - R0015 - External Movement (4.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00J - R9001 - No Access (7.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R9002 - Sports Store (11.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
B00J - R9003 - Movement (29.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
B00J - R9004 - Toilets - Girls (21.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
B00J - R9005 - Toilets - Boys (15.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
B00J - R9006 - External Movement (19.78 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
1402/B00J/R0013/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
In-fill-panel	Compressed AC Sheet	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00K/In-fill-panel/S20					Chrysotile (white asbestos)
In-fill-panel	Compressed AC Sheet	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
In-fill-panel	Compressed AC Sheet	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	1402/B00K/Eaves Linings/S27					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	Non Accessible Area - Area inaccessible					
Gable Lining	Flat AC Sheeting					No Asbestos Detected
	1402/B00K/Gable Lining/S28					

Interior

B00K - R0001 - External Movement (144.95 m2)

No Asbestos

B00K - R0002 - Special Programs Room (58.11 m2)

No Asbestos

B00K - R0003 - Home Base Store (5.52 m2)

No Asbestos

B00K - R0004 - Movement (17.18 m2)

No Asbestos

B00K - R0005 - Distribution Board (0.98 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0006 - Home Base Store (4.34 m2)

No Asbestos

B00K - R0007 - Home Base (58.34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1913 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1402/B00L/Eaves Linings/S29					No Asbestos Detected

Interior

B00L - R0001 - General Storeroom (5.83 m2)

No Asbestos

B00L - R0002 - General Learning Space (10.92 m2)

No Asbestos

B00L - R0003 - Movement (53.49 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 1966 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00M/Eaves Linings/S30			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00M - R0001 - Computer Store (6.24 m2)

No Asbestos

B00M - R0002 - General Learning Space (43.81 m2)

No Asbestos

B00M - R0003 - External Movement (9.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1402/B00M/R0003/Ceiling Structures/Linings/S17			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00R - Art/General Learning - 2007 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00R - R0001 - Practice/Seminar (18.18 m2)**

No Asbestos

B00R - R0002 - General Learning Space (59.43 m2)

No Asbestos

B00R - R0003 - General Learning Space (59.01 m2)

No Asbestos

B00R - R0004 - Performance Store (12.2 m2)

No Asbestos

B00R - R0005 - Fitness Store (10 m2)

No Asbestos

B00R - R0006 - Distribution Board Cupboard (5.8 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00R - R0007 - External Movement (79.18 m2)

No Asbestos

B00R - R0008 - External Stairs (0.74 m2)

No Asbestos

B00R - R1001 - General Learning Space (59.7 m2)

No Asbestos

B00R - R1002 - General Learning Space (59.92 m2)

No Asbestos

B00R - R1003 - Visual Arts Workshop (99.83 m2)

No Asbestos

B00R - R1004 - Cleaning Distributed Store (3.06 m2)

No Asbestos

B00R - R1005 - Kiln Space (9.17 m2)

No Asbestos

B00R - R1006 - Pottery Store (9.98 m2)

No Asbestos

B00R - R1007 - Welding Area (12.14 m2)

No Asbestos

B00R - R1008 - Visual Arts Store (20.52 m2)

No Asbestos

B00R - R1009 - Project Store - Type 1 (25.58 m2)

No Asbestos

B00R - R1010 - Other (0.83 m2)

No Asbestos

B00R - R1011 - Outdoor Workshop (84.65 m2)

No Asbestos

B00R - R1012 - Distribution Board Cupboard (0.52 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00R - R1014 - External Stairs (22.39 m2)

No Asbestos

B00R - R1015 - External Movement (108.01 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00S - Multi Purpose Facilities/Physical Education - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00S - R0001 - Gymnasium (481.79 m2)

No Asbestos

B00S - R0002 - Change (22.08 m2)

No Asbestos

B00S - R0003 - Shower (14.69 m2)

No Asbestos

B00S - R0004 - Change (22.03 m2)

No Asbestos

B00S - R0005 - Shower (14.77 m2)

No Asbestos

B00S - R0006 - Large Equipment Store (25.09 m2)

No Asbestos

B00S - R0007 - Chair Store (21.95 m2)

No Asbestos

B00S - R0008 - Toilets - Boys/Girls (6.11 m2)

No Asbestos

B00S - R0009 - Shower (2.7 m2)

No Asbestos

B00S - R0010 - Access Shower/Toilet (5.34 m2)

No Asbestos

B00S - R0011 - First Aid (12.95 m2)

No Asbestos

B00S - R0012 - Sport Equipment Store (25.07 m2)

No Asbestos

B00S - R0013 - Distribution Board Cupboard (0.5 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00S - R0014 - Other (0.31 m2)

No Asbestos

B00S - R0017 - External Movement (71.94 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Agricultural Science - 2006 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00T - R0001 - Agriculture Covered Area (78.16 m2)

No Asbestos

B00T - R0002 - Garden Store (52.35 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Agricultural Science - 2006 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00U - R0001 - Animal Space (8.61 m2)

No Asbestos

B00U - R0002 - Animal Space (9.43 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void No Asbestos Found

Underfloor void No Asbestos Found

Interior**B00V - R0001 - General Learning Space - Type 2 (91.59 m2)**

No Asbestos

B00V - R0002 - Seminar - Type 2 (18.7 m2)

No Asbestos

B00V - R0003 - Resource/Project Store (10.05 m2)

No Asbestos

B00V - R0004 - Computer Store (9.01 m2)

No Asbestos

B00V - R0005 - External Movement (28.99 m2)

No Asbestos

B00V - R0006 - Distribution Board Cupboard (0.5 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00W - Library - 2011 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00W - R0001 - External Movement (95.92 m2)**

No Asbestos

B00W - R0002 - Library Office/Workroom (10.98 m2)

No Asbestos

B00W - R0003 - No Access (0.53 m2)

No Asbestos

B00W - R0004 - Staff - Toilet (3.46 m2)

No Asbestos

B00W - R0005 - No Access (1.97 m2)

No Asbestos

B00W - R0006 - Toilet - Lobby (2.23 m2)

No Asbestos

B00W - R0007 - K.L.A. Store (15.02 m2)

No Asbestos

B00W - R0008 - Reading Area (200.04 m2)

No Asbestos

B00W - R0009 - Library Office/Workroom (26.47 m2)

No Asbestos

B00W - R0010 - Communications Room (9.89 m2)

No Asbestos

B00W - R0011 - Seminar/Study (16.73 m2)

No Asbestos

B00W - R0012 - Seminar/Study (10.76 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00X - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00X - R0001 - No Access (105.87 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Y - Technological & Applied Studies - 2012 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00Y - R0001 - External Movement (47.54 m2)**

No Asbestos

B00Y - R0002 - Materials Store - Type 1 (15.21 m2)

No Asbestos

B00Y - R0003 - Kitchen - Type 2 (95.21 m2)

No Asbestos

B00Y - R0004 - Preparation - Materials (18.61 m2)

No Asbestos

B00Y - R0005 - Pantry (7.15 m2)

No Asbestos

B00Y - R0006 - Distribution Board Cupboard (0.86 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00Y - R0007 - Plant (9.44 m2)

No Asbestos

B00Y - R0008 - Plant (1.26 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0DD - Pupil Facilities - 2007 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor void	No Asbestos Found

Interior**B0DD - R0001 - Toilets - Boys (22.88 m2)**

No Asbestos

B0DD - R0002 - Toilets - Girls (30.11 m2)

No Asbestos

B0DD - R0003 - General Assistants (16.9 m2)

No Asbestos

B0DD - R0004 - External Movement (36.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0NN - General Learning Unit - 2005 - Brick/Veneer (Brick/Veneer)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B0NN - R0001 - General Learning Space (59.77 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0002 - Shared Learning Space (75.07 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0003 - Practical Activity Area (24.36 m2)						
No Asbestos						
B0NN - R0004 - General Learning Space (64.66 m2)						
No Asbestos						
B0NN - R0005 - Store (19.73 m2)						
No Asbestos						
B0NN - R0006 - Cleaning Store - Distributed (2.76 m2)						
No Asbestos						
B0NN - R0007 - Distribution Board (1.05 m2)						
No Asbestos					Note: No inspection of live electrical installation.	
B0NN - R0008 - Toilets-Girls (11.95 m2)						
No Asbestos						
B0NN - R0009 - Toilets-Boys (9.16 m2)						
No Asbestos						
B0NN - R0010 - General Learning Space (59.44 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0011 - General Learning Space (59.85 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0012 - General Learning Space (59.86 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0013 - Seminar (24.72 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0014 - General Learning Space (59.52 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0015 - Store (20.96 m2)						
No Asbestos						
B0NN - R0016 - Distribution Board Cupboard (0.78 m2)						
No Asbestos					Note: No inspection of live electrical installation.	
B0NN - R0017 - Movement (71.11 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B0NN - R0018 - External Movement (25.74 m2)						
No Asbestos						
B0NN - R0019 - External Movement (3.37 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning Unit - 2006 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B000 - R0001 - General Learning Space (59.54 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0002 - Shared Learning Space (50.37 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0003 - General Learning Space (64.33 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0004 - Practical Activity Area (15.98 m2)

No Asbestos

B000 - R0005 - Cleaning Store - Distributed (3.04 m2)

No Asbestos

B000 - R0006 - Distribution Board (0.56 m2)

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0007 - Store (25.52 m2)

No Asbestos

B000 - R0008 - General Learning Space (59.62 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0009 - General Learning Space (60.28 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0010 - General Learning Space (59.1 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0011 - Seminar (25.58 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0012 - Distribution Board (0.52 m2)

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0013 - Movement (46.55 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B000 - R0014 - External Movement (50.54 m2)

No Asbestos

B000 - R0015 - External Movement (2.75 m2)

No Asbestos

B000 - R0016 - Movement (1.88 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0PP - Science Learning Unit - 2006 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B0PP - R0001 - General Learning Space (60.18 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B0PP - R0002 - General Learning Space (60.35 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B0PP - R0003 - Chemical Store (13.11 m2)

No Asbestos

B0PP - R0004 - Cleaning Store - Distributed (3.84 m2)

No Asbestos

B0PP - R0005 - Store (15.02 m2)

No Asbestos

B0PP - R0006 - Apparatus Storage (22.59 m2)

No Asbestos

B0PP - R0007 - General Learning Space (46.04 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B0PP - R0008 - Laboratory L.S. (75.02 m2)

No Asbestos

B0PP - R0009 - Preparation - Science (49.75 m2)

No Asbestos

B0PP - R0010 - Laboratory L.S. (100.28 m2)

No Asbestos

B0PP - R0011 - External Movement (109.32 m2)

No Asbestos

B0PP - R0012 - Distribution Board (0.38 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0QQ - Agriculture - 2005 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0QQ - R0001 - Store (23.73 m2)

No Asbestos

B0QQ - R0002 - Plant Space (9.81 m2)

No Asbestos

B0QQ - R0003 - Agriculture Covered Area (32.19 m2)

No Asbestos

B0QQ - R0004 - Shed Workshop (35.06 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0RR - Art - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0RR - R0001 - Dark Room (28.42 m2)

No Asbestos

B0RR - R0002 - Materials Store (35.24 m2)

No Asbestos

B0RR - R0003 - External Movement (65.69 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

NS 270 - D13186 - Metal Technics/Heat Area/Storage : Placement Date - 11/02/2008

Exterior

No Asbestos Found.

Interior

R1 - Materials Technology L.S.

No Asbestos Found.

R2 - Store

No Asbestos Found.

R3 - Entry

No Asbestos Found.

OS 780 - D16837 - Woodwork/Metalwork/Heat Area/Store : Placement Date - 6/02/1997

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

Interior

R1 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

R2 - Materials Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	91 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1402_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017