


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bundanoon Public School (1414)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Wingecarribee

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : Grencap-NAA : 02 - Aug - 2016

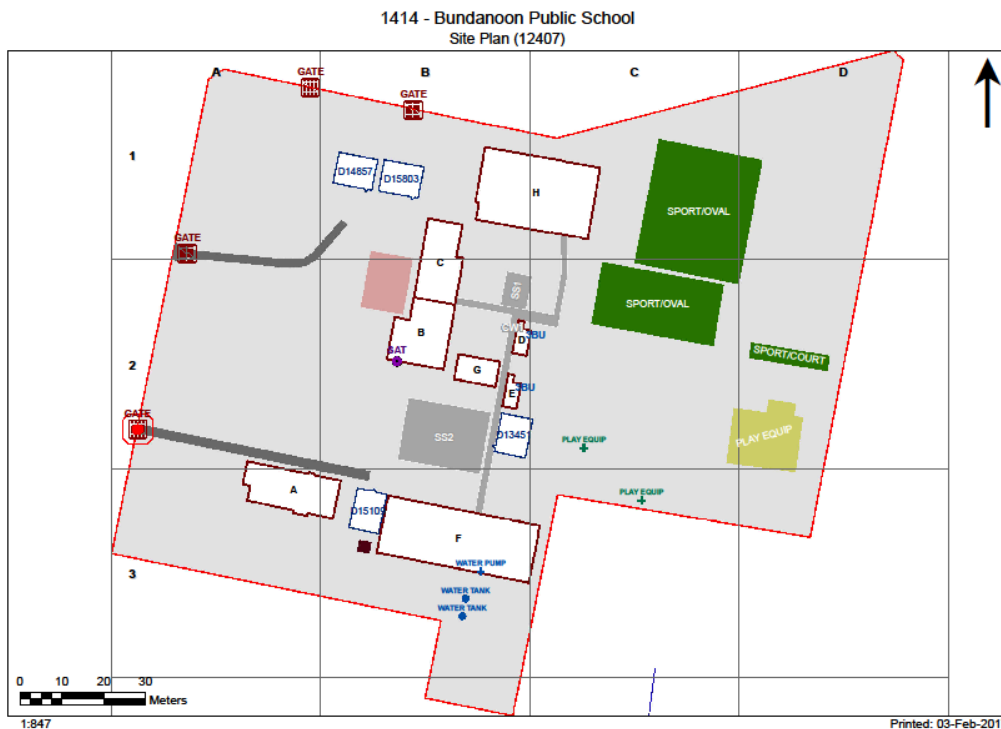

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1935 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	32m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	22m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/Eaves Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00A - R0005 - General Storeroom**

No Asbestos

B00A - R0007 - Interview

No Asbestos

B00A - R0008 - Sick Bay

No Asbestos

B00A - R0009 - Principal

No Asbestos

B00A - R0010 - Clerical Office

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - Duplicating Workroom

No Asbestos

B00A - R0014 - Clerical Office/Workroom

No Asbestos

B00A - R0017 - Staff Kitchen

No Asbestos

B00A - R0018 - Staff Room

No Asbestos

B00A - R0019 - Movement

No Asbestos

B00A - R0020 - External Movement

No Asbestos

B00A - R0021 - Staff Toilet

No Asbestos

B00A - R0022 - Staff Toilet

No Asbestos

B00A - R0023 - Staff Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1909 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
In-fill-panel	Flat AC Sheeting	2m2	South, Around door	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00B/In-fill-panel/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00B/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Library Office/Workroom

No Asbestos

B00B - R0005 - K.L.A. Store

No Asbestos

B00B - R0006 - General Storeroom

No Asbestos

B00B - R0007 - Movement

No Asbestos

B00B - R0008 - Personal Effects Storage

No Asbestos

B00B - R0009 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	22m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/Eaves Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00C - R0001 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	4m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00C/R0004/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		

B00C - R0002 - Personal Effects Storage

Wall Linings Internal	Flat AC Sheeting	5m2	Near stairs	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/R0001/Wall Linings Internal/S1			Chrysotile (white asbestos)		

B00C - R0003 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/R0001/Wall Linings Internal/S1			Chrysotile (white asbestos)		

B00C - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	4m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00C/R0004/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		

B00C - R0005 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00C/R0005/Ceiling Structures/Linings/S4			Chrysotile (white asbestos)		

B00C - R0006 - Movement

No Asbestos

B00C - R0007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1935 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/Eaves Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00D - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
	<i>Asbestos removed, remediation work completed - 8/04/2015</i>					
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/R0001/Wall Linings Internal/S1			Chrysotile (white asbestos)		
	<i>Asbestos removed, remediation work completed - 8/04/2015</i>					

B00D - R0002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1935 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/Eaves Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00E - R0001 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/R0001/Wall Linings Internal/S1			Chrysotile (white asbestos)		
	<i>Asbestos removed, remediation work completed - 8/04/2015</i>					
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
	<i>Asbestos removed, remediation work completed - 8/04/2015</i>					

B00E - R0002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - General Learning - 1950 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					
	1414/B00F/R0001/Ceiling Structures/Linings/S8					No Asbestos Detected

Interior**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	1414/B00F/R0001/Ceiling Structures/Linings/S8					No Asbestos Detected

B00F - R0002 - Practical Activities - 1hb

No Asbestos

B00F - R0003 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0004 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	1414/B00F/R0001/Ceiling Structures/Linings/S8					No Asbestos Detected

B00F - R0006 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	1414/B00F/R0001/Ceiling Structures/Linings/S8					No Asbestos Detected

B00F - R0008 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0009 - Practical Activities - 1hb

No Asbestos

B00F - R0010 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0011 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	1414/B00F/R0001/Ceiling Structures/Linings/S8					No Asbestos Detected

B00F - R0013 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0014 - Practical Activities - 1hb

No Asbestos

B00F - R0015 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0016 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	1414/B00F/R0001/Ceiling Structures/Linings/S8					No Asbestos Detected

B00F - R0017 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0018 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0019 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 2005 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1414/B00A/Eaves Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00G - R0001 - Sports Store

No Asbestos

B00G - R0002 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Communal Space

No Asbestos

B00H - R0002 - Raised Platform

No Asbestos

B00H - R0003 - Hall Chair Store

No Asbestos

B00H - R0004 - Communal/Performance Store

No Asbestos

B00H - R0005 - P.E. Store

No Asbestos

B00H - R0006 - Toilet - Lobby

No Asbestos

B00H - R0007 - Toilets - Girls

No Asbestos

B00H - R0008 - Sound Cupboard

No Asbestos

B00H - R0009 - Toilet - Lobby

No Asbestos

B00H - R0010 - Toilets - Boys

No Asbestos

B00H - R0011 - Cleaning Distributed Store

No Asbestos

B00H - R0012 - Plant

No Asbestos

B00H - R0013 - Main Switch Board

No Asbestos

B00H - R0014 - Access Shower/Toilet/Change

No Asbestos

B00H - R0015 - Covered Outdoor Learning Area

No Asbestos

B00H - R0016 - Movement

No Asbestos

B00H - R0017 - Movement

No Asbestos

B00H - R0018 - Ramp

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D13451 - Learning Unit - Standard/Withdrawal : Placement Date - 2/04/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D14857 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 27/11/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

NS 300 - D15109 - FSU /Bulk Store/Toilet : Placement Date - 17/05/2004

Exterior

No Asbestos Found.

Interior

R1 - Canteen

No Asbestos Found.

R2 - Bulk Store

No Asbestos Found.

R3 - Cleaning Supplies

No Asbestos Found.

R4 - Toilets-Boys/Girls

No Asbestos Found.

OS 602 - D15803 - Learning Unit - Standard With P.A.A. : Placement Date - 13/01/2012

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017