


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bungwahl Public School (1424)  
**Region :** North Coast  
**State Electorate :** Myall Lakes  
**Local Government Area :** Great Lakes

**Initial Survey :** Noel Arnold & Associates : 16 - Apr - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

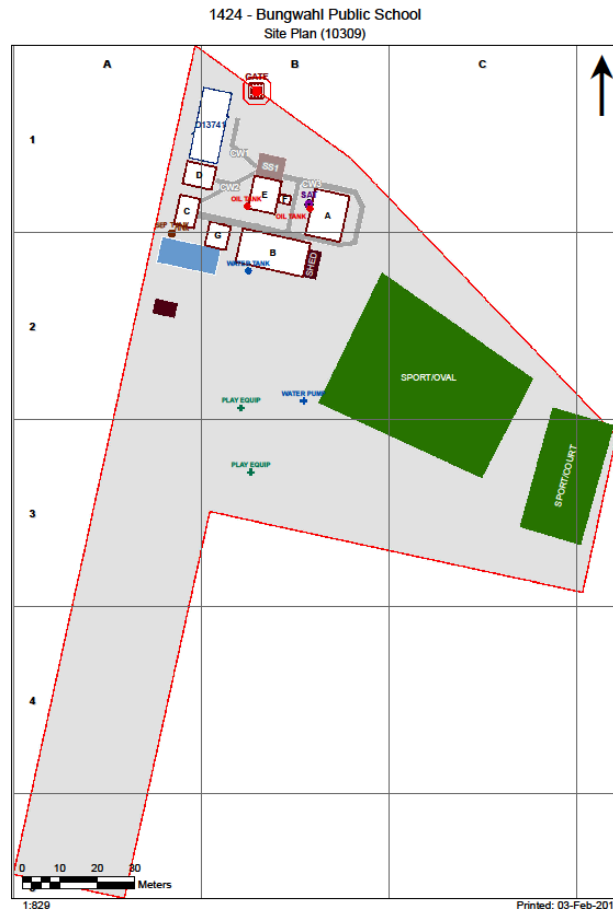

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1916 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00A/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
Ceiling Void	Non Accessible Area - No Access - Manhole 4m high in middle of room with wires interfering with access					
Underfloor Void	No Asbestos Found					

**Interior****B00A - R0001 - Practical Activities - 1hb**

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00A/R0001/Wall Linings Internal/S7					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00A/R0001/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00A - R0002 - Home Base**

Chalk board	Flat AC Sheeting	6m2	East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00A/R0002/Chalk Board/S6					<b>Chrysotile (white asbestos)</b>

**B00A - R0005 - Reading Area**

Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00A/R0001/Wall Linings Internal/S7					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00A/R0001/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>

**B00A - R0006 - Practical Activities**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1424/B00A/R0006/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1992 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00B - R0001 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Staff Facilities - 1970 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00C/Eaves Linings/S10					<b>Chrysotile (white asbestos)</b>

**Interior****B00C - R0001 - External Movement**

No Asbestos

**B00C - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00C/R0005/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00C - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00C/R0005/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North, Middle portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Encapsulated material within unit</b>					

**B00C - R0004 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00C/R0005/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00C/R0005/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities/Administration - 1950 - Timber (Timber)**

**Exterior**

Wall Cladding	Flat AC Sheeting 1424/B00B/Wall Cladding/S2					<b>No Asbestos Detected</b>
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

**Interior**

**B00D - R0001 - Canteen**

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00B/Room+1/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00D - R0002 - Canteen Office/Store**

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00B/Room+1/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00D - R0003 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00B/Room+1/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1912 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00E/Eaves Linings/S11					<b>Chrysotile (white asbestos)</b>
Ceiling Void	Non Accessible Area - No Access - No Manhole in Building					
Underfloor Void	No Asbestos Found					

**Interior****B00E - R0001 - Practical Activities - 1hb**

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00E/R0001/Wall Linings Internal/S4					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00E/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>

**B00E - R0002 - Home Base**

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00E/R0002/Wall Linings Internal/S5					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1424/B00E/R0001/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Communal Facilities - 1980 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Void      No Asbestos Found

**Interior**

**B00F - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00G - R0001 - Canteen**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 503 - D13741 - Admin Lib Staff/Principal/Clerk/Store : Placement Date - 18/12/2006

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2

### Interior

#### R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				24 m2

#### R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

#### R3 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

#### R4 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

#### R5 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
---------	---------------	------------------	--	--	--	-------

#### R6 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
---------	---------------	------------------	--	--	--	------

#### R7 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2
---------	---------------	------------------	--	--	--	-------

#### R8 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				6 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017