


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Bunnaloo Public School (1425)  
**Region :** Riverina  
**State Electorate :** Murray  
**Local Government Area :** Murray

**Initial Survey :** Noel Arnold & Associates : 12 - May - 2008  
**Reviewed By :** Greencap-NAA : 07 - Jul - 2016

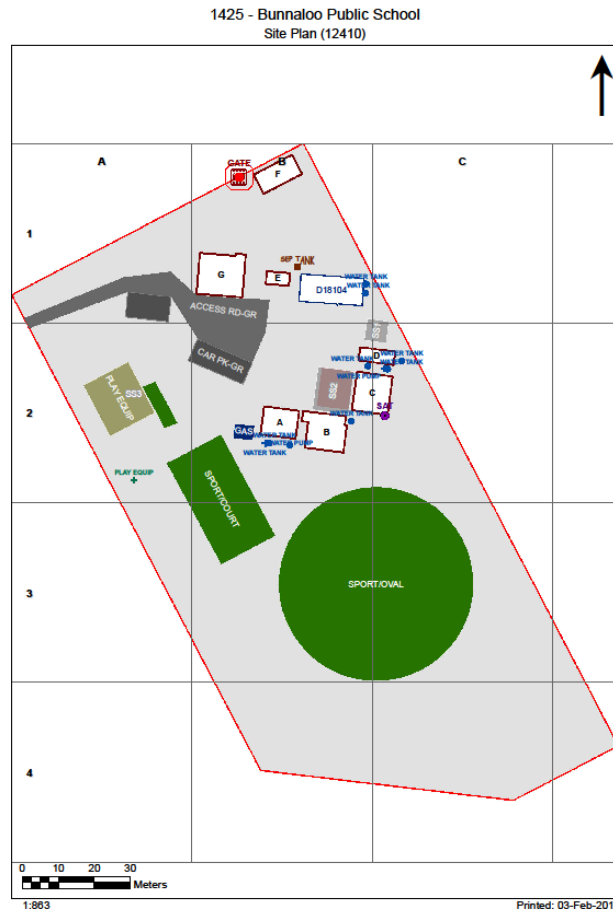

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Library - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

**Interior**

**B00A - R0001 - Movement**

Floor Coverings Res/Textile	Compressed AC Sheet					
	1425/B00C/R0004/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00A - R0002 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00A/R0002/Wall Linings Internal/S5					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**B00A - R0003 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Staff Facilities - 1950 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00B/R0005/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00B/R0005/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00B/R0005/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					

Floor Coverings Res/Textile	Compressed AC Sheet					
	1425/B00C/R0004/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>	

**B00B - R0002 - Home Base**

Wall Linings Internal	Flat AC Sheeting	2m2	South west corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00A/R0002/Wall Linings Internal/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00B - R0003 - General Storeroom**

No Asbestos

**B00B - R0004 - Practical Activities - 1hb**

No Asbestos

**B00B - R0005 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00B/R0005/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

**B00B - R0006 - Drinking Facilities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1950 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00B/R0005/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting	3m2	South east corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00C/R0001/Wall Linings Internal/S6					<b>Chrysotile (white asbestos)</b>

**B00C - R0002 - General Storeroom**

No Asbestos

**B00C - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00C - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00B/R0005/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Electrical Cupboard Lining	Millboard	1m2	East facing	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	1425/B00C/R0004/Electrical switchboard lining/S2					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Compressed AC Sheet					
	1425/B00C/R0004/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Shed - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00D/Eaves Linings/S7				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Shelter**

No Asbestos

**B00D - R0002 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1970 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00E/R0004/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**Interior****B00E - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00E/R0004/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00E - R0002 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00E/R0004/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00E - R0003 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00E/R0004/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00E - R0004 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1425/B00E/R0004/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Other - 2007 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Sports Store**

No Asbestos

**B00F - R0002 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Distribution Board** Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0002 - Communications Room**

No Asbestos

**B00G - R0003 - K.L.A. Store**

No Asbestos

**B00G - R0004 - Library Office/Workroom**

No Asbestos

**B00G - R0005 - Reading Area**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 500 - D18104 - Admin - Library : Placement Date - 26/10/2001

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		20.16 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		13 m2

#### R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2
---------	---------------	------------------	--	-------

#### R3 - Staff Room/Kitchen

Ceiling	Flat AC Sheet	Assumed Asbestos		19 m2
---------	---------------	------------------	--	-------

#### R4 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2
---------	---------------	------------------	--	-------

#### R5 - Library

Ceiling	Flat AC Sheet	Assumed Asbestos		54 m2
---------	---------------	------------------	--	-------

#### R6 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos		0 m2
---------	---------------	------------------	--	------

#### R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2

#### R8 - Entry to toilet

Ceiling	Flat AC Sheet	Assumed Asbestos		0 m2
---------	---------------	------------------	--	------

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017