


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Burrawang Public School (1445)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Wingecarribee

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Grencap-NAA : 16 - Jun - 2015

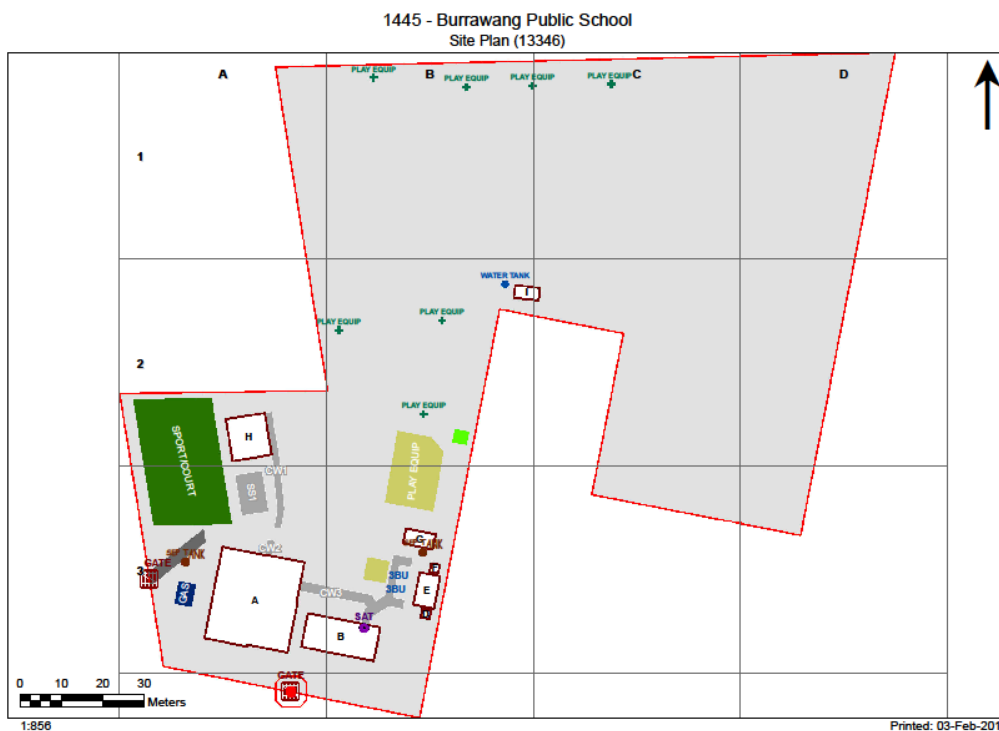

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning/Administration - 1992 - Brick/Veneer (Brick/Veneer)**Exterior**

In-fill-panel	Flat AC Sheeting 1445/B00A/In-fill-panel/S7					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1445/B00A/Eaves Linings/S4	70m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 1445/B00A/Gable Verge Lining/S5	45m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible					
Infil Panels	Putty 1445/B00A/Infil Panels/S6					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior**B00A - R0001 - Entry Vestibule**

Ceiling Structures/Linings	Flat AC Sheeting 1445/B00A/R0001/Ceiling Structures/Linings/S8	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00A - R0002 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles 1445/B00A/R0003/Floor Coverings Res/Textile/S3	14.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	---------	------------	--------------------	---------	--

B00A - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 1445/B00A/R0003/Floor Coverings Res/Textile/S3	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00A - R0004 - Principal

Floor Coverings Res/Textile	Vinyl Tiles 1445/B00A/R0003/Floor Coverings Res/Textile/S3	13.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	---------	------------	--------------------	---------	--

B00A - R0005 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles 1445/B00A/R0003/Floor Coverings Res/Textile/S3	4.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00A - R0008 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles 1445/B00A/R0003/Floor Coverings Res/Textile/S3	15.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00A - R0009 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 1445/B00A/R0003/Floor Coverings Res/Textile/S3	16.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	---------	------------	--------------------	---------	--

B00A - R0010 - Distribution Board Cupboard

Ceiling Structures/Linings	Flat AC Sheeting 1445/B00A/R0010/Ceiling Structures/Linings/S9	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 1445/B00A/R0010/Wall Linings Internal/S10	8m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	0.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard**B00A - R0014 - Practical Activities**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	1445/B00A/R0015/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00A - R0015 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles					
	1445/B00A/R0015/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00A - R0016 - Home Base						
No Asbestos						
B00A - R0017 - Home Base						
No Asbestos						
B00A - R0021 - Covered Outdoor Learning Area						
No Asbestos						
B00A - R0022 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1445/B00A/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting					
	1445/B00A/In-fill-panel/S7					No Asbestos Detected
B00A - R0023 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1445/B00A/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting					
	1445/B00A/In-fill-panel/S7					No Asbestos Detected
B00A - R0024 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1445/B00A/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting					
	1445/B00A/In-fill-panel/S7					No Asbestos Detected
B00A - R0025 - Toilet - Lobby						
No Asbestos						
B00A - R0026 - Staff Toilet						
No Asbestos						
B00A - R0027 - Toilet - Lobby						
No Asbestos						
B00A - R0028 - Staff Toilet						
No Asbestos						
B00A - R0031 - Entry Vestibule						
No Asbestos						
B00A - R0032 - General Storeroom						
No Asbestos						
B00A - R0033 - General Storeroom						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1971 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting 1445/B00B/Wall Cladding/S1					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Height Restriction					

Interior**B00B - R0001 - Movement**

Wall Linings Internal	Flat AC Sheeting 1445/B00B/Wall Cladding/S1					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00B - R0002 - Reading Area

No Asbestos

B00B - R0003 - General Storeroom

Electrical Backing Board	Resinous Board	0.25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1445/B00B/R0003/Electrical Backing Board/S11						Chrysotile (white asbestos)

B00B - R0004 - Library Office/Workroom

No Asbestos

B00B - R0005 - Resource/Toy Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 1971 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground

Ceiling Voids - Flat Roof

Interior

B00D - R0001 - Cleaning Supplies

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1971 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1445/B00A/Eaves Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Ceiling Voids - Flat Roof

Underfloor Voids - Slab on Ground

Interior

B00E - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1445/B00A/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	

B00E - R0002 - Cleaning Distributed Store

No Asbestos

B00E - R0003 - Staff Toilet

No Asbestos

B00E - R0004 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Administration - 1971 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof

Underfloor Voids - Slab on Ground

Interior

B00F - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2009 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00H - R0001 - Staff Kitchen

No Asbestos

B00H - R0002 - General Storeroom

No Asbestos

B00H - R0003 - Home Base

No Asbestos

B00H - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Special Purpose - 1991 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling

Underfloor Voids - Slab on Ground

Interior

B001 - R0001 - Store

No Asbestos

B001 - R0002 - Growing/Breeding

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017