


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Burren Junction Public School (1447)
Region : New England
State Electorate : Barwon
Local Government Area : Walgett

Initial Survey : Noel Arnold & Associates : 15 - May - 2008
Reviewed By : Grencap-NAA : 04 - May - 2016

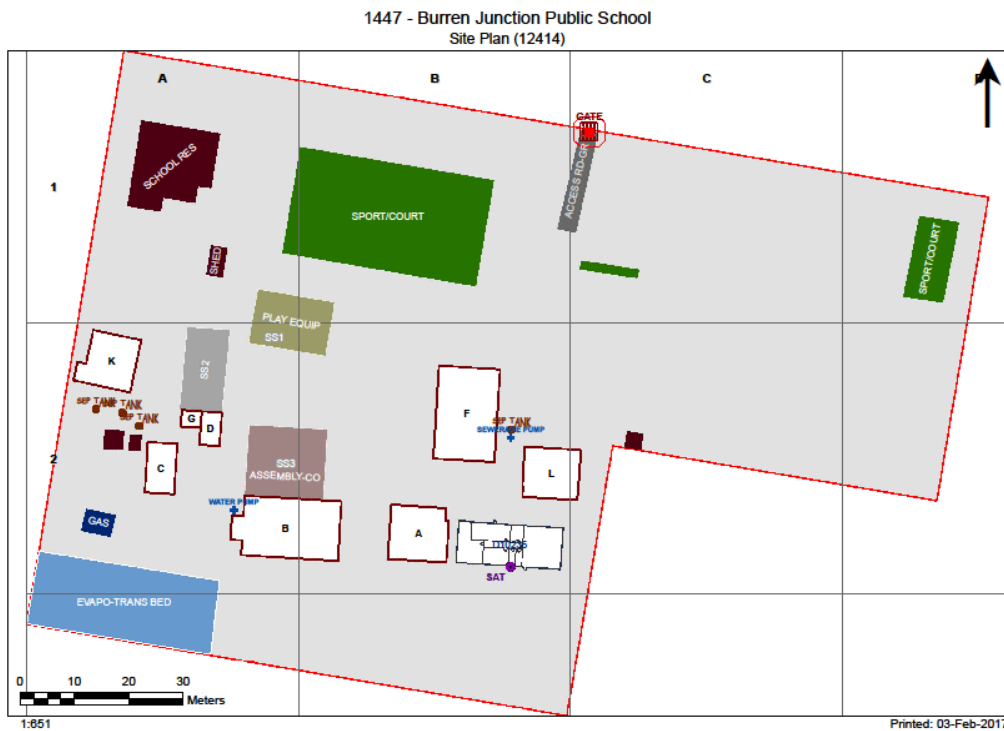

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1970 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	18m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00A/Eaves Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00A/R0001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0002 - Home Base

window putty	Putty					
	1447/B00A/R0002/window putty/S8				No Asbestos Detected	

B00A - R0003 - Principal

No Asbestos

B00A - R0004 - Duplicating Workroom

No Asbestos

B00A - R0005 - Clerical Office/Workroom

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00A/R0001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00A/R0005/Wall Linings Internal/S2				Chrysotile (White asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Other-D.E.C. Admin - 1975 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1447/B00B/Eaves Linings/S9					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 1447/B00B/In-fill-panel/S10					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - no access					
Ceiling Voids - Raked Ceiling	Non Accessible Area - height - 4 meters					

Interior

B00B - R0001 - Canteen

Floor Coverings Res/Textile	Flat AC Sheeting 1447/B00B/R0001/Floor Coverings Res/Textile/S11					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

B00B - R0002 - Home Base

In-fill-panel	Flat AC Sheeting 1447/B00B/In-fill-panel/S10					No Asbestos Detected
---------------	---	--	--	--	--	----------------------

B00B - R0003 - Other - Regional Use

In-fill-panel	Flat AC Sheeting 1447/B00B/In-fill-panel/S10					No Asbestos Detected
---------------	---	--	--	--	--	----------------------

B00B - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet 1447/B00B/R0001/Floor Coverings Res/Textile/S11					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00B - R0005 - Craft Store

Floor Coverings Res/Textile	Vinyl Tiles 1447/B00B/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected
-----------------------------	---	--	--	--	--	----------------------

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Movement

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
1447/B00B/R0007/Electrical Backing Board/S12						Chrysotile (white asbestos)

B00B - R0008 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Pupil Facilities/Staff Facilities - 1956 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00C/Eaves Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00C - R0001 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	1.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00C/R0004/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00C/R0004/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	1.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00C/R0004/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00C/R0004/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00C/R0004/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1975 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00D - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Staff Facilities - 1911 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	18m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/Eaves Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eaves Linings	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/Eaves Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/R0001/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	2m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/R0001/In-fill-panel/S17				Chrysotile (white asbestos)	

B00F - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	77.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/R0002/Floor Coverings Res/Textile/S18				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive				No Asbestos Detected	
	1447/B00F/R0002/Floor Coverings Res/Textile/S19					

B00F - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/R0003/Floor Coverings Res/Textile/S1				Chrysotile (White asbestos)	

B00F - R0004 - Toilets - Boys/Girls

No Asbestos

B00F - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/R0003/Floor Coverings Res/Textile/S1				Chrysotile (White asbestos)	

B00F - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	12.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/R0006/Floor Coverings Res/Textile/S20				Chrysotile (white asbestos)	

B00F - R0007 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1447/B00F/R0006/Floor Coverings Res/Textile/S20				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pre-School Facilities - 1975 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1447/B00G/Eaves Linings/S21					No Asbestos Detected
Ceiling Voids - Flat Roof	Non Accessible Area - non accessible area					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00G - R0001 - Other-Non Government Pre-Sch

Ceiling Structures/Linings	Flat AC Sheeting 1447/B00G/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00G - R0002 - Other-Non Government Pre-Sch

Ceiling Structures/Linings	Flat AC Sheeting 1447/B00G/R0001/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pre-School Facilities - 2000 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1447/B00K/Eaves Linings/S23					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 1447/B00K/Wall Cladding/S24					No Asbestos Detected

Interior

B00K - R0001 - Home Base - Pre

No Asbestos

B00K - R0002 - Kitchen - Pre

No Asbestos

B00K - R0003 - Toilets - Boys/Girls

No Asbestos

B00K - R0004 - Toilets - Boys/Girls

No Asbestos

B00K - R0005 - Access Shower/Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00L - R0001 - Reading Area

No Asbestos

B00L - R0002 - K.L.A. Store

No Asbestos

B00L - R0003 - Practical Activities

No Asbestos

B00L - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 503 - D10236 - Admin Lib Staff/Principal/Clerk/Store : Placement Date - 26/05/1999

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Clerical Office

No Asbestos Found.

R2 - Principal

No Asbestos Found.

R3 - Staff Toilet

No Asbestos Found.

R4 - Staff Toilet

No Asbestos Found.

R5 - Reading Area

No Asbestos Found.

R6 - Security Store

No Asbestos Found.

R7 - Staff Room

No Asbestos Found.

R8 - Entry

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017