


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Burrumbuttock Public School (1453)
Region : Riverina
State Electorate : Albury
Local Government Area : Greater Hume

Initial Survey : Noel Arnold & Associates : 23 - Feb - 2008
Reviewed By : Parsons Brinckerhoff : 12 - Jul - 2016

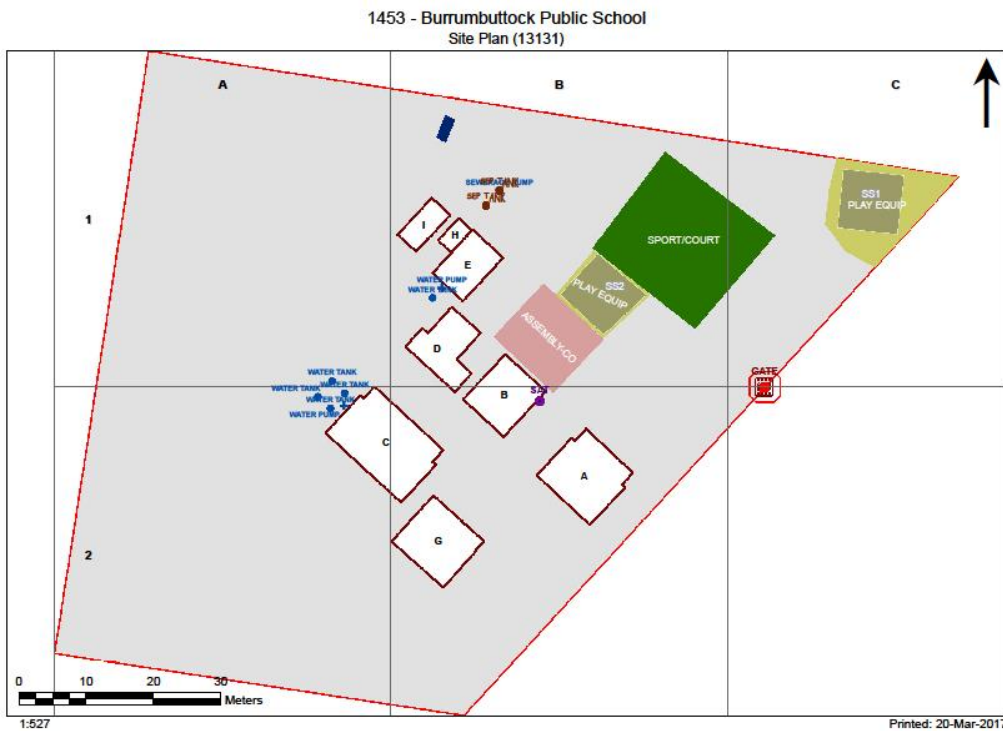

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1928 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1453/B00A/Eaves Linings/S4					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00A - R0001 - Clerical Office

No Asbestos

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - K.L.A. Store

No Asbestos

B00A - R0004 - Home Base

Wall lining behind heater	Flat AC Sheeting	2m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00B/R0003/Wall lining behind heater/S10					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Staff Facilities - 1953 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 1453/B00B/Eaves Linings/S5					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00B - R0001 - Staff Room

No Asbestos

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1453/B00B/R0002/Ceiling Structures/Linings/S8					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00B - R0003 - Reading Area

Wall lining behind heater	Flat AC Sheeting 1453/B00B/R0003/Wall lining behind heater/S10	2m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------------------	---	-----	------------------------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1958 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	4m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00C/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Access ramp	Compressed AC Sheet				No Asbestos Detected	
	1453/B00C/Access ramp/S3					
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00C/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Fascia panel	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00C/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00C/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Shed - 1962 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting 1453/B00D/Wall Cladding/S2					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00D - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 1453/B00D/Wall Cladding/S2					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00D - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1964 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable verge lining	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00E/Gable verge lining/S7				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00E/Eaves Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	No Asbestos Found					

Interior**B00E - R0001 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00E/R0003/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00E - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00E/R0003/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00E - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00E/R0003/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	West wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					

B00E - R0004 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00E/R0003/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00E - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1453/B00E/R0003/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00G - R0001 - Home Base

No Asbestos

B00G - R0002 - Home Base Store

No Asbestos

B00G - R0003 - Practical Activities

No Asbestos

B00G - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017