


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Brisbane Public School (1498)  
**Region :** Hunter/Central Coast  
**State Electorate :** Terrigal  
**Local Government Area :** Gosford

**Initial Survey :** Noel Arnold & Associates : 20 - Mar - 2008  
**Reviewed By :** AECOM : 29 - Jun - 2016

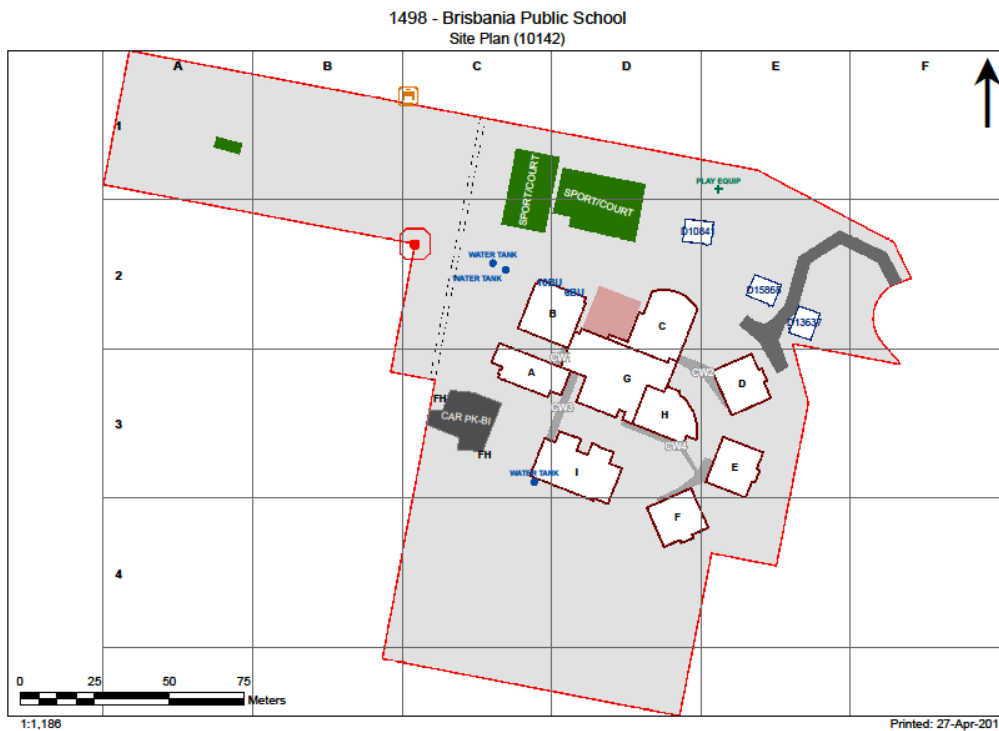

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1987 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, slab to ground / no access points.					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no manhole / no access points.					
Eaves Linings	Flat AC Sheeting 1498/B00B/Eaves Linings/S21	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**Interior****B00A - R0001 - Security Store (3.74 m2)**

Ceiling Structures/Linings	Vermiculite 1498/B00A/R0004/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	--

**B00A - R0002 - Main Switch Board (0.78 m2)**

Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard</b>
---------------------------	----------------	-------	--------------	--------------------	---------	---

**B00A - R0003 - Staff Toilet (6.58 m2)**

Incinerette	Millboard	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Electrical Hazard</b>
-------------	-----------	----------	--------------	----------------------	---------	---

**B00A - R0004 - Staff Room Annexe (26.59 m2)**

Ceiling Structures/Linings	Vermiculite 1498/B00A/R0004/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	--

**B00A - R0005 - General Storeroom (9.26 m2)**

Ceiling Structures/Linings	Vermiculite 1498/B00A/R0004/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	--

**B00A - R0006 - Staff Room (67.22 m2)**

Ceiling Structures/Linings	Vermiculite 1498/B00A/R0004/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	--

**B00A - R0007 - Staff Toilet (3.29 m2)**

Ceiling Structures/Linings	Vermiculite 1498/B00A/R0004/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	--

**B00A - R0008 - Staff Toilet (3.59 m2)**

Ceiling Structures/Linings	Vermiculite 1498/B00A/R0004/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	--

**B00A - R0009 - Security Store (3.74 m2)**

No Asbestos

**B00A - R0010 - Garden Store (7.76 m2)**

No Asbestos

**B00A - R0011 - Garden Store (7.35 m2)**

No Asbestos

**B00A - R0012 - General Storeroom (3.53 m2)**

Ceiling Structures/Linings	Vermiculite 1498/B00A/R0004/Ceiling Structures/Linings/S18					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	--

**B00A - R0013 - Movement (53.56 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R1001 - Staff Toilet (6.18 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Staff Toilet (5.04 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Entry Vestibule (10.99 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1004 - Clerical Office (16.38 m2)</b>						
Front reception desk	Vinyl Sheet					
	1498/B00A/R1004/Front reception desk/S19				<b>No Asbestos Detected</b>	
<b>B00A - R1005 - Duplicating Workroom (7.5 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1006 - Clerical Office (15.72 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1007 - Sick Bay (14.2 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1008 - Deputy Principal (13.33 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1009 - Interview (11.84 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1010 - Movement (20.04 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1011 - Interview (12.88 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00A - R1012 - Cleaning Distributed Store (1.1 m2)</b>						
No Asbestos						
<b>B00A - R1013 - Distribution Board (0.52 m2)</b>						
					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting					
	1498/B00A/R1013/Wall Linings Internal/S16				<b>No Asbestos Detected</b>	
Fibre-cement sheet debris	Flat AC Sheeting	1m2	Lower portion	Poor Condition (4)	Low (1)	Low Priority (2-3)
	1498/B00A/R1013/Fibre-cement sheet debris/S17				<b>Chrysotile (white asbestos)</b>	
Electrical Mounting Board	Resinous Board					
	1498/B00C/R0010/Ceiling Structures/Linings/S1				<b>No Asbestos Detected</b>	
<b>B00A - R1014 - Movement (48.72 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1498/B00A/R1014/Ceiling Structures/Linings/S15				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no manhole / no access points.					
Eaves Linings	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1498/B00B/Eaves Linings/S21					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting					
	1498/B00B/Gable Verge Lining/S20					<b>No Asbestos Detected</b>

**Interior****B00B - R0001 - Cleaning Distributed Store (3.18 m2)**

No Asbestos

**B00B - R0002 - Home Base (89.48 m2)**

No Asbestos

**B00B - R0003 - Practical Activities - 1hb (18.6 m2)**

No Asbestos

**B00B - R0004 - Toilets - Boys/Girls (3.24 m2)**

No Asbestos

**B00B - R0005 - Home Base (89.8 m2)**

No Asbestos

**B00B - R0006 - Movement (42.5 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	1498/B00B/R0006/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0007 - Movement (33.03 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	1498/B00B/R0007/Ceiling Structures/Linings/S6					<b>No Asbestos Detected</b>

**B00B - R0008 - Practical Activities - 1hb (18.6 m2)**

No Asbestos

**B00B - R9001 - Toilets - Girls (27.18 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1498/B00B/R9008/Partition Walls (Cubicles)/S9					<b>Chrysotile (white asbestos)</b>

**B00B - R9002 - Cleaning Distributed Store (1.29 m2)**

No Asbestos

**B00B - R9003 - Movement (4.54 m2)**

No Asbestos

**B00B - R9004 - Movement (14.89 m2)**

No Asbestos

**B00B - R9005 - General Storeroom (19.16 m2)**

No Asbestos

**B00B - R9006 - Movement (28.15 m2)**

No Asbestos

**B00B - R9007 - General Storeroom (13.49 m2)**

No Asbestos

**B00B - R9008 - Toilets - Boys (32.5 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1498/B00B/R9008/Partition Walls (Cubicles)/S9					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - R9009 - General Storeroom (127.08 m2)**

Fibre-cement sheet debris	Flat AC Sheeting	2m2	Lower portion, Variable positions	Poor Condition (4)	Medium (2)	Low Priority (2-3)
1498/B00B/R9009/Fibre-cement sheet debris/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R9010 - Movement (4.36 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Communal Facilities/Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area  
- Area inaccessible, slab to ground / no access points.

Ceiling Voids - Flat Roof Non Accessible Area  
- Area inaccessible, no manhole / no access points.

**Interior****B00C - R0001 - Practical Activities - 1hb (39.91 m2)**

No Asbestos

**B00C - R0002 - Home Base Store (6.96 m2)**

No Asbestos

**B00C - R0003 - Home Base (59.37 m2)**

No Asbestos

**B00C - R0004 - Movement (16.47 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
1498/B00C/R0009/Ceiling Structures/Linings/S2 **No Asbestos Detected**

**B00C - R0005 - Withdrawal Space - 1hb (11.54 m2)**

No Asbestos

**B00C - R0006 - Home Base (59.37 m2)**

No Asbestos

**B00C - R0007 - Home Base Store (6.03 m2)**

No Asbestos

**B00C - R0008 - Uniform Shop (4.27 m2)**

No Asbestos

**B00C - R0009 - Movement (16.47 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
1498/B00C/R0009/Ceiling Structures/Linings/S2 **No Asbestos Detected**

**B00C - R0010 - Distribution Board (0.96 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite  
1498/B00C/R0010/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00C - R9001 - Canteen (26.23 m2)**

Wall Linings Internal Flat AC Sheeting  
1498/B00C/R9001/Wall Linings Internal/S5 **No Asbestos Detected**

**B00C - R9002 - Canteen Office/Store (4.87 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
1498/B00C/R9002/Ceiling Structures/Linings/S4 **No Asbestos Detected**

**B00C - R9003 - Canteen Office/Store (4.35 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
1498/B00C/R9002/Ceiling Structures/Linings/S4 **No Asbestos Detected**

**B00C - R9004 - Hall Chair Store (9.68 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
1498/B00C/R9002/Ceiling Structures/Linings/S4 **No Asbestos Detected**

**B00C - R9015 - External Movement (26.07 m2)**

No Asbestos

**B00C - R9016 - External Movement (3.31 m2)**

No Asbestos

**B00C - R9019 - Plant (0.59 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R9020 - Communal Space (96.95 m2)</b>						
No Asbestos						
<b>B00C - R9021 - Communal/Performance Store (8.83 m2)</b>						
No Asbestos						
<b>B00C - R9022 - Raised Platform (89.33 m2)</b>						
No Asbestos						
<b>B00C - R9023 - External Movement (14.43 m2)</b>						
No Asbestos						
<b>B00C - R9024 - External Movement (70.37 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1987 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no manhole / no access points.

**Interior****B00D - R0001 - Practical Activities - 1hb (40.91 m2)**

No Asbestos

**B00D - R0002 - Security Store (4.4 m2)**

No Asbestos

**B00D - R0003 - Home Base Store (6.19 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0004 - Home Base (59.38 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0005 - Movement (9.98 m2)**

No Asbestos

**B00D - R0006 - Withdrawal Space - 1hb (11.54 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0007 - Home Base (59.38 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0008 - Home Base Store (6.53 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0009 - Distribution Board (0.83 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite  
1498/B00D/R0009/Ceiling Structures/Linings/S10**Limited Samples Taken****Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works****B00D - R0010 - Toilets - Girls (10.86 m2)**Ceiling Structures/Linings Flat AC Sheeting  
1498/B00D/R0010/Ceiling Structures/Linings/S13**No Asbestos Detected****B00D - R0011 - Movement (9.98 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1987 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no manhole / no access points.

**Interior****B00E - R0001 - Toilets - Boys (10.86 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1498/B00E/R0001/Ceiling Structures/Linings/S14	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B00E - R0002 - Practical Activities - 1hb (41.09 m2)**

No Asbestos

**B00E - R0003 - Home Base Store (6.53 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00E - R0004 - Home Base (59.38 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00E - R0005 - Movement (9.98 m2)**

No Asbestos

**B00E - R0006 - Withdrawal Space - 1hb (11.54 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00E - R0007 - Movement (9.98 m2)**

No Asbestos

**B00E - R0008 - Home Base (59.38 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00E - R0009 - Home Base Store (6.19 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00E - R0010 - Security Store (4.4 m2)**

No Asbestos

**B00E - R0011 - Distribution Board (0.83 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 1498/B00D/R0009/Ceiling Structures/Linings/S10	<b>Limited Samples Taken</b>
----------------------------	---	------------------------------

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00F - General Learning - 1987 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids - Flat Roof Non Accessible Area  
- Area inaccessible, no manhole / no access points.

Underfloor Voids - Packing to Floor Joists No Asbestos Found

**Interior****B00F - R0001 - Practical Activities - 1hb (44.52 m2)**

No Asbestos

**B00F - R0002 - Home Base Store (7.56 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00F - R0003 - Home Base (59.37 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00F - R0004 - Movement (9.98 m2)**

No Asbestos

**B00F - R0005 - Withdrawal Space - 1hb (11.76 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00F - R0006 - Movement (9.98 m2)**

No Asbestos

**B00F - R0007 - Home Base (59.37 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00F - R0008 - Home Base Store (6.19 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00F - R0009 - Security Store (4.4 m2)**

No Asbestos

**B00F - R0010 - Distribution Board (0.83 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite  
1498/B00D/R0009/Ceiling Structures/Linings/S10

Limited Samples Taken

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00F - R0011 - Cleaning Distributed Store (3.84 m2)**

No Asbestos

**B00F - R0012 - Garden Store (5.04 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1987 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof Non Accessible Area  
- Area inaccessible, no manhole / no access points.

Underfloor Voids - Slab on Ground Non Accessible Area  
- Area inaccessible, slab to ground / no access points.

**Interior****B00G - M0001 - Music Store (5.78 m2)**

No Asbestos

**B00G - M0002 - Practical Activities - 1hb (40.91 m2)**

No Asbestos

**B00G - M0003 - Kiln Room (2.13 m2)**

No Asbestos

**B00G - M0004 - Home Base Store (4.51 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - M0005 - Home Base (62.57 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - M0006 - Movement (16.41 m2)**

Ceiling Structures/Linings Flat AC Sheeting  
1498/B00G/M0006/Ceiling Structures/Linings/S11 **No Asbestos Detected**

Wall panels under air-conditioning unit Flat AC Sheeting  
1498/B00G/M0006/Wall panels under air-conditioning unit/S12 **No Asbestos Detected**

**B00G - M0007 - Withdrawal Space - 1hb (11.86 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - M0008 - Movement (7.66 m2)**

No Asbestos

**B00G - M0009 - Home Base (62.57 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - M0010 - Home Base Store (6.42 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - M0011 - Distribution Board (0.66 m2)**

Note: No inspection of live electrical installation.

Electrical Mounting Board Resinous Board 1Unit East facing Good Condition (1) Low (1) Low Priority (2-3)

**Assumed Asbestos - Electrical Hazard**

**B00G - M0012 - Movement (63.58 m2)**

No Asbestos

**B00G - R0001 - Movement (238.92 m2)**

No Asbestos

**B00G - R0002 - Movement (14.31 m2)**

No Asbestos

**B00G - R0003 - Cleaning Distributed Store (4.24 m2)**

No Asbestos

**B00G - R0004 - Cleaning Distributed Store (4.1 m2)**

No Asbestos

**B00G - R9001 - P.E. Store (12.18 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting					
	1498/B00C/R0009/Ceiling Structures/Linings/S2					<b>No Asbestos Detected</b>
<b>B00G - R9002 - Toilets - Girls (15.6 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction, 3.84m</b>						
<b>B00G - R9003 - Disabled Toilet (3.95 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction, 3.84m</b>						
<b>B00G - R9004 - Toilets - Boys (14.12 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction, 3.84m</b>						
<b>B00G - R9005 - Main Switch Board (10.48 m2)</b>						
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B00G - R9006 - Movement (13.52 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Library - 1987 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof Non Accessible Area  
- Area inaccessible, no manhole / no access points.

Underfloor Voids - Slab on Ground Non Accessible Area  
- Area inaccessible, slab to ground / no access points.

**Interior****B00H - M0001 - Plant (39.72 m2)**

No Asbestos

**B00H - R0001 - Security Store (1.52 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00H - R0002 - Special Programs Room (31.39 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00H - R0003 - K.L.A. Store (14.43 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00H - R0004 - Library Office/Workroom (23.84 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00H - R0006 - Distribution Board (0.73 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite  
1498/B00D/R0009/Ceiling Structures/Linings/S10

**Limited Samples Taken**

***Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***

**B00H - R0007 - Reading Area (144.13 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00H - R0008 - Special Programs Room (36.17 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - General Learning/Building Services - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible, slab to ground / no access points.

Ceiling Voids      No Asbestos Found

**Interior****B00I - R0001 - Practical Activities - 1hb (15.67 m2)**

No Asbestos

**B00I - R0002 - Personal Effects Storage (2.99 m2)**

No Asbestos

**B00I - R0003 - Home Base Store (6.09 m2)**

No Asbestos

**B00I - R0004 - Home Base (60.28 m2)**

No Asbestos

**B00I - R0005 - Withdrawal Space - 2hb (11.64 m2)**

No Asbestos

**B00I - R0006 - Practical Activities - 1hb (14.28 m2)**

No Asbestos

**B00I - R0007 - Personal Effects Storage (4.74 m2)**

No Asbestos

**B00I - R0008 - Home Base Store (6.09 m2)**

No Asbestos

**B00I - R0009 - Home Base (60.46 m2)**

No Asbestos

**B00I - R0010 - Movement (5.51 m2)**

No Asbestos

**B00I - R0011 - Special Programs Store (5.45 m2)**

No Asbestos

**B00I - R0012 - Special Programs Room (31.51 m2)**

No Asbestos

**B00I - R0013 - Garden Store (12.47 m2)**

No Asbestos

**B00I - R0014 - General Assistant/Bulk Store (15.58 m2)**

No Asbestos

**B00I - R0015 - Sports Store (12.47 m2)**

No Asbestos

**B00I - R0016 - Distribution Board (0.55 m2)**

No Asbestos

Note: No inspection of live electrical installation.

**B00I - R0017 - External Movement (96.98 m2)**

No Asbestos

**B00I - R0018 - External Stairs (10.02 m2)**

No Asbestos

**B00I - R0019 - External Stairs (10.02 m2)**

No Asbestos

**B00I - R1001 - Practical Activities - 1hb (15.74 m2)**

No Asbestos

**B00I - R1002 - Personal Effects Storage (2.99 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B001 - R1003 - Home Base Store (6.13 m2)**

No Asbestos

**B001 - R1004 - Home Base (60.1 m2)**

No Asbestos

**B001 - R1005 - Withdrawal Space - 2hb (11.64 m2)**

No Asbestos

**B001 - R1006 - Practical Activities - 1hb (14.24 m2)**

No Asbestos

**B001 - R1007 - Personal Effects Storage (4.7 m2)**

No Asbestos

**B001 - R1008 - Home Base Store (6.12 m2)**

No Asbestos

**B001 - R1009 - Home Base (60.26 m2)**

No Asbestos

**B001 - R1010 - Distribution Board (0.6 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B001 - R1011 - External Movement (43.13 m2)**

No Asbestos

**B001 - R1012 - External Stairs (23.33 m2)**

No Asbestos

**B001 - R1013 - External Stairs (23.96 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10841 - Learning Unit - Standard With P.A.A. : Placement Date - 15/12/2016**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D13637 - Learning Unit - Standard With P.A.A. : Placement Date - 28/10/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D15868 - Learning Unit - Standard With P.A.A. : Placement Date - 14/01/2013**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017