


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Buronga Public School (1688)
Region : Western NSW
State Electorate : Murray
Local Government Area : Wentworth

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Nov - 2016

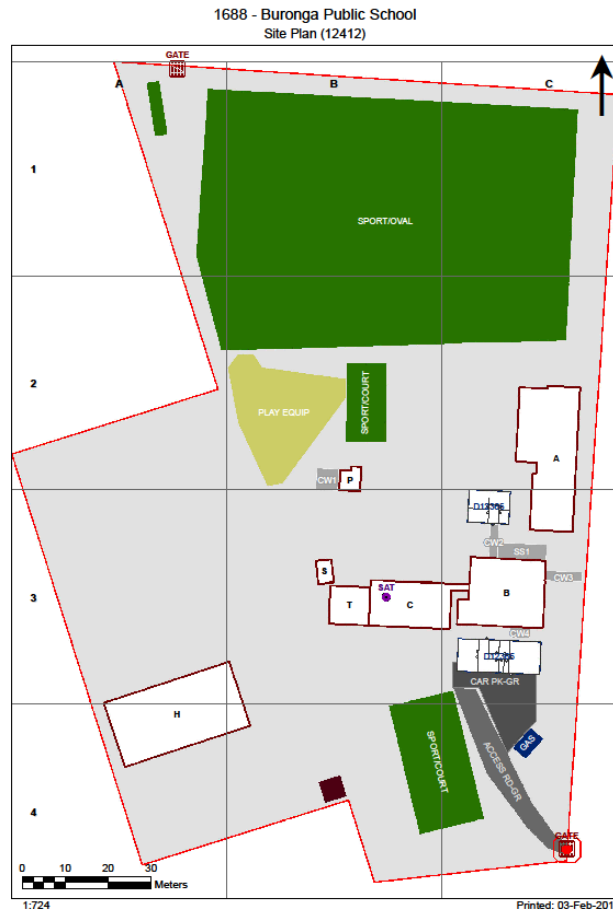

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1958 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00A/R0006/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00A/Eaves Linings/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	AC Fragments/Debris	1m2	Middle portion	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1688/B00A/Ceiling Void/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	Flat AC Sheeting	4m2	Middle portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	1688/B00A/Ceiling Void/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	1688/B00A/Underfloor Voids/S14			Chrysotile (white asbestos)		

Interior**B00A - R0001 - Toilets - Boys/Girls**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00A/R0006/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - General Storeroom

No Asbestos

B00A - R0005 - Staff Kitchen

Floor Coverings Res/Textile	Vinyl Sheet					
	1688/B00A/R0005/Floor Coverings Res/Textile/S2			No Asbestos Detected		

B00A - R0007 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00A/R0009/Ceiling Structures/Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00A/R0009/Ceiling Structures/Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00A/R0009/Ceiling Structures/Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - General Storeroom

No Asbestos

B00A - R0012 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - R0013 - Communal Space

No Asbestos

B00A - R0014 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1947 - Timber (Timber)**Exterior**

Ceiling Void	Flat AC Sheeting 1688/B00B/Ceiling Void/S13	200m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Movement**

No Asbestos

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - General Storeroom

No Asbestos

B00B - R0005 - Withdrawal Space - 1hb

No Asbestos

B00B - R0006 - External Movement

Floor Coverings Res/Textile	Compressed AC Sheet	10m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
1688/B00B/R0006/Floor Coverings Res/Textile/S3						

B00B - R0007 - General Storeroom

No Asbestos

B00B - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1958 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00A/R0006/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00C - R0001 - Staff Kitchen**

Floor Coverings Res/Textile	Vinyl Tiles					
	1688/B00C/R0003/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00C - R0002 - Kiln Room

Floor Coverings Res/Textile	Vinyl Tiles					
	1688/B00C/R0003/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00C - R0003 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles					
	1688/B00C/R0003/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00C - R0004 - Practical Activities - 1hb

No Asbestos

B00C - R1002 - Home Base

No Asbestos

B00C - R1003 - General Storeroom

No Asbestos

B00C - R1004 - General Storeroom

No Asbestos

B00C - R1005 - Home Base

No Asbestos

B00C - R1006 - General Storeroom

No Asbestos

B00C - R1007 - Movement

No Asbestos

B00C - R1008 - Practical Activities

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00C/R1009/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00C - R1009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00C/R1009/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 1980 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Communal Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Administration - 1947 - Timber Shed (Timber Shed)

Exterior

Eaves Linings	Flat AC Sheeting 1688/B00P/Eaves Linings/S4					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 1688/B00P/Eaves Linings/S10					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00P - R0001 - General Storeroom

No Asbestos

B00P - R0002 - Hall Chair Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Communal Facilities - 1970 - Timber Shed (Timber Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00S - R0001 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1688/B00S/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1688/B00S/R0001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00T - Pupil Facilities - 1980 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior**B00T - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 1688/B00T/R0002/Partition Walls (Cubicles)/S7					No Asbestos Detected

B00T - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00T - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 1688/B00T/R0002/Partition Walls (Cubicles)/S7					No Asbestos Detected

B00T - R0005 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00T - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00T - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00T - R0008 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected

B00T - R0009 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 1688/B00T/R0002/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 534 - D12365 - Library/Group Study/Office/A V Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2
---------	---------------	------------------	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos	54 m2
---------	---------------	------------------	-------

R8 - Entry

Ceiling	Flat AC Sheet	Assumed Asbestos	14 m2
---------	---------------	------------------	-------

OS 505 - D12366 - Admin Staff/Principal/Secure Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R3 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	20 m2
---------	---------------	------------------	-------

R4 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R5 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017