


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Borenore Public School (3504)
Region : Western NSW
State Electorate : Orange
Local Government Area : Cabonne

Initial Survey : Noel Arnold & Associates : 04 - May - 2008
Reviewed By : Greencap-NAA : 08 - Dec - 2016

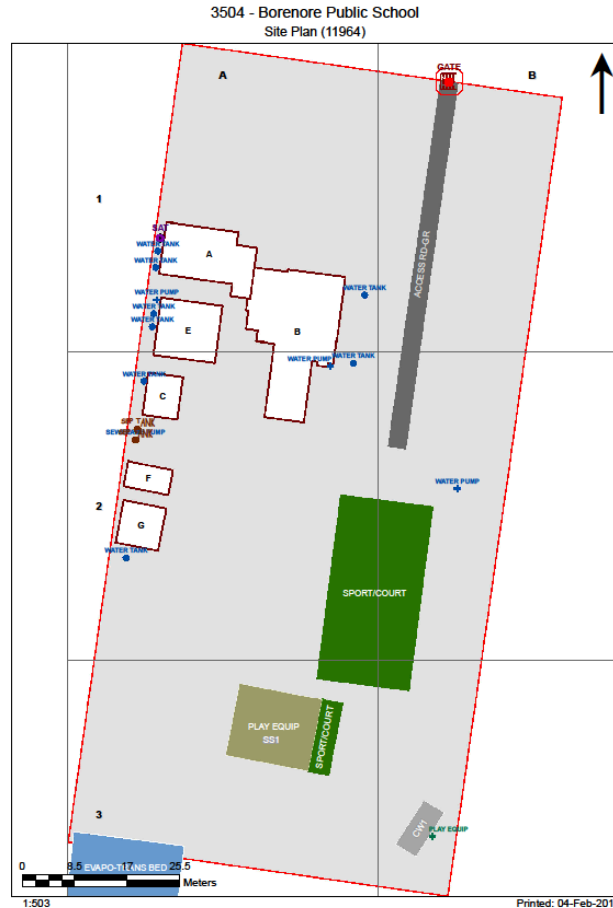

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1968 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height restricted 3-4m						
Eaves Linings	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
In-fill-panel	Compressed AC Sheet	18m2	North, South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
In-fill-panel	Flat AC Sheeting	3m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Pitched Roof -Flat Ceiling	No Asbestos Found					

Interior

B00A - R0001 - Clerical Office

No Asbestos

B00A - R0002 - Principal

No Asbestos

B00A - R0003 - Entry Vestibule

No Asbestos

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - External Movement

No Asbestos

B00A - R0006 - Entry Vestibule

No Asbestos

B00A - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1876 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Very low headspace					
Wall Cladding	Flat AC Sheeting 3504/B00B/Wall Cladding/S3	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Pitched Roof-Flat Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3504/B00B/Wall Cladding/S3	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Craft Store

No Asbestos

B00B - R0003 - Movement

Chalk Board	Flat AC Sheeting 3504/B00B/Wall Cladding/S3	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
-------------	--	------	-------	--------------------	---------	---

B00B - R0004 - General Storeroom

No Asbestos

B00B - R0005 - Movement

No Asbestos

B00B - R0006 - Interview

No Asbestos

B00B - R0007 - Staff Room

No Asbestos

B00B - R0008 - Practical Activities - 1hb

No Asbestos

B00B - R0009 - Staff Kitchen

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - General Storeroom

No Asbestos

B00B - R0012 - Staff Toilet

No Asbestos

B00B - R0013 - Covered Outdoor Learning Area

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Staff Facilities - 1877 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole					

Interior**B00C - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0003 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0006 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	4.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3504/B00B/Wall Cladding/S3					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00E - R0001 - Reading Area

No Asbestos

B00E - R0002 - K.L.A. Store

No Asbestos

B00E - R0003 - Practical Activities

No Asbestos

B00E - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - 2010 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2010 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00G - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017