


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Belrose Public School (3748)
Region : Northern Sydney
State Electorate : Davidson
Local Government Area : Warringah

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

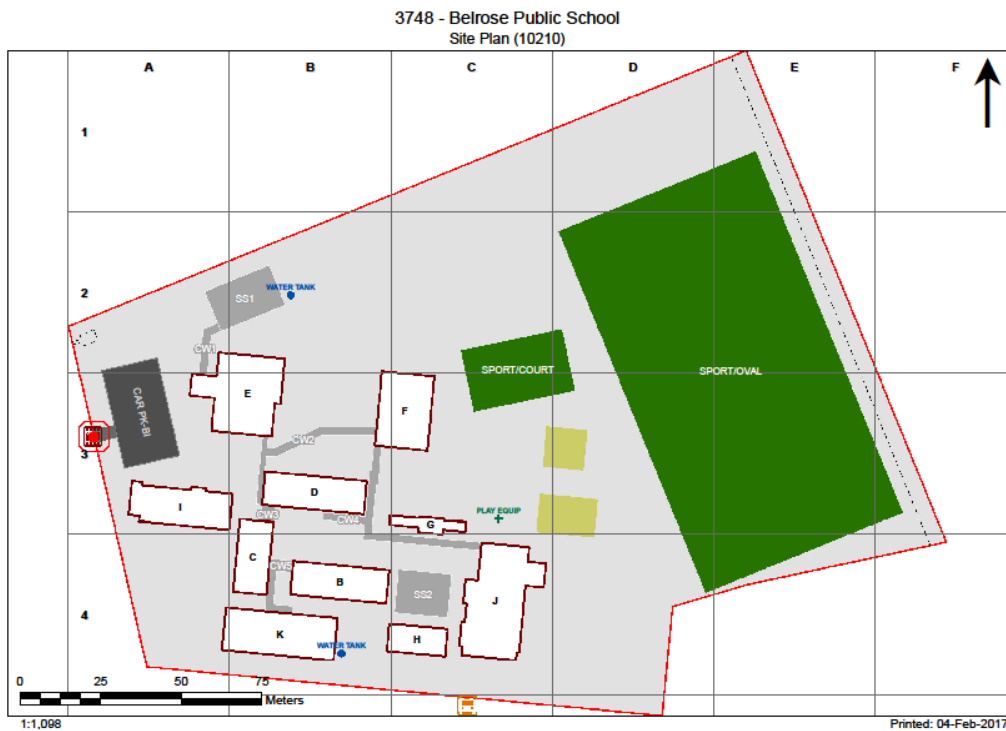

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/Underfloor Voids - Packing to Floor Joists/S15				Chrysotile (white asbestos)	
Underfloor Voids	AC Fragments/Debris	40m2	Throughout	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
	3748/B00B/Underfloor Voids/S16				Chrysotile (white asbestos)	
Eaves Linings	Compressed AC Sheet	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/Eaves Linings/S17				Chrysotile (white asbestos)	
Gable Verge Lining	Compressed AC Sheet	20m	East & West Locations	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/Gable Verge Lining/S18				Chrysotile (white asbestos)	

Interior

B00B - R0001 - Interview (17.08 m2)

Window in-fill panels	Flat AC Sheeting	2m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0001/Window in-fill panels/S19				Chrysotile (white asbestos)	

B00B - R0002 - General Storeroom (0.91 m2)

No Asbestos

B00B - R0003 - Staff Toilet (4.31 m2)

Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0003/Wall Linings Internal/S3				Chrysotile (white asbestos)	

B00B - R0004 - Movement (4.95 m2)

No Asbestos

B00B - R0005 - K.L.A. Store (21.12 m2)

Window in-fill panels	Flat AC Sheeting	2m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0001/Window in-fill panels- Lower section./S2				Chrysotile (white asbestos)	

B00B - R0006 - Craft Store (6.09 m2)

No Asbestos

B00B - R0007 - Personal Effects Storage (9.2 m2)

No Asbestos

B00B - R0008 - Home Base Store (4.95 m2)

No Asbestos

B00B - R0010 - Practical Activities - 1hb (16.19 m2)

Window in-fill panels	Flat AC Sheeting	4m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0001/Window in-fill panels- Lower section./S2				Chrysotile (white asbestos)	

B00B - R0011 - Home Base (44.62 m2)

Window in-fill panels	Flat AC Sheeting	4m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0001/Window in-fill panels- Lower section./S2				Chrysotile (white asbestos)	

B00B - R0012 - Home Base (61.64 m2)

Window in-fill panels	Flat AC Sheeting	6m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0001/Window in-fill panels- Lower section./S2				Chrysotile (white asbestos)	

B00B - R0013 - Practical Activities - 1hb (22.37 m2)

Window in-fill panels	Flat AC Sheeting	6m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0001/Window in-fill panels- Lower section./S2				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0014 - Toilets - Boys/Girls (4.34 m2)						
Wall Linings Internal	Flat AC Sheeting	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3748/B00B/R0003/Wall Linings Internal/S3					Chrysotile (white asbestos)	
B00B - R0015 - Home Base Store (3.08 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00B - R0016 - Personal Effects Storage (6.7 m2)						
No Asbestos						
B00B - R0017 - External Movement (53.42 m2)						
In-fill panels	Flat AC Sheeting	2m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3748/B00B/R0001/Window in-fill panels/S19					Chrysotile (white asbestos)	
B00B - R9001 - Practical Activities - 1hb (56.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3748/B00B/R9001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R9002 - General Storeroom (32.71 m2)						
No Asbestos						
B00B - R9003 - General Storeroom (21.6 m2)						
No Asbestos						
B00B - R9004 - General Storeroom (118.52 m2)						
No Asbestos						
B00B - R9005 - Sports Store (9.07 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable verge lining	Flat AC Sheeting	20m	East and West elevations	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00C/Gable verge lining/S21				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00C/Eaves Linings/S20				Chrysotile (white asbestos)	
Underfloor Voids	Packers on piers	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00C/Underfloor Voids/S22				Chrysotile (white asbestos)	

Interior**B00C - R0001 - Toilets - Boys/Girls (3.36 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00B/R0003/Wall Linings Internal/S3				Chrysotile (white asbestos)	

B00C - R0002 - Home Base Store (3.04 m2)

No Asbestos

B00C - R0003 - Personal Effects Storage (6.55 m2)

No Asbestos

B00C - R0004 - Home Base (85.72 m2)

No Asbestos

B00C - R0005 - Home Base (56.88 m2)

No Asbestos

B00C - R0006 - Home Base Store (7.14 m2)

Vinyl Floor	Vinyl Sheet	7m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00C/R0006/Vinyl Floor/S23				Chrysotile (white asbestos)	

B00C - R0008 - Personal Effects Storage (7.14 m2)

No Asbestos

B00C - R0009 - External Movement (41.11 m2)

In-fill panels	Flat AC Sheeting	4m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00C/R0009/In-fill panels/S24				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00C/R0009/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1980 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	16m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00D/Eaves Linings/S25					Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting	20m	East and West elevations	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00D/Gable verge lining/S26					Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00D/Underfloor Voids/S27					Chrysotile (white asbestos)

Interior**B00D - R0001 - Home Base (57.28 m2)**

No Asbestos

B00D - R0002 - Home Base Store (6.14 m2)

No Asbestos

B00D - R0003 - Distribution Board (0.87 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00D/R0003/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00D - R0004 - Personal Effects Storage (12.78 m2)

No Asbestos

B00D - R0005 - Home Base Store (7.25 m2)

No Asbestos

B00D - R0006 - Home Base (43.26 m2)

No Asbestos

B00D - R0007 - Practical Activities - 1hb (13.23 m2)

No Asbestos

B00D - R0008 - Practical Activities - 1hb (20.08 m2)

No Asbestos

B00D - R0009 - Home Base (65.64 m2)

No Asbestos

B00D - R0010 - Toilets - Boys/Girls (3.27 m2)

No Asbestos

B00D - R0011 - General Storeroom (3.93 m2)

No Asbestos

B00D - R0012 - Personal Effects Storage (6.34 m2)

Floor Coverings Res/Textile	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00D/R0012/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00D - R0013 - External Movement (48.68 m2)

In-fill panels	Flat AC Sheeting	6m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00D/R0013/In-fill panels/S28					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00C/R0009/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00D - R0014 - Interview (7.92 m2)

In-fill panels	Flat AC Sheeting	1m2	South facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00D/R0014/In-fill panels/S29					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
- Area inaccessible no voids

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00E - R0001 - Toilets - Girls (38.81 m2)

Partition Walls (Cubicles) Compressed AC Sheet 16m2 Variable positions Good Condition (1) Low (1) Low Priority (2-3)
3748/B00E/R0001/Partition Walls (Cubicles)/S6 **Chrysotile (white asbestos)**

B00E - R0002 - Staff Toilet (1.88 m2)

Non Accessible

B00E - R0003 - Sports Store (15.12 m2)

Floor Coverings Res/Textile Flat AC Sheeting
3748/B00E/R0003/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

B00E - R0004 - Kiln Room (0.84 m2)

No Asbestos

B00E - R0005 - Garden Store (25.21 m2)

No Asbestos

B00E - R0006 - Staff Toilet (2.16 m2)

No Asbestos

B00E - R0007 - Toilets - Boys (50.21 m2)

Partition Walls (Cubicles) Compressed AC Sheet 12m2 Variable positions Good Condition (1) Low (1) Low Priority (2-3)
3748/B00E/R0001/Partition Walls (Cubicles)/S6 **Chrysotile (white asbestos)**

B00E - R0008 - Movement (26.31 m2)

No Asbestos

B00E - R0009 - Cleaning Distributed Store (7.21 m2)

No Asbestos

B00E - R0010 - Staff Toilet (4.88 m2)

Incinerette Non Accessible Area
- Area inaccessible no key

B00E - R0011 - Canteen Office/Store (3.76 m2)

Floor Coverings Res/Textile Flat AC Sheeting
3748/B00E/R0003/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

B00E - R0012 - Canteen (20.65 m2)

Floor Coverings Res/Textile Flat AC Sheeting
3748/B00E/R0003/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

B00E - R0013 - Uniform Shop (4.19 m2)

Floor Coverings Res/Textile Flat AC Sheeting
3748/B00E/R0003/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

B00E - R0014 - External Stairs (10.13 m2)

No Asbestos

B00E - R0015 - Communal Space (93.42 m2)

Floor Coverings Res/Textile Flat AC Sheeting
3748/B00E/R0015/Floor Coverings Res/Textile/S7 **No Asbestos Detected**

B00E - R0016 - External Movement (11.29 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No						Test Result	
No Asbestos							
B00E - R0018 - Cleaning Distributed Store (7.64 m2)							
No Asbestos							
B00E - R0019 - Main Switch Board (7.75 m2)							
No Access	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Area inaccessible no key							
B00E - R0020 - General Storeroom (7.36 m2)							
No Asbestos							
B00E - R0021 - External Movement (32.28 m2)							
No Asbestos							
B00E - R0022 - External Movement (40.66 m2)							
No Asbestos							
B00E - R0023 - External Movement (28.75 m2)							
No Asbestos							
B00E - R1001 - Movement (7.7 m2)							
Floor Coverings Res/Textile	Flat AC Sheeting	3748/B00E/R0003/Floor Coverings Res/Textile/S9				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite	3748/B00E/R1001/New Interior/S10				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
B00E - R1002 - Home Base (62.7 m2)							
Ceiling Structures/Linings	Vermiculite	3748/B00E/R1001/New Interior/S10				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
B00E - R1003 - Home Base (62.7 m2)							
Ceiling Structures/Linings	Vermiculite	3748/B00E/R1001/New Interior/S10				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
B00E - R1004 - Movement (36.85 m2)							
Ceiling Structures/Linings	Vermiculite	3748/B00E/R1001/New Interior/S10				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
B00E - R1005 - Cleaning Distributed Store (0.32 m2)							
No Asbestos							
B00E - R1006 - Distribution Board (0.32 m2)							
Ceiling Structures/Linings	No Asbestos Found	Note: No inspection of live electrical installation.					
B00E - R1007 - External Movement (30.22 m2)							
No Asbestos							
B00E - R1008 - Home Base (62.51 m2)							
Ceiling Structures/Linings	Vermiculite	3748/B00E/R1001/New Interior/S10				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
B00E - R1009 - Home Base (62.52 m2)							
Ceiling Structures/Linings	Vermiculite	3748/B00E/R1001/New Interior/S10				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
B00E - R1010 - Movement (7.74 m2)							
Ceiling Structures/Linings	Vermiculite	3748/B00E/R1001/New Interior/S10				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
B00E - R1011 - External Movement (9.48 m2)							

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00E - R1012 - External Stairs (17.42 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 1983 - Brick/Veneer (Brick/Veneer)

Exterior

Wall Cladding	Flat AC Sheeting 3748/B00F/Wall Cladding/S8					No Asbestos Detected
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible No voids					

Interior

B00F - R0001 - Reading Area (158.37 m2)

No Asbestos

B00F - R0002 - K.L.A. Store (12.16 m2)

No Asbestos

B00F - R0003 - Library Office/Workroom (26.03 m2)

No Asbestos

B00F - R0004 - Communications Room (42.68 m2)

No Asbestos

B00F - R0005 - K.L.A. Store (4.78 m2)

No Asbestos

B00F - R0006 - Distribution Board (0.54 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0007 - Cleaning Distributed Store (1.86 m2)

No Asbestos

B00F - R0008 - External Movement (71 m2)

No Asbestos

B00F - R0009 - External Movement (12.88 m2)

No Asbestos

B00F - R0010 - External Movement (12.86 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1952 - Concrete (Concrete)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible on slab no voids					

Interior

B00G - R0001 - Toilets - Boys (24.72 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3748/B00E/R0001/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	

B00G - R0002 - Handwashing Facilities (16.21 m2)

No Asbestos

B00G - R0003 - Handwashing Facilities (15.16 m2)

No Asbestos

B00G - R0004 - Toilets - Girls (19.18 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3748/B00E/R0001/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00H - General Learning - 1955 - Concrete (Concrete)						
Exterior						
Eaves Linings	Flat AC Sheeting	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/Eaves Linings/S30					Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/Underfloor Voids/S31					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	5m2	Throughout	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
	3748/B00H/Underfloor Voids/S32					Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior						
B00H - R0001 - Personal Effects Storage (3.57 m2)						
Wall Linings Internal	Flat AC Sheeting	2m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0002 - Home Base Store (13.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0003 - Communal/Performance Store (6.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0004 - Home Base (47.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0005 - Other-Community Use (47.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0006 - External Movement (27.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3748/B00H/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Administration - 2005 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00I - R0001 - Entry Vestibule (24.21 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0002 - Clerical Office (50.33 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0003 - Sick Bay (9.73 m2)

No Asbestos

B00I - R0004 - Disabled Toilet (4.54 m2)

No Asbestos

B00I - R0005 - Staff Toilet (4.9 m2)

No Asbestos

B00I - R0006 - Distribution Board (2.59 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0007 - Cleaning Distributed Store (2.6 m2)

No Asbestos

B00I - R0008 - Principal (16.64 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0009 - Security Store (13.61 m2)

No Asbestos

B00I - R0010 - Staff Room Annexe (19.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0011 - Staff Room (39.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0012 - Staff Toilet (4.75 m2)

No Asbestos

B00I - R0013 - Staff Toilet (4.68 m2)

No Asbestos

B00I - R0014 - Deputy Principal (12.45 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0015 - Duplicating Workroom (17.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0016 - Interview (13.01 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0017 - Movement (55.82 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00I - R0018 - Staff Kitchen (9.72 m2)

No Asbestos

B00I - R0019 - External Movement (11.37 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B001 - R0020 - External Movement (5.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - Communal Facilities - 2005 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - Covered Outdoor Learning Area (243.83 m2)**

No Asbestos

B00J - R0002 - Canteen (27.21 m2)

No Asbestos

B00J - R0003 - Canteen Office/Store (8.61 m2)

No Asbestos

B00J - R0004 - Communal Space (166.46 m2)

No Asbestos

B00J - R0005 - Disabled Toilet (5.04 m2)

No Asbestos

B00J - R0006 - Cleaning Distributed Store (3.64 m2)

No Asbestos

B00J - R0007 - Cleaning Distributed Store (6 m2)

No Asbestos

B00J - R0008 - Plant (0.72 m2)

No Asbestos

B00J - R0009 - Communications Room (1.36 m2)

No Asbestos

B00J - R0010 - P.E. Store (11.52 m2)

No Asbestos

B00J - R0011 - Performance Store (8.82 m2)

No Asbestos

B00J - R0012 - Chair Store (9.1 m2)

No Asbestos

B00J - R0013 - Sports Store (13.2 m2)

No Asbestos

B00J - R0014 - Raised Platform (56.65 m2)

No Asbestos

B00J - R0015 - Distribution Board (2.43 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0016 - Movement (26.99 m2)

No Asbestos

B00J - R0017 - Movement (8.59 m2)

No Asbestos

B00J - R0018 - External Movement (8.02 m2)

No Asbestos

B00J - R0019 - Movement (6.5 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - External Movement (72.95 m2)

No Asbestos

B00K - R0002 - Practical Activities - 1hb (19.36 m2)

No Asbestos

B00K - R0003 - Home Base Store (5.72 m2)

No Asbestos

B00K - R0004 - Home Base (58.76 m2)

No Asbestos

B00K - R0005 - Withdrawal Space - 2hb (10.67 m2)

No Asbestos

B00K - R0006 - Home Base (58.67 m2)

No Asbestos

B00K - R0007 - Home Base Store (5.72 m2)

No Asbestos

B00K - R0008 - Practical Activities - 1hb (19.36 m2)

No Asbestos

B00K - R0009 - Practical Activities - 1hb (19.36 m2)

No Asbestos

B00K - R0010 - Home Base Store (5.71 m2)

No Asbestos

B00K - R0011 - Home Base (58.76 m2)

No Asbestos

B00K - R0012 - Withdrawal Space - 2hb (10.67 m2)

No Asbestos

B00K - R0013 - Home Base (58.67 m2)

No Asbestos

B00K - R0014 - Home Base Store (5.71 m2)

No Asbestos

B00K - R0015 - Practical Activities - 1hb (19.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3748_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017