


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bathurst West Public School (3824)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Bathurst

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Grencap-NAA : 17 - Apr - 2015

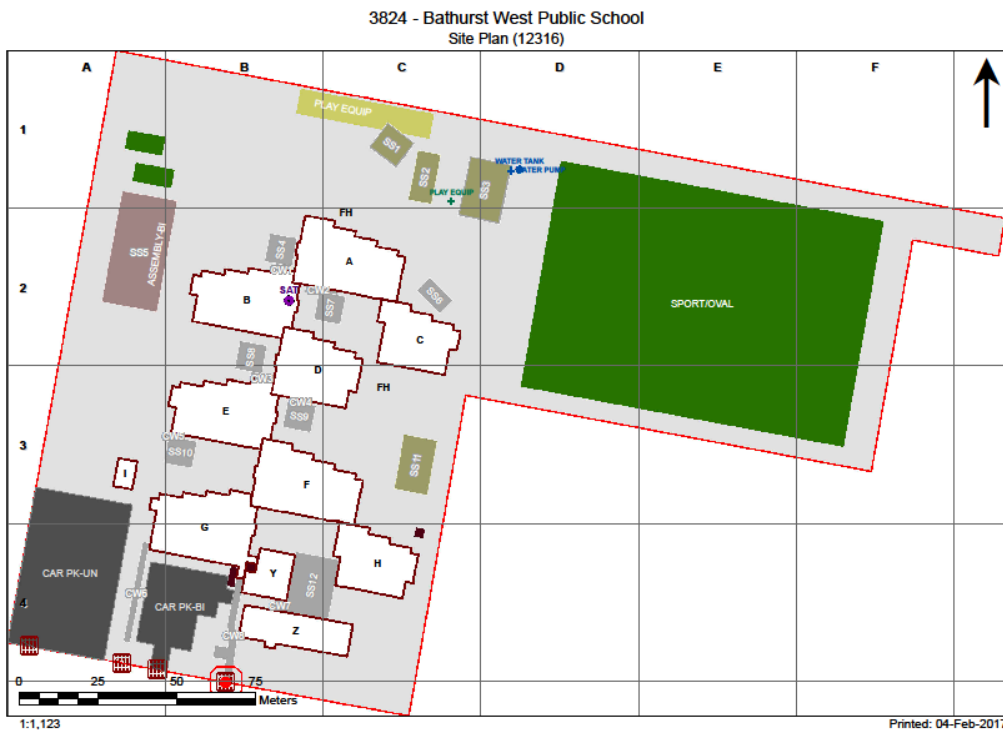

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos sighted.

Interior**B00A - R0001 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	0.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00A - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0003/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00A - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0003/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00A - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00A - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00A - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00A - R0008 - Staff Room Annexe

No Asbestos

B00A - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00A - R0010 - Home Base

No Asbestos

B00A - R0011 - Withdrawal Space - 1hb

No Asbestos

B00A - R0012 - Home Base

No Asbestos

B00A - R0013 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00A - R0014 - Home Base

No Asbestos

B00A - R0015 - Withdrawal Space - 1hb

No Asbestos

B00A - R0016 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0017 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00A - R0018 - Craft Store						
Floor Coverings Res/Textile	Vinyl Sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive/underlay of green mottled vinyl sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected	
B00A - R0019 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive/underlay of green mottled vinyl sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected	
B00A - R0020 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive/underlay of green mottled vinyl sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected	
B00A - R0021 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive/underlay green mottled vinyl sheet.					
3824/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected	
B00A - R0022 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive/underlay of green mottled vinyl sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00A - R0023 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive/underlay of green mottled vinyl sheet					
3824/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00A - R0024 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles. 3824/B00C/R0021/Floor Coverings Res/Textile/S12				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting 3824/B00C/R0021/Wall Linings Internal/S13	30m2	East, south & north	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R0025 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles 3824/B00C/R0021/Floor Coverings Res/Textile/S11	6.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles. 3824/B00C/R0021/Floor Coverings Res/Textile/S12				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting 3824/B00C/R0021/Wall Linings Internal/S13	30m2	East, south & north	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R0027 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting 3824/B00C/R0011/Ceiling Structures/Linings/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R0028 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Tiered Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos sighted

Interior**B00B - R0001 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	0.56m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00B - R0002 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles	0.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.				No Asbestos Detected	
3824/B00C/R0021/Floor Coverings Res/Textile/S12						

Ceiling Structures/Linings	Flat AC Sheeting	0.56m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00B - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00B - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0003/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00B - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00B - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00B - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00B - R0008 - Staff Room Annexe

No Asbestos

B00B - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00B - R0010 - Home Base

No Asbestos

B00B - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00B - R0012 - Withdrawal Space - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0013 - Home Base						
No Asbestos						
B00B - R0014 - Home Base						
No Asbestos						
B00B - R0015 - Withdrawal Space - 1hb						
No Asbestos						
B00B - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00B - R0017 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	40m2	East, west, south	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00B - R0018 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	20m2	South & east	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00B - R0019 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	30m2	East , west, south	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00B - R0020 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	1.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
B00B - R0021 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	0.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
B00B - R0022 - Security Store						
Floor Coverings Res/Textile	Vinyl Tiles	7.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	30m2	East , west, south	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00B - R0023 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	130.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Floor Coverings
Res/Textile

Adhesive/underlay of dark blue
vinyl tiles.
3824/B00C/R0021/Floor Coverings Res/Textile/S12

No Asbestos Detected

B00B - R0024 - Special Programs Room

No Asbestos

B00B - R0025 - Movement

No Asbestos

B00B - R0026 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00C - R0001 - Staff Room Annexe**

No Asbestos

B00C - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00C - R0005 - Withdrawal Space - 1hb

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00C - R0008 - Home Base

No Asbestos

B00C - R0009 - Withdrawal Space - 1hb

No Asbestos

B00C - R0010 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						

Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion East, West & South	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	

B00C - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	0.66m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3824/B00C/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00C - R0012 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	0.41m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3824/B00C/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00C - R0013 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00C - R0014 - Toilets - Boys

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	
B00C - R0015 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00C - R0016 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00C - R0017 - Personal Effects Storage						
No Asbestos						
B00C - R0018 - Practical Activities - 1hb						
No Asbestos						
B00C - R0019 - Personal Effects Storage						
No Asbestos						
B00C - R0020 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion east, west & south.	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00C - R0021 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00C - R0022 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	16.33.m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos sighted

Interior**B00D - R0001 - Reading Area**

No Asbestos

B00D - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00D - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00D - R0004 - Music Store

Floor Coverings Res/Textile	Vinyl Tiles	3.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						

B00D - R0005 - Special Programs Room

No Asbestos

B00D - R0006 - K.L.A. Store

Floor Coverings Res/Textile	Vinyl Tiles	11.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						

B00D - R0007 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	15.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						

B00D - R0008 - Library Office/Workroom

No Asbestos

B00D - R0009 - Movement

No Asbestos

B00D - R0010 - Toilets - Girls

No Asbestos

B00D - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	0.46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00D - R0012 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	0.46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0013 - Toilets - Boys						
No Asbestos						
B00D - R0014 - K.L.A. Store						
No Asbestos						
B00D - R0015 - K.L.A. Store						
No Asbestos						
B00D - R0016 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00D - R0017 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00D - R0018 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos sighted.

Interior**B00E - R0001 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R0002 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles	0.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						

Ceiling Structures/Linings	Flat AC Sheeting	0.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00E - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00E - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R0008 - Staff Room Annexe

No Asbestos

B00E - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00E - R0012 - Withdrawal Space - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0013 - Home Base						
No Asbestos						
B00E - R0014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00E - R0015 - Home Base						
No Asbestos						
B00E - R0016 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00E - R0017 - Home Base						
No Asbestos						
B00E - R0018 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	30m2	East, south & west	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00E - R0019 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	30m2	South & west	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00E - R0020 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	20m2	South & east	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00E - R0021 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	20m2	South & west	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00E - R0022 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	1.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
B00E - R0023 - Practical Activities - 1hb						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	124.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	
B00E - R0024 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	0.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	
B00E - R0025 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	1.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	
B00E - R0026 - Withdrawal Space - 1hb						
No Asbestos						
B00E - R0027 - No Access						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	30m2	East , west, south	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00E - R0028 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole.
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos sighted.

Interior**B00F - R0001 - Distribution Board** Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	0.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00F - R0002 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles	0.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						

Ceiling Structures/Linings	Flat AC Sheeting	0.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00F - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00F - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00F - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00F - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00F - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00F - R0008 - Staff Room Annexe

No Asbestos

B00F - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00F - R0010 - Home Base

No Asbestos

B00F - R0011 - Withdrawal Space - 1hb

No Asbestos

B00F - R0012 - Home Base

No Asbestos

B00F - R0013 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00F - R0014 - Home Base						
No Asbestos						
B00F - R0015 - Withdrawal Space - 1hb						
No Asbestos						
B00F - R0016 - Home Base						
No Asbestos						
B00F - R0017 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00F - R0018 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	7.42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	30m2	East, south & west	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00F - R0019 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	1.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
B00F - R0020 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	123.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
B00F - R0021 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	0.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
B00F - R0022 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					No Asbestos Detected
3824/B00C/R0021/Floor Coverings Res/Textile/S12						
Wall Linings Internal	Flat AC Sheeting	20m2	West & south	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00F - R0023 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles. 3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3824/B00C/R0021/Wall Linings Internal/S13	20m2	East & south	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00F - R0024 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles 3824/B00C/R0021/Floor Coverings Res/Textile/S11	6.46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles. 3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3824/B00C/R0021/Wall Linings Internal/S13	20m2	West & south	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00F - R0025 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles 3824/B00C/R0021/Floor Coverings Res/Textile/S11	6.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles. 3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3824/B00C/R0021/Wall Linings Internal/S13	6.4m2	South & east	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00F - R0026 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles 3824/B00C/R0021/Floor Coverings Res/Textile/S11	1.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles. 3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected
B00F - R0027 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos sighted

Interior**B00G - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00G - R0002 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	

B00G - R0003 - Plant

No Asbestos

B00G - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	24.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	

B00G - R0005 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay beneath blue tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	

B00G - R0006 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00G - R0007 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0014/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	

B00G - R0008 - Staff Kitchen

Floor Coverings Res/Textile	Vinyl Tiles	9.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	

B00G - R0009 - Sports Store

No Asbestos

B00G - R0010 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	11.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

B00G - R0011 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00G - R0012 - Hall Chair Store						
Wall Linings Internal	Flat AC Sheeting	40m2	North, south, east	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00G - R0013 - Communal Space						
No Asbestos						
B00G - R0014 - Raised Platform						
No Asbestos						
B00G - R0015 - P.E. Store						
Wall Linings Internal	Flat AC Sheeting	20m2	East & west	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Wall Linings Internal/S13					Chrysotile (white asbestos)	
B00G - R0016 - Plant						
Ceiling Structures/Linings	Flat AC Sheeting	0.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00A/R0002/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00G - R0017 - General Assistant/Bulk Store						
Floor Coverings Res/Textile	Vinyl Tiles	11.29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00C/R0021/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of dark blue vinyl tiles.					
3824/B00C/R0021/Floor Coverings Res/Textile/S12					No Asbestos Detected	
B00G - R0018 - No Access						
No Asbestos						
B00G - R0019 - Main Switch Board						
No Asbestos						
B00G - R0020 - No Access						
No Asbestos						
B00G - R0021 - Staff Toilet						
No Asbestos						
B00G - R0022 - Staff Toilet						
No Asbestos						
B00G - R0023 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1980 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - No asbestos sighted.
Underfloor Voids	Non Accessible Area - No asbestos sighted.

Interior**B00H - R0001 - Staff Room Annexe**

No Asbestos

B00H - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00H - R0003 - Toilets - Boys/Girls

No Asbestos

B00H - R0004 - Home Base

No Asbestos

B00H - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00H - R0006 - Withdrawal Space - 1hb

No Asbestos

B00H - R0007 - Home Base

No Asbestos

B00H - R0008 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	16.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00H - R0009 - Home Base

No Asbestos

B00H - R0010 - Withdrawal Space - 1hb

No Asbestos

B00H - R0011 - Toilets - Boys/Girls

Insulation to Supports

B00H - R0012 - Toilets - Boys/Girls

No Asbestos

B00H - R0013 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0014 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3824/B00H/R0014/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay of blue tile.					
3824/B00H/R0014/Floor Coverings Res/Textile/S8					No Asbestos Detected	

B00H - R0015 - Personal Effects Storage

No Asbestos

B00H - R0016 - Practical Activities - 1hb

No Asbestos

B00H - R0017 - Personal Effects Storage

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0018 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00H/R0014/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive/underlay under dark blue tiles.					
	3824/B00H/R0014/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00H - R0019 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00H/R0014/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive/underlay under dark blue tiles.					
	3824/B00H/R0014/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00H - R0020 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00H - R0021 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00H - R0022 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00H - R0023 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00H/R0020/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Storage - 2014 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00I - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00Y - Pupil Facilities - 1979 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Flat AC Sheeting	500m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eave linings	Flat AC Sheeting	70m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	Non Accessible Area - No Asbestos.					

Interior**B00Y - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	125m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00Y - R0002 - Canteen

Floor Coverings Res/Textile	Yellow vinyl sheet					No Asbestos Detected
	3824/B00Y/R0002/Floor Coverings Res/Textile/S16					
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Adhesive/ underlay of yellow vinyl sheet					No Asbestos Detected
	3824/B00Y/R0002/Floor Coverings Res/Textile/S17					
Floor Coverings Res/Textile	Blue vinyl tile beneath yellow vinyl sheet.	30.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Floor Coverings Res/Textile/S18				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive/underlay under blue vinyl tile. Blue tile being under yellow vinyl sheeting.					No Asbestos Detected
	3824/B00Y/R0002/Floor Coverings Res/Textile/S19					
In-fill panel above roller shutters	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/In-fill panel above roller shutters/S20				Chrysotile (white asbestos)	

B00Y - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Yellow vinyl sheet					No Asbestos Detected
	3824/B00Y/R0002/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive/underlay yellow vinyl sheet					No Asbestos Detected
	3824/B00Y/R0002/Floor Coverings Res/Textile/S17					
Floor Coverings Res/Textile	Blue vinyl tile under yellow vinyl sheet.	3.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Floor Coverings Res/Textile/S18				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive beneath blue vinyl tile. Blue vinyl being beneath yellow vinyl sheet.					No Asbestos Detected
	3824/B00Y/R0002/Floor Coverings Res/Textile/S19					

B00Y - R0004 - Canteen Office/Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Yellow vinyl sheet. 3824/B00Y/R0002/Floor Coverings Res/Textile/S16					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3824/B00Y/R0002/Ceiling Structures/Linings/S14	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Underlay/Adhesive beneath yellow vinyl sheet 3824/B00Y/R0002/Floor Coverings Res/Textile/S17					No Asbestos Detected
Floor Coverings Res/Textile	Blue vinyl tile beneath yellow vinyl sheet 3824/B00Y/R0002/Floor Coverings Res/Textile/S18	3.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive/underlay beneath blue vinyl tile. Blue vinyl under yellow vinyl sheet. 3824/B00Y/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected

B00Y - R0005 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Administration - 1979 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Inaccessible - height restriction						
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/Eaves Linings/S2					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - No manhole					
Underfloor Voids	Non Accessible Area - No sub-floor opening					
Below window in-fill panels	Flat AC Sheeting	13Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0028/Window in-fill panel./S24					Chrysotile (white asbestos)

Interior**B00Z - R0001 - Clerical Office/Workroom**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3824/B00Z/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00Z - R0002 - Staff Toilet

No Asbestos

B00Z - R0003 - Duplicating Workroom

No Asbestos

B00Z - R0004 - Deputy Principal

No Asbestos

B00Z - R0005 - Clerical Office/Workroom

No Asbestos

B00Z - R0006 - Interview

No Asbestos

B00Z - R0007 - Principal

Window in-fill panel.	Flat AC Sheeting	2Unit	West lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0028/Window in-fill panel./S24					Chrysotile (white asbestos)

B00Z - R0008 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	3824/B00Z/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00Z - R0010 - Clerical Office

Window in-fill panel.	Flat AC Sheeting	2m2	West lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0028/Window in-fill panel./S24					Chrysotile (white asbestos)

B00Z - R0013 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0013/Wall Linings Internal/S4					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0013/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00Z - R0014 - Staff Room

Window in-fill panel.	Flat AC Sheeting	2m2	North below external window	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0028/Window in-fill panel./S24					Chrysotile (white asbestos)

B00Z - R0015 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	3824/B00Z/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected
Below window in-fill panels	Flat AC Sheeting	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0028/Window in-fill panel./S24					Chrysotile (white asbestos)
B00Z - R0016 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
	3824/B00Z/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected
B00Z - R0017 - Plant						
No Asbestos						
B00Z - R0018 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00Z - R0020 - Movement						
No Asbestos						
B00Z - R0021 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00Z - R0022 - Cleaning Distributed Store						
No Asbestos						
B00Z - R0024 - Movement						
No Asbestos						
B00Z - R0026 - Disabled Toilet						
No Asbestos						
B00Z - R0027 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	62.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Y/R0002/Ceiling Structures/Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Window in-fill panels	Flat AC Sheeting	12Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0028/Window in-fill panel./S24					Chrysotile (white asbestos)
B00Z - R0028 - Entry Vestibule						
Window in-fill panel.	Flat AC Sheeting	1m2	West lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3824/B00Z/R0028/Window in-fill panel./S24					Chrysotile (white asbestos)
B00Z - R0029 - Staff Room Annexe						
No Asbestos						
B00Z - R0030 - Staff Kitchen						
No Asbestos						
B00Z - R0031 - Sick Bay						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3824_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017