


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Bathurst South Public School (3847)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Bathurst

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Greencap-NAA : 17 - Apr - 2015

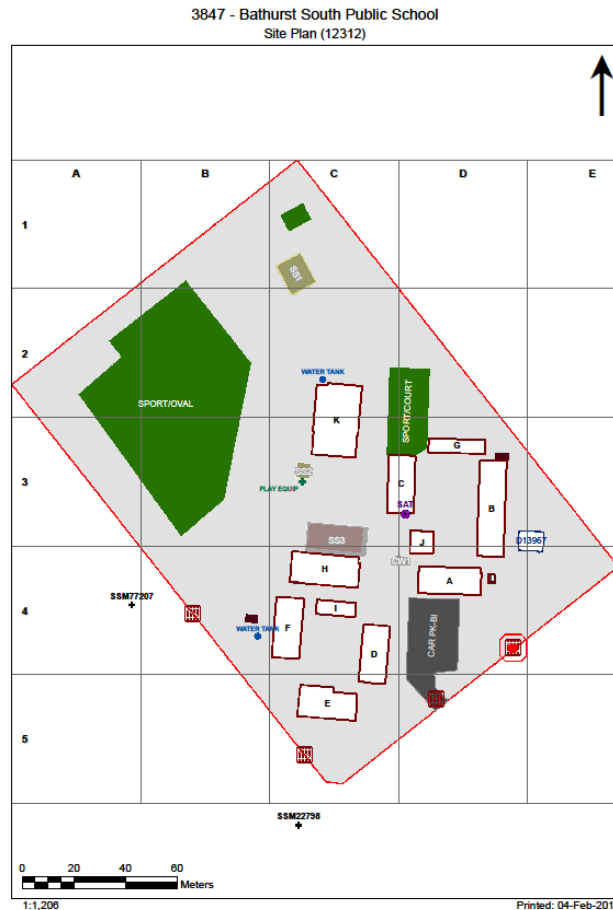

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	22m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	18m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00B/R0014/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Clerical Office/Workroom**

Safe	Encapsulated Insulation material within unit	6m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Material encased					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					

B00A - R0002 - General Storeroom

No Asbestos

B00A - R0003 - Cleaning Distributed Store

No Asbestos

B00A - R0004 - Main Switch Board

Electrical Backing Board	Bituminous board	2Unit	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Could not sample - live					

B00A - R0005 - Duplicating Workroom

No Asbestos

B00A - R0006 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					

B00A - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					

B00A - R0008 - Principal

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00F/R0008/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		

B00A - R0011 - Staff Room

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00A - R0012 - Craft Store						
No Asbestos						
B00A - R0013 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00A - R0014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	42.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0015 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0016 - Toilet - Lobby						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0017 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0018 - Toilet - Lobby						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0019 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00B/R0014/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	22m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	70m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					
Window in-fill panels	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Home Base

Window in-fill panels	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Home Base

Window in-fill panels	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0008 - Home Base Store

No Asbestos

B00B - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red tile.					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					

B00B - R0010 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive under red tile. Tile is under linoleum.					
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00B - R0011 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under red tile. Tile is under linoleum.					
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00B - R0012 - Home Base						
Window in-fill panels	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0013 - Home Base Store						
No Asbestos						
B00B - R0014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00B/R0014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Window in-fill panels	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling in-fill panels	Flat AC Sheeting	2Unit	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	22m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - No manhole.					
Underfloor Voids	Flat AC fragment.	0.1m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Cannot be accessed sub-floor locked.					

Interior**B00C - R0003 - K.L.A. Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	3847/B00C/R0003/Floor Coverings Res/Textile/S12					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under grey mottled vinyl sheet.					
	3847/B00C/R0003/Floor Coverings Res/Textile/S13					No Asbestos Detected

B00C - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl sheet under carpet.					
	3847/B00C/R0011/Floor Coverings Res/Textile/S10					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under linoleum. Linoleum being under carpet.					
	3847/B00C/R0011/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00C - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Window in-fill panels	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0009 - Home Base

Floor Coverings Res/Textile	Vinyl sheet under carpet.					
	3847/B00C/R0011/Floor Coverings Res/Textile/S10					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under linoleum. Linoleum being under carpet.					
	3847/B00C/R0011/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00C - R0010 - Home Base Store

Floor Coverings Res/Textile	Vinyl sheet under carpet.					
	3847/B00C/R0011/Floor Coverings Res/Textile/S10					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under linoleum. Linoleum being under carpet.					
	3847/B00C/R0011/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00C - R0011 - Withdrawal Space - 2hb

Floor Coverings Res/Textile	Vinyl sheet under carpet.					
	3847/B00C/R0011/Floor Coverings Res/Textile/S10					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings
Res/Textile

Adhesive under linoleum.
Linoleum being under carpet.
3847/B00C/R0011/Floor Coverings Res/Textile/S11

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	48m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Ceiling in-fill panel	Flat AC Sheeting	3m2	East & west	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior**B00D - R0001 - Withdrawal Space - 1hb**

No Asbestos

B00D - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0010/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0003 - Movement

No Asbestos

B00D - R0004 - Personal Effects Storage

No Asbestos

B00D - R0005 - Home Base Store

No Asbestos

B00D - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					
Window in-fill panels	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0007 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0010/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0008 - Deputy Principal

No Asbestos

B00D - R0009 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00D - R0010 - Staff Room Annexe						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00D - R0011 - Cleaning Distributed Store						
No Asbestos						
B00D - R0012 - Duplicating Workroom						
Floor Coverings Res/Textile	Vinyl Tiles					
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under red tile.					
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00D - R0013 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Window in-fill panels	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling in-fill panels	Flat AC Sheeting	3m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	22m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	22m2	East, west & south	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - Movement**

Window in-fill panels	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling in-fill panels	Flat AC Sheeting	4m2	East & west	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	63.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Above door in-fill panel	Flat AC Sheeting	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0002 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					

B00E - R0003 - Home Base Store

No Asbestos

B00E - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under red vinyl tile. Tile being under carpet					No Asbestos Detected
	3847/B00A/R0007/Floor Coverings Res/Textile/S9					

B00E - R0005 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0010/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	3.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0006 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3847/B00A/R0015/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0007 - Home Base

No Asbestos

B00E - R0008 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	22m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos sighted					

Interior**B00F - R0001 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0002 - Sports Store

No Asbestos

B00F - R0003 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wood fired stove.	Encapsulated Insulation material within unit	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Old stove no visible ACM					

B00F - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Window in-fill panels	Flat AC Sheeting	6m2	Various east,west & south	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling in-fill panels	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	32.89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00F/R0008/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		

B00F - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00F/R0008/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0007 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3847/B00F/R0008/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00F - R0008 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3847/B00F/R0008/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	22m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Disused incinerator	Encapsulated Insulation material within unit	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Incinerator door is open however it is					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- No ACM sighted.					
Ceiling Voids	No Asbestos Found					

Interior**B00G - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library - 1979 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	14m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00H/R0002/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	Single FCS fragment	0.01m2	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Cannot access sub-floor cage door					
Ceiling Voids	No Asbestos Found					

Interior**B00H - R0001 - Hall Chair Store**

Ceiling Structures/Linings	Flat AC Sheeting	6.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00H/R0002/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00H/R0002/Ceiling Structures/Linings/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0004 - General Storeroom

No Asbestos

B00H - R0007 - Reading Area

No Asbestos

B00H - R0008 - Library Office/Workroom

No Asbestos

B00H - R0010 - Practical Activities

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	14m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	22m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- No asbestos sighted.					

Interior

B001 - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	35.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	35.87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00J - Pupil Facilities - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	18m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/Gable Verge Lining/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Window in-fill panel	Flat AC Sheeting	5m2	Variable positions west	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- No asbestos sighted					

Interior**B00J - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Window in-fill panels	Flat AC Sheeting	1.0m2	Northwest lower portion of window	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0002 - Security Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Window in-fill panels	Flat AC Sheeting	1.0m2	East lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/In-fill-panel/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0005 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3847/B00A/R0015/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0006 - Canteen Office/Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3847/B00A/R0015/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - No asbestos
Underfloor Voids - Slab on Ground	Non Accessible Area - No asbestos found

Interior

B00K - R0001 - Access Shower/Toilet/Change

No Asbestos

B00K - R0002 - Main Switch Board

No Asbestos

B00K - R0003 - Cleaning Distributed Store

No Asbestos

B00K - R0004 - Plant

No Asbestos

B00K - R0005 - Movement

No Asbestos

B00K - R0006 - Toilets - Boys

No Asbestos

B00K - R0007 - Sound Cupboard

No Asbestos

B00K - R0008 - Toilets - Girls

No Asbestos

B00K - R0009 - Movement

No Asbestos

B00K - R0010 - P.E. Store

No Asbestos

B00K - R0011 - Communal/Performance Store

No Asbestos

B00K - R0012 - Hall Chair Store

No Asbestos

B00K - R0013 - Raised Platform

No Asbestos

B00K - R0014 - Communal Space

No Asbestos

B00K - R0015 - Covered Outdoor Learning Area

No Asbestos

B00K - R0016 - Ramp

No Asbestos

B00K - R0017 - Movement

No Asbestos

B00K - R0018 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Electrical Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Small ceiling space if at all there is a ceiling space.No ACM sighted.
Underfloor Voids - Slab on Ground	Non Accessible Area - No ACM sighted.

Interior

B00L - R0001 - Main Switch Board

No Asbestos

B00L - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13967 - Learning Unit - Standard With P.A.A. : Placement Date - 26/03/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017