


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Belmont North Public School (3927)
Region : Hunter/Central Coast
State Electorate : Swansea
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 28 - May - 2008
Reviewed By : AECOM : 17 - Jun - 2016

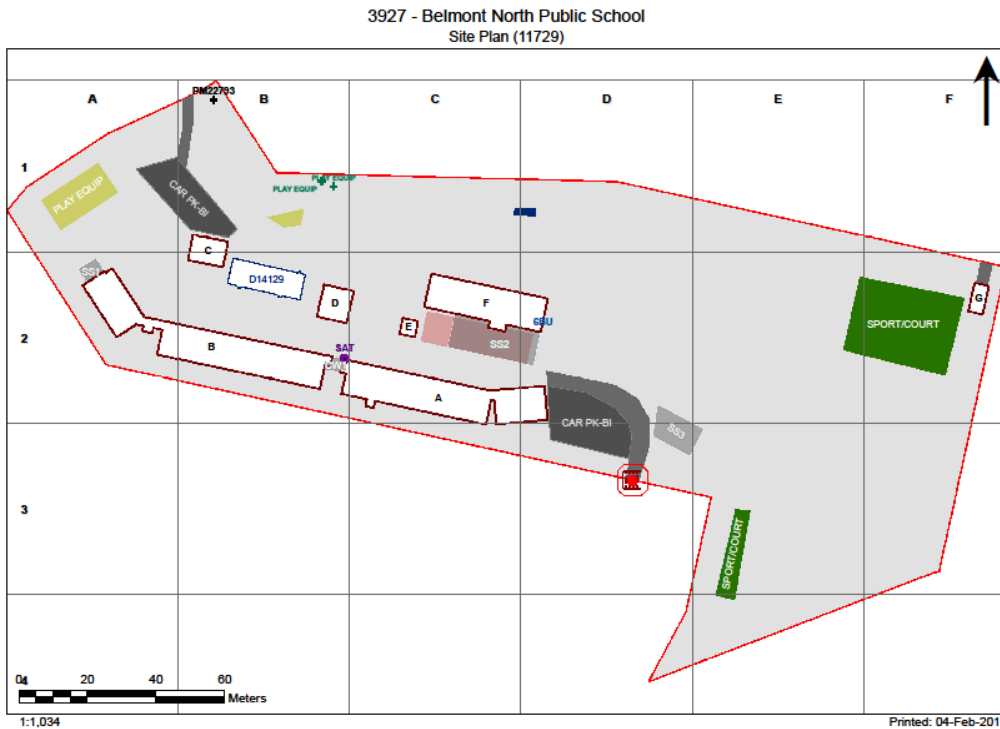

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1962 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction 3.31m					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/Eaves Linings/S13						Chrysotile (white asbestos)

Interior

B00A - R0001 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/R0003/Ceiling Structures/Linings/S12						Chrysotile (white asbestos)

B00A - R0002 - Home Base

Heater Surround	Flat AC Sheeting	1Unit(s)	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/R0008/Infill-Panel Behind Heater/S16						Chrysotile (white asbestos)

B00A - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	112m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/R0003/Ceiling Structures/Linings/S12						Chrysotile (white asbestos)

B00A - R0004 - Home Base

Chalk Board	Flat AC Sheeting 3927/B00A/R0004/Chalk Board/S18					No Asbestos Detected
Heater Surround	Flat AC Sheeting	1Unit(s)	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/R0008/Infill-Panel Behind Heater/S16						Chrysotile (white asbestos)

B00A - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/R0003/Ceiling Structures/Linings/S12						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 3927/B00A/R0014/Wall Linings Internal/S15					No Asbestos Detected

B00A - R0006 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 3927/B00A/R0014/Wall Linings Internal/S15					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/R0003/Ceiling Structures/Linings/S12						Chrysotile (white asbestos)

B00A - R0007 - Staff Room

Floor Coverings Res/Textile	Vinyl Sheet 3927/B00A/R0007/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00A - R0008 - Reading Area

Heater Surround	Flat AC Sheeting	1Unit(s)	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00A/R0008/Infill-Panel Behind Heater/S16						Chrysotile (white asbestos)

B00A - R0009 - Library Office/Workroom

No Asbestos

B00A - R0010 - Duplicating Workroom

No Asbestos

B00A - R0011 - Clerical Office

No Asbestos

B00A - R0012 - Security Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0013 - Entry Vestibule

No Asbestos

B00A - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

3927/B00A/R0003/Ceiling Structures/Linings/S12 **Chrysotile (white asbestos)**

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
-----------------------	------------------	--	--	--	--	-----------------------------

3927/B00A/R0014/Wall Linings Internal/S15

B00A - R0015 - Movement

No Asbestos

B00A - R0016 - Principal

No Asbestos

B00A - R0017 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	-----	------------	--------------------	---------	--------------------

3927/B00A/R0017/Floor Coverings Res/Textile/S14 **Chrysotile (white asbestos)**

B00A - R0018 - Interview

No Asbestos

B00A - R0019 - Interview

No Asbestos

B00A - R0020 - Sick Bay

No Asbestos

B00A - R9001 - Sports Store

No Asbestos

B00A - R9002 - Sports Store

No Asbestos

B00A - R9003 - General Storeroom

No Asbestos

B00A - R9004 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Music - 1958 - Timber (Timber)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction 3.4m					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00A/Eaves Linings/S13					Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris	0.02m2	Below BR0021	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	3927/B00B/Underfloor Voids - Packing to Floor Joists/S24					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris					
	3927/B00B/Underfloor Voids - Packing to Floor Joists/S25					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	Compressed AC Sheet					
	3927/B00B/Underfloor Voids - Packing to Floor Joists/S26					No Asbestos Detected

Interior**B00B - R0001 - Craft Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	3927/B00B/R0009/Floor Coverings Res/Textile/S10					No Asbestos Detected

B00B - R0002 - Home Base

Chalk Board	Flat AC Sheeting					
	3927/B00B/R9002/Chalk Board/S3					No Asbestos Detected

B00B - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Sheet					
	3927/B00B/R0007/Floor Coverings Res/Textile/S11					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	East, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00B/R0014/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00B - R0004 - Toilets - Boys/Girls

No Asbestos

B00B - R0005 - Toilets - Boys/Girls

No Asbestos

B00B - R0006 - Home Base

Chalk Board	Flat AC Sheeting					
	3927/B00B/R9002/Chalk Board/S3					No Asbestos Detected

B00B - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Sheet					
	3927/B00B/R0007/Floor Coverings Res/Textile/S11					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00B - R0008 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	5m2	East, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0014/Wall Linings Internal/S9					Chrysotile (white asbestos)	
B00B - R0009 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
3927/B00B/R0009/Floor Coverings Res/Textile/S10					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	20m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0014/Wall Linings Internal/S9					Chrysotile (white asbestos)	
B00B - R0014 - Staff Room Annexe						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	60m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0014/Wall Linings Internal/S9					Chrysotile (white asbestos)	
B00B - R0015 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
3927/B00B/R0017/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B00B - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
3927/B00B/R0017/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B00B - R0017 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Sheet					
3927/B00B/R0017/Floor Coverings Res/Textile/S7					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0018 - Withdrawal Space - 1hb						
No Asbestos						
B00B - R0019 - General Storeroom						
No Asbestos						
B00B - R0020 - Communal Space						
Chalk Board	Flat AC Sheeting					
3927/B00B/R9002/Chalk Board/S3					No Asbestos Detected	
B00B - R0021 - Disabled Toilet						
No Asbestos						
B00B - R0022 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3927/B00B/R0017/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	86m2	Upper portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
3927/B00B/R0014/Wall Linings Internal/S9					Chrysotile (white asbestos)	
B00B - R9001 - General Storeroom						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R9002 - Special Programs Room

Chalk Board	Flat AC Sheeting		3927/B00B/R9002/Chalk Board/S3			No Asbestos Detected
-------------	------------------	--	--------------------------------	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Building Services - 1984 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible, slab to ground no access hatch.					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00C/Gable Verge Lining/S27			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting					
	3927/B00C/R0002/Ceiling Structures/Linings/S2			No Asbestos Detected		

Interior

B00C - R0001 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00C/R0004/Partition Walls (Cubicles)/S1			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					
	3927/B00C/R0002/Ceiling Structures/Linings/S2			No Asbestos Detected		

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	3927/B00C/R0002/Ceiling Structures/Linings/S2			No Asbestos Detected		

B00C - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting					
	3927/B00C/R0002/Ceiling Structures/Linings/S2			No Asbestos Detected		

B00C - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00C/R0004/Partition Walls (Cubicles)/S1			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					
	3927/B00C/R0002/Ceiling Structures/Linings/S2			No Asbestos Detected		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1984 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible no access point.					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3927/B00D/Eaves Linings/S4					No Asbestos Detected

Interior

B00D - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 3927/B00D/R0002/Ceiling Structures/Linings/S5					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 3927/B00D/R0003/Partition Walls (Cubicles)/S6					No Asbestos Detected

B00D - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3927/B00D/R0002/Ceiling Structures/Linings/S5					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00D - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 3927/B00D/R0002/Ceiling Structures/Linings/S5					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 3927/B00D/R0003/Partition Walls (Cubicles)/S6					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services/Administration - 1962 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 3927/B00E/Eaves Linings/S21					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 3927/B00E/Wall Cladding/S22					No Asbestos Detected

Interior

B00E - R0001 - Cleaning Supplies

No Asbestos

B00E - R0002 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1962 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction 3.32m					
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00F/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Compressed AC Sheet	4m2	Panel to South Wall of Room 003	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00F/In-fill-panel/S20					Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00F - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00F/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0011 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3927/B00F/R0005/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0012 - Home Base

No Asbestos

B00F - R0013 - Home Base

No Asbestos

B00F - R0014 - Home Base Store

No Asbestos

B00F - R0015 - Home Base

No Asbestos

B00F - R0016 - External Movement

No Asbestos

B00F - R0017 - Practical Activities

Ceiling Structures/Linings	Non Accessible Area - No asbestos seen, however no access available to the original ceiling above the metal cladding to the ceiling. Assumed to be asbestos.
----------------------------	---

B00F - R9001 - No Access

No Asbestos

B00F - R9002 - General Storeroom

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 810 - D14129 - FSU/Shelter/Stores : Placement Date - 27/07/2004

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Canteen

No Asbestos Found.

R2 - Covered Area

No Asbestos Found.

R3 - Store

No Asbestos Found.

R4 - Sports Store

No Asbestos Found.

R5 - Garden Store

No Asbestos Found.

R6 - Change Room

No Asbestos Found.

R7 - Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017