


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Beverly Hills North Public School (3944)
Region : South Western Sydney
State Electorate : Lakemba
Local Government Area : Canterbury

Initial Survey : Noel Arnold & Associates : 21 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 03 - Jan - 2017

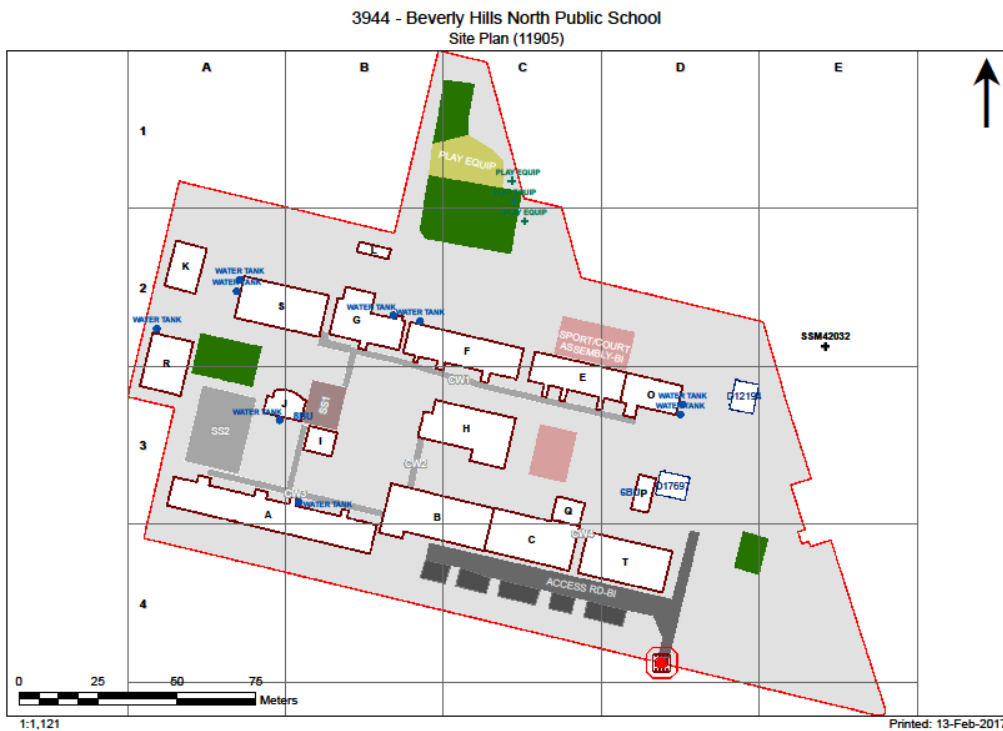

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1997 - Concrete (Concrete)

Exterior

Gable Verge Lining	Flat AC Sheeting 3944/B00A/Gable Verge Lining/S17					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 3944/B00A/Eaves Linings/S11	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0002 - Practical Activities - 1hb

No Asbestos

B00A - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0008 - Practical Activities - 1hb

No Asbestos

B00A - R0009 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0010 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0011 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0012 - Practical Activities - 1hb

No Asbestos

B00A - R0013 - Movement

No Asbestos

B00A - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	3944/B00A/R0014/Ceiling Structures/Linings/S2					

B00A - R0015 - Movement

No Asbestos

B00A - R0016 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0017 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0018 - Practical Activities - 1hb						
No Asbestos						
B00A - R0019 - Practical Activities - 1hb						
No Asbestos						
B00A - R0020 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0021 - Movement						
No Asbestos						
B00A - R0022 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0023 - Practical Activities - 1hb						
No Asbestos						
B00A - R0024 - Practical Activities - 1hb						
No Asbestos						
B00A - R0025 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0026 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0027 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00B - Administration - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Staff Room

No Asbestos

B00B - R0003 - Staff Room Annexe

No Asbestos

B00B - R0004 - Cleaning Distributed Store

No Asbestos

B00B - R0005 - Main Switch Board

No Asbestos

B00B - R0006 - Staff Toilet

No Asbestos

B00B - R0007 - Staff Toilet

No Asbestos

B00B - R0008 - Staff Toilet

No Asbestos

B00B - R0009 - Security Store

No Asbestos

B00B - R0010 - Principal

No Asbestos

B00B - R0011 - Clerical Office

No Asbestos

B00B - R0013 - Duplicating Workroom

No Asbestos

B00B - R0014 - Sick Bay

No Asbestos

B00B - R0015 - Sick Bay - Shower/Toilet

No Asbestos

B00B - R0016 - Interview

No Asbestos

B00B - R0017 - Deputy Principal

No Asbestos

B00B - R0018 - Staff Room Annexe

No Asbestos

B00B - R0020 - Movement

No Asbestos

B00B - R0021 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids	Flat AC Sheeting 3944/B00C/Underfloor Voids/S23					No Asbestos Detected
Ceiling Void	Non Accessible Area - No manhole in building					

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Reading Area

No Asbestos

B00C - R0003 - Library Office/Workroom

No Asbestos

B00C - R0004 - Communications Room

No Asbestos

B00C - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1950 - Concrete (Concrete)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00E/Eaves Linings/S12					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	3944/B00E/Gable Verge Lining/S18					
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	3944/B00E/Underfloor Voids/S24					Chrysotile (white asbestos)

Interior

B00E - R0006 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00E/R0017/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0007 - Home Base

No Asbestos

B00E - R0008 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00E/R0017/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0009 - Practical Activities - 1hb

No Asbestos

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Home Base Store

No Asbestos

B00E - R0012 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00E/R0017/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0013 - Practical Activities - 1hb

No Asbestos

B00E - R0014 - Home Base

No Asbestos

B00E - R0015 - Home Base Store

No Asbestos

B00E - R0016 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00E/R0017/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0017 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00E/R0017/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0018 - Movement

No Asbestos

B00E - R0019 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - R0020 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1950 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0004 - Home Base

No Asbestos

B00F - R0005 - Home Base

No Asbestos

B00F - R0006 - Home Base

No Asbestos

B00F - R0007 - Home Base

No Asbestos

B00F - R0011 - Movement

No Asbestos

B00F - R0013 - Special Programs Room

No Asbestos

B00F - R0014 - General Storeroom

No Asbestos

B00F - R0015 - Home Base Store

No Asbestos

B00F - R0016 - Practical Activities - 1hb

No Asbestos

B00F - R0017 - Movement

No Asbestos

B00F - R0018 - Movement

No Asbestos

B00F - R0019 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1997 - Concrete (Concrete)

Exterior

Eaves Linings	Flat AC Sheeting 3944/B00G/Eaves Linings/S13					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting 3944/B00G/Gable Verge Lining/S19	20m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Ends	Flat AC Sheeting 3944/B00G/Gable Ends/S22					No Asbestos Detected

Interior

B00G - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3944/B00G/R0001/Ceiling Structures/Linings/S25	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	------------	--------------------	---------	---

B00G - R0002 - Personal Effects Storage

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0004 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0005 - Practical Activities - 1hb

No Asbestos

B00G - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0007 - Home Base

In-fill-panel	Flat AC Sheeting 3944/B00G/R0007/In-fill-panel/S3					No Asbestos Detected
---------------	--	--	--	--	--	-----------------------------

B00G - R0008 - Practical Activities - 1hb

No Asbestos

B00G - R0009 - Personal Effects Storage

No Asbestos

B00G - R0010 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0011 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0012 - Toilets - Girls

No Asbestos

B00G - R0013 - Outdoor Learning Area

No Asbestos

B00G - R0014 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00H/Eaves Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	Non Accessible Area - No access - Manhole >6m high					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - General Storeroom

No Asbestos

B00H - R0002 - General Storeroom

No Asbestos

B00H - R0003 - Raised Platform

No Asbestos

B00H - R0004 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00H/R0005/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	3944/B00H/R0004/Floor Coverings Res/Textile/S10					No Asbestos Detected

B00H - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00H/R0005/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R0006 - Communal Space

No Asbestos

B00H - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00H/R0005/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R9001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1997 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B001 - R0001 - Canteen

No Asbestos

B001 - R0002 - Canteen Office/Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1997 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00J/Eaves Linings/S15			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00J - R0001 - Toilets - Girls

No Asbestos

B00J - R0002 - Toilets - Boys

No Asbestos

B00J - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other-Community Use - 1950 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting 3944/B00K/Wall Cladding/S1					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - Movement

No Asbestos

B00K - R0002 - Uniform Shop

No Asbestos

B00K - R0003 - Other-After School Care

No Asbestos

B00K - R0004 - Staff Room Annexe

No Asbestos

B00K - R0005 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities/Building Services - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B00L - R0001 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3944/B00L/R0002/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00L - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3944/B00L/R0002/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 1950 - Concrete (Concrete)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00E/Eaves Linings/S12					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	3944/B00E/Gable Verge Lining/S18					
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B000 - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00O/R0007/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B000 - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00O/R0007/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00O/R0006/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B000 - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00O/R0007/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00O/R0006/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B000 - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00O/R0007/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B000 - R0009 - Home Base

No Asbestos

B000 - R0010 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3944/B00O/R0007/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B000 - R0011 - Home Base Store

No Asbestos

B000 - R0012 - Withdrawal Space - 1hb

No Asbestos

B000 - R0013 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting 3944/B00P/Gable Verge Lining/S20					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 3944/B00P/Eaves Linings/S16					No Asbestos Detected
Ceiling Void	Non Accessible Area - No manhole in building					
Gable Ends	Flat AC Sheeting 3944/B00P/Gable Ends/S21					No Asbestos Detected

Interior

B00P - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 3944/B00P/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3944/B00P/R0001/Wall Linings Internal/S6					No Asbestos Detected

B00P - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 3944/B00P/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3944/B00P/R0001/Wall Linings Internal/S6					No Asbestos Detected

B00P - R0003 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting 3944/B00P/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Tiered Learning - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	Non Accessible Area - No Access - No key tp manhole padlock on site

Interior

B00Q - R0001 - Cleaning Distributed Store

No Asbestos

B00Q - R0002 - Special Programs Room

No Asbestos

B00Q - R0003 - Plant

No Asbestos

B00Q - R0004 - Special Programs Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 2005 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00R - R0001 - Movement

No Asbestos

B00R - R0002 - Practical Activities - 1hb

No Asbestos

B00R - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00R - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00R - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00R - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00R - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00R - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00S - R0001 - Practical Activities - 3hb

No Asbestos

B00S - R0002 - Home Base

No Asbestos

B00S - R0003 - Home Base Store

No Asbestos

B00S - R0004 - Withdrawal Space - 1hb

No Asbestos

B00S - R0005 - Practical Activities - 2hb

No Asbestos

B00S - R0006 - Home Base

No Asbestos

B00S - R0007 - Home Base Store

No Asbestos

B00S - R0008 - Withdrawal Space - 1hb

No Asbestos

B00S - R0009 - Practical Activities - 1hb

No Asbestos

B00S - R0010 - Home Base

No Asbestos

B00S - R0011 - Home Base Store

No Asbestos

B00S - R0012 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00S - R0013 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00T - R0001 - Practical Activities - 3hb

No Asbestos

B00T - R0002 - Home Base

No Asbestos

B00T - R0003 - Home Base Store

No Asbestos

B00T - R0004 - Withdrawal Space - 1hb

No Asbestos

B00T - R0005 - Practical Activities - 2hb

No Asbestos

B00T - R0006 - Home Base

No Asbestos

B00T - R0007 - Home Base Store

No Asbestos

B00T - R0008 - Withdrawal Space - 1hb

No Asbestos

B00T - R0009 - Practical Activities - 1hb

No Asbestos

B00T - R0010 - Home Base

No Asbestos

B00T - R0011 - Home Base Store

No Asbestos

B00T - R0012 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00T - R0013 - External Movement

No Asbestos

B00T - R9001 - General Storeroom

No Asbestos

B00T - R9002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 603 - D12194 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 11/12/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D17697 - Learning Unit - Standard With P.A.A. : Placement Date - 2/07/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017